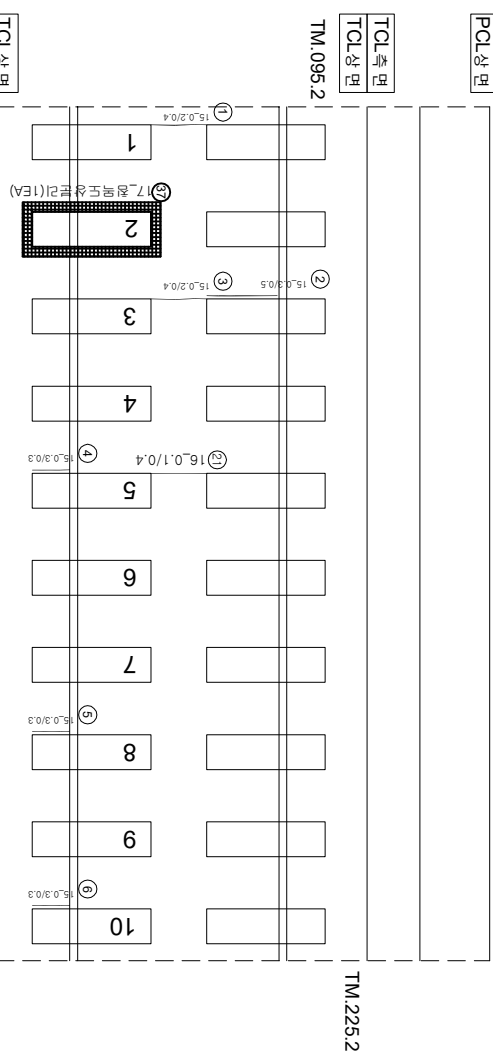


호남고속선 정지 고가_1198(65.241~65.247km, S229-3)

65K247


65K241


$$\left(\begin{array}{c} \text{아} \\ \text{하} \\ \text{아} \\ \text{포} \end{array} \right)$$

(하와이)



PCL 54 頁

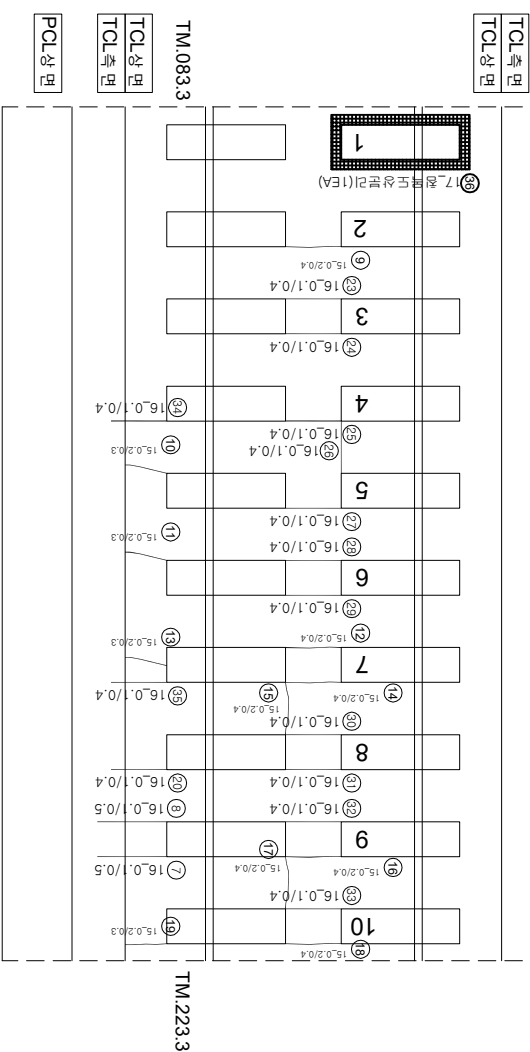

T2
($\frac{0}{\pi}$, $\frac{0}{\pi}$)

(유형)

연번	순상	복	연강	비고	연번	순상	복	연강	비고
1	균열	0.2 mm	0.4 m		55				
2	강좌부 균열	0.3 mm	0.5 m		56				
3	균열	0.2 mm	0.4 m		57				
4	강좌부 균열	0.3 mm	0.3 m		58				
5	강좌부 균열	0.3 mm	0.3 m		59				
6	강좌부 균열	0.3 mm	0.3 m		60				
7	균열	0.1 mm	0.5 m		61				
8	균열	0.1 mm	0.5 m		62				
9	균열	0.2 mm	0.4 m		63				
10	균열	0.2 mm	0.3 m		64				
11	균열	0.2 mm	0.3 m		65				
12	균열	0.2 mm	0.4 m		66				
13	균열	0.2 mm	0.3 m		67				
14	균열	0.2 mm	0.4 m		68				
15	균열	0.2 mm	0.4 m		69				
16	균열	0.2 mm	0.4 m		70				
17	균열	0.2 mm	0.4 m		71				
18	균열	0.2 mm	0.4 m		72				
19	균열	0.2 mm	0.3 m		73				
20	균열	0.1 mm	0.4 m		74				
21	균열	0.1 mm	0.4 m		75				
22	균열	0.2 mm	0.8 m		76				
23	균열	0.1 mm	0.4 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.1 mm	0.4 m		79				
26	균열	0.1 mm	0.4 m		80				
27	균열	0.1 mm	0.4 m		81				
28	균열	0.1 mm	0.4 m		82				
29	균열	0.1 mm	0.4 m		83				
30	균열	0.1 mm	0.4 m		84				
31	균열	0.1 mm	0.4 m		85				
32	균열	0.1 mm	0.4 m		86				
33	균열	0.1 mm	0.4 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.1 mm	0.4 m		89				
36	점록 도상분리	1.0 ea	신규		90				
37	점록 도상분리	1.0 ea	신규		91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행	사	영	여	명	영	여	사	과	영	영	간	 0.220 (0.300이하 : 흑색)  0.4420 (0.300초과 0.500이하 : 청색)  0.6620 (0.500초과 1.000미만 : 적색)  1.0020 (1.000이상 : 분홍색)	 침묵도상분리  망상  바리,바릭,핀손  백태	 재료분리  철근노출  누수,수면부  시공이음분리,중분리
									과	영	영				
 한국철도공사 KOREA RAILROAD									이 복 영						
2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용여									(주)한국국토물안전재구원 (주)한국국토안전연구원 (재)한국건설품질연구원						