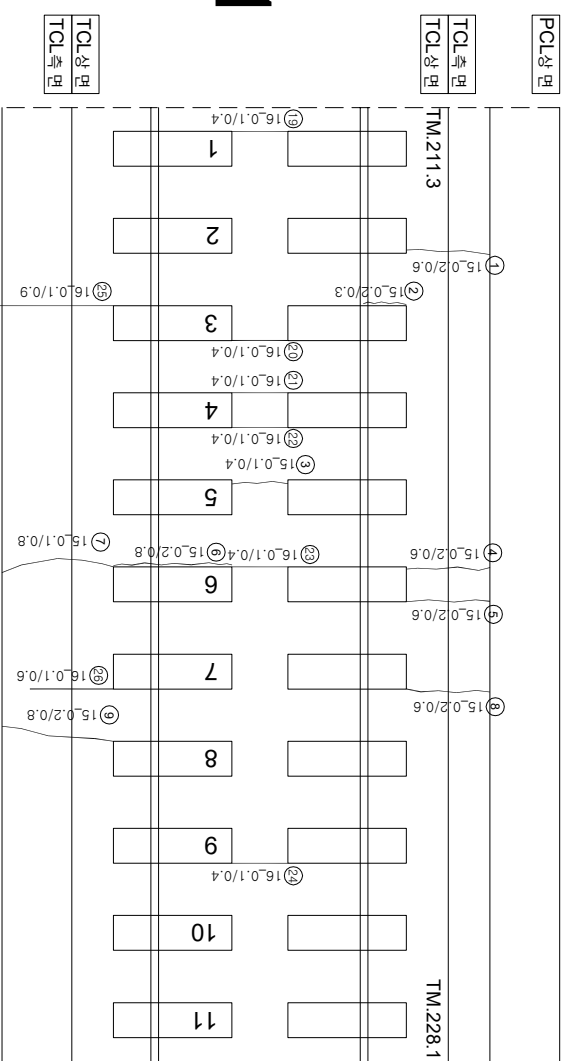


호남고속선 정지고가_321(59.131~59.138km, S60-4)

59K138

59K131


$$\left(\begin{array}{c} \text{아} \\ \text{0호} \end{array} \right)$$


(아호)

TCL 상면
TCL 측면

TCL 集团

PCL 상용

PCL 상면

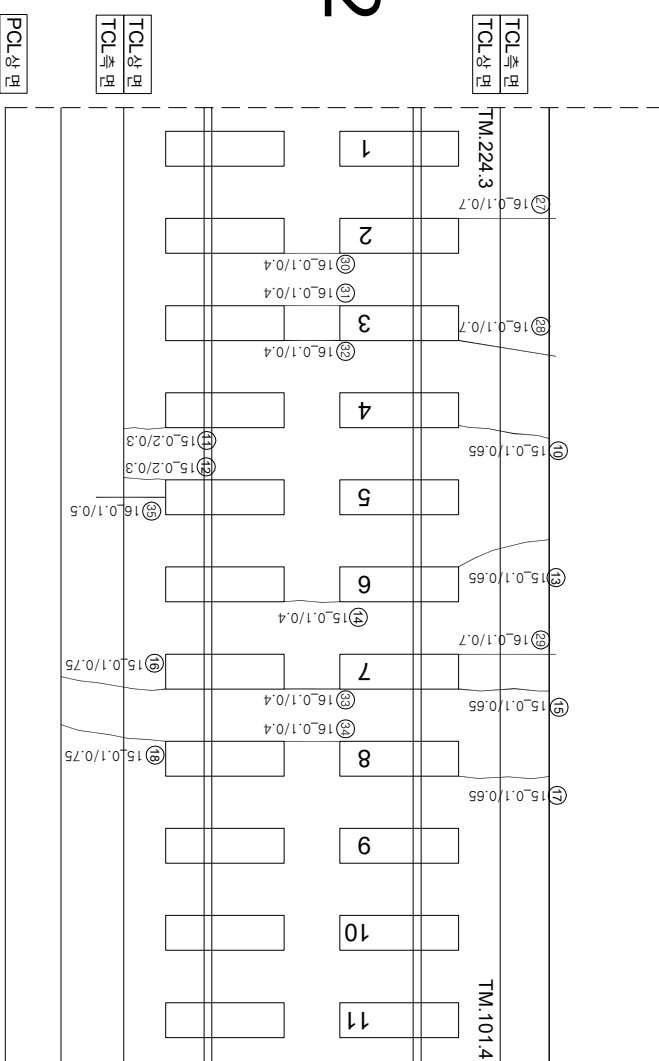

T2
(σ_{H} , σ_{H})

(가) 0원

TCL상면	TCL측면
-------	-------

TCL 集团

PCL 상면

PCL상표

연번	순상	목	연장	비고	연번	순상	목	연장	비고
1	균열	0.2 mm	0.6 m		55				
2	강재부 균열	0.2 mm	0.3 m		56				
3	균열	0.1 mm	0.4 m		57				
4	균열	0.2 mm	0.6 m		58				
5	균열	0.2 mm	0.8 m		59				
6	강재부 균열	0.2 mm	0.8 m		60				
7	균열	0.1 mm	0.8 m		61				
8	균열	0.2 mm	0.6 m		62				
9	균열	0.1 mm	0.8 m		63				
10	균열	0.1 mm	0.7 m		64				
11	균열	0.2 mm	0.3 m		65				
12	균열	0.2 mm	0.3 m		66				
13	균열	0.1 mm	0.7 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열	0.1 mm	0.7 m		69				
16	균열	0.1 mm	0.8 m		70				
17	균열	0.1 mm	0.7 m		71				
18	균열	0.1 mm	0.8 m		72				
19	균열	0.1 mm	0.4 m		73				
20	균열	0.1 mm	0.4 m		74				
21	균열	0.1 mm	0.4 m		75				
22	균열	0.1 mm	0.4 m		76				
23	균열	0.1 mm	0.4 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.1 mm	0.9 m		79				
26	균열	0.1 mm	0.6 m		80				
27	균열	0.1 mm	0.7 m		81				
28	균열	0.1 mm	0.7 m		82				
29	균열	0.1 mm	0.7 m		83				
30	균열	0.1 mm	0.4 m		84				
31	균열	0.1 mm	0.4 m		85				
32	균열	0.1 mm	0.4 m		86				
33	균열	0.1 mm	0.4 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.1 mm	0.5 m		89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]