


호남고속선 정지고가 _725(61.970~61.977km, S136-4)

61K970


61K977
136 SPAN - 4

PCL상면

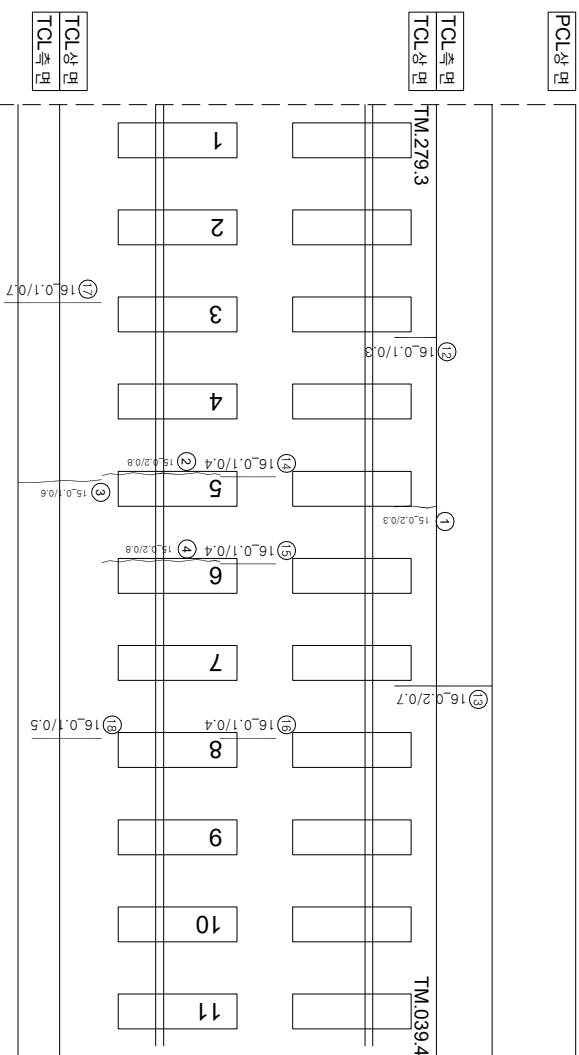

TCL상면	TCL측면
-------	-------

PCL 상면

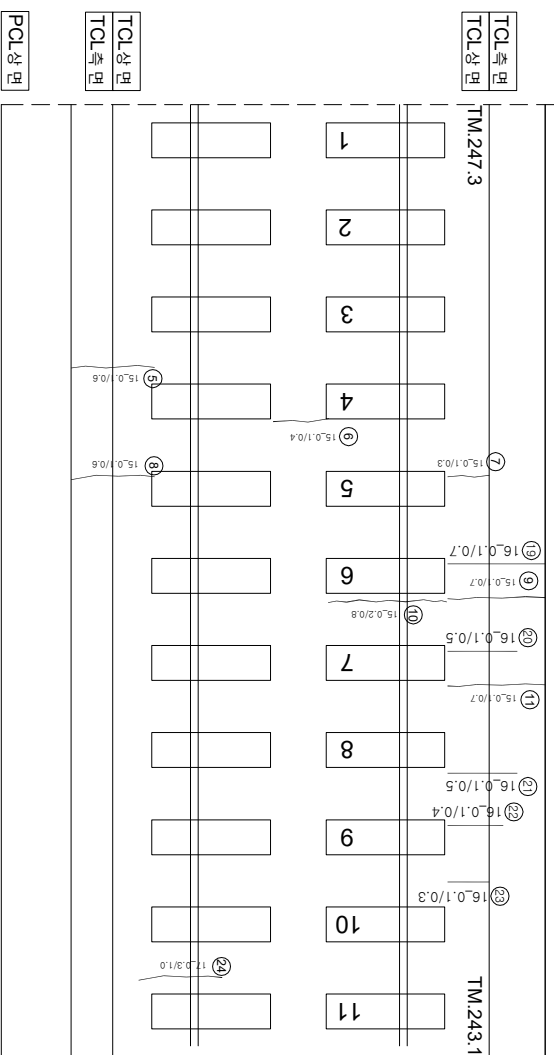

TCL 集团	TCL 集团
--------	--------

TCL상면	TCL측면
-------	-------

PCL상면

연번	순상	폭	면적	비고	연번	순상	폭	면적	비고
1	균열	0.2 mm	0.3 m		55				
2	경계부 균열	0.2 mm	0.8 m		56				
3	균열	0.1 mm	0.6 m		57				
4	경계부 균열	0.2 mm	0.8 m		58				
5	균열	0.1 mm	0.6 m		59				
6	균열	0.1 mm	0.4 m		60				
7	균열	0.1 mm	0.3 m		61				
8	균열	0.1 mm	0.6 m		62				
9	균열	0.1 mm	0.7 m		63				
10	경계부 균열	0.2 mm	0.8 m		64				
11	균열	0.1 mm	0.7 m		65				
12	균열	0.1 mm	0.3 m		66				
13	균열	0.2 mm	0.7 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열	0.1 mm	0.4 m		69				
16	균열	0.1 mm	0.4 m		70				
17	균열	0.1 mm	0.7 m		71				
18	균열	0.1 mm	0.5 m		72				
19	균열	0.1 mm	0.7 m		73				
20	균열	0.1 mm	0.5 m		74				
21	균열	0.1 mm	0.5 m		75				
22	균열	0.1 mm	0.4 m		76				
23	균열	0.1 mm	0.3 m		77				
24	균열	0.3 mm	1.0 m	신규	78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]