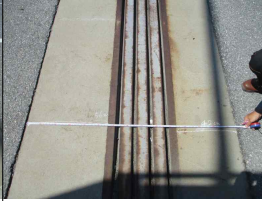
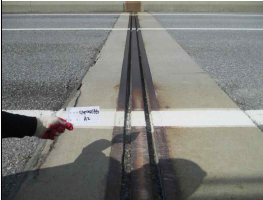
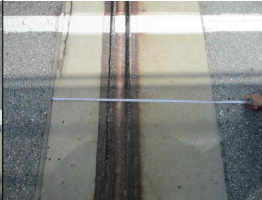


□ 단양대교(춘천) 신축이음장치 점검결과

위 치	점 검 결 과				
A1	1	2	3	4	5
					
	전 경 (상 부)	일평균기온:23.3℃ 신축이음유간:1.8cm	일평균기온:17.0℃ 신축이음유간:2.0cm	일평균기온:23.3℃ 하부유간:5.5cm	일평균기온:17.0℃ 하부유간:5.2cm
A2	1	2	3	4	5
					
	전 경 (상 부)	일평균기온:23.3℃ 신축이음유간:2.0cm	일평균기온:17.0℃ 신축이음유간:1.2cm	일평균기온:23.3℃ 하부유간:3.0m	일평균기온:17.0℃ 하부유간:3.1cm

□ 단양대교(춘천) 교량반침 점검결과

위 치	점 검 결 과				
A1 SH-1	1	2	3	4	5
					
	전 경	일평균기온:24.0℃ 이동량: A2 5.5cm	일평균기온:17.0℃ 이동량: A2 6.0cm	연단거리: A2 52cm	
A1 SH-2	1	2	3	4	5
					
	전 경	일평균기온:24.0℃ 이동량: A2 5.5cm	일평균기온:17.0℃ 이동량: A2 6.0cm	연단거리: A2 52cm	
P1 SH-1	1	2	3	4	5
					
	전 경	일평균기온:24.0℃ 이동량: A2 0.4cm	일평균기온:24.0℃ 이동량: A2 1.0cm	연단거리: A1(470cm) 연단거리: A2(470cm)	
P1 SH-2	1	2	3	4	5
					
	전 경	일평균기온:24.0℃ 이동량: A2 0.6cm	일평균기온:17.0℃ 이동량: A2 1.0cm	연단거리: A1(470cm) 연단거리: A2(470cm)	
A2 SH-1	1	2	3	4	5
					
	전 경	일평균기온:24.0℃ 이동량: A1 5.6cm	일평균기온:17.0℃ 이동량: A1 6.0cm	연단거리: A1 60cm	

위 치	점 검 결 과				
A2 SH-2	1	2	3	4	5
					
	전 경	일평균기온:24.0℃ 이동량: A1 5.5cm	일평균기온:17.0℃ 이동량: A1 6.0cm	연단거리: A1 60cm	