

← 용인

여주 →

① 난간 및 연석

② 교면포장

③ 중앙분리대

용인방향

025 용인진행
~29

② 연석 균열
0.3/0.75, 8EA

① 토사회적
10.0X0.5

③ 중분대 균열
0.2/1.0

A1

A2

035.23


검측
포장균열
L=8.0m
상
033.34

031.32

KEY PLAN

용인방향
시점측

여주방향
중점측

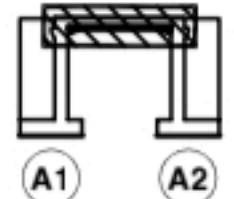

SECTION



No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1	토사퇴적	-	-	10.0	0.5	1	5.00	m²	
2	연석 균열	-	0.3	0.75	-	8	6.00	m	
3	중분대 균열	-	0.2	1.0	-	1	1.00	m	
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

CW/0.2	균열			용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역
	파손, 탈락			구조물명	백록육교
	바리, 박락			조사일자	2024. 10
	표면오염			책임자	한은택
	토사퇴적			도면번호	001


ID : 바닥판 하면 (S1) 외관조사망도

손상물량표

236 폭면경
237 바닥 하부경
238 A1고려경
239 A2 고려경

여주 →

← 용인

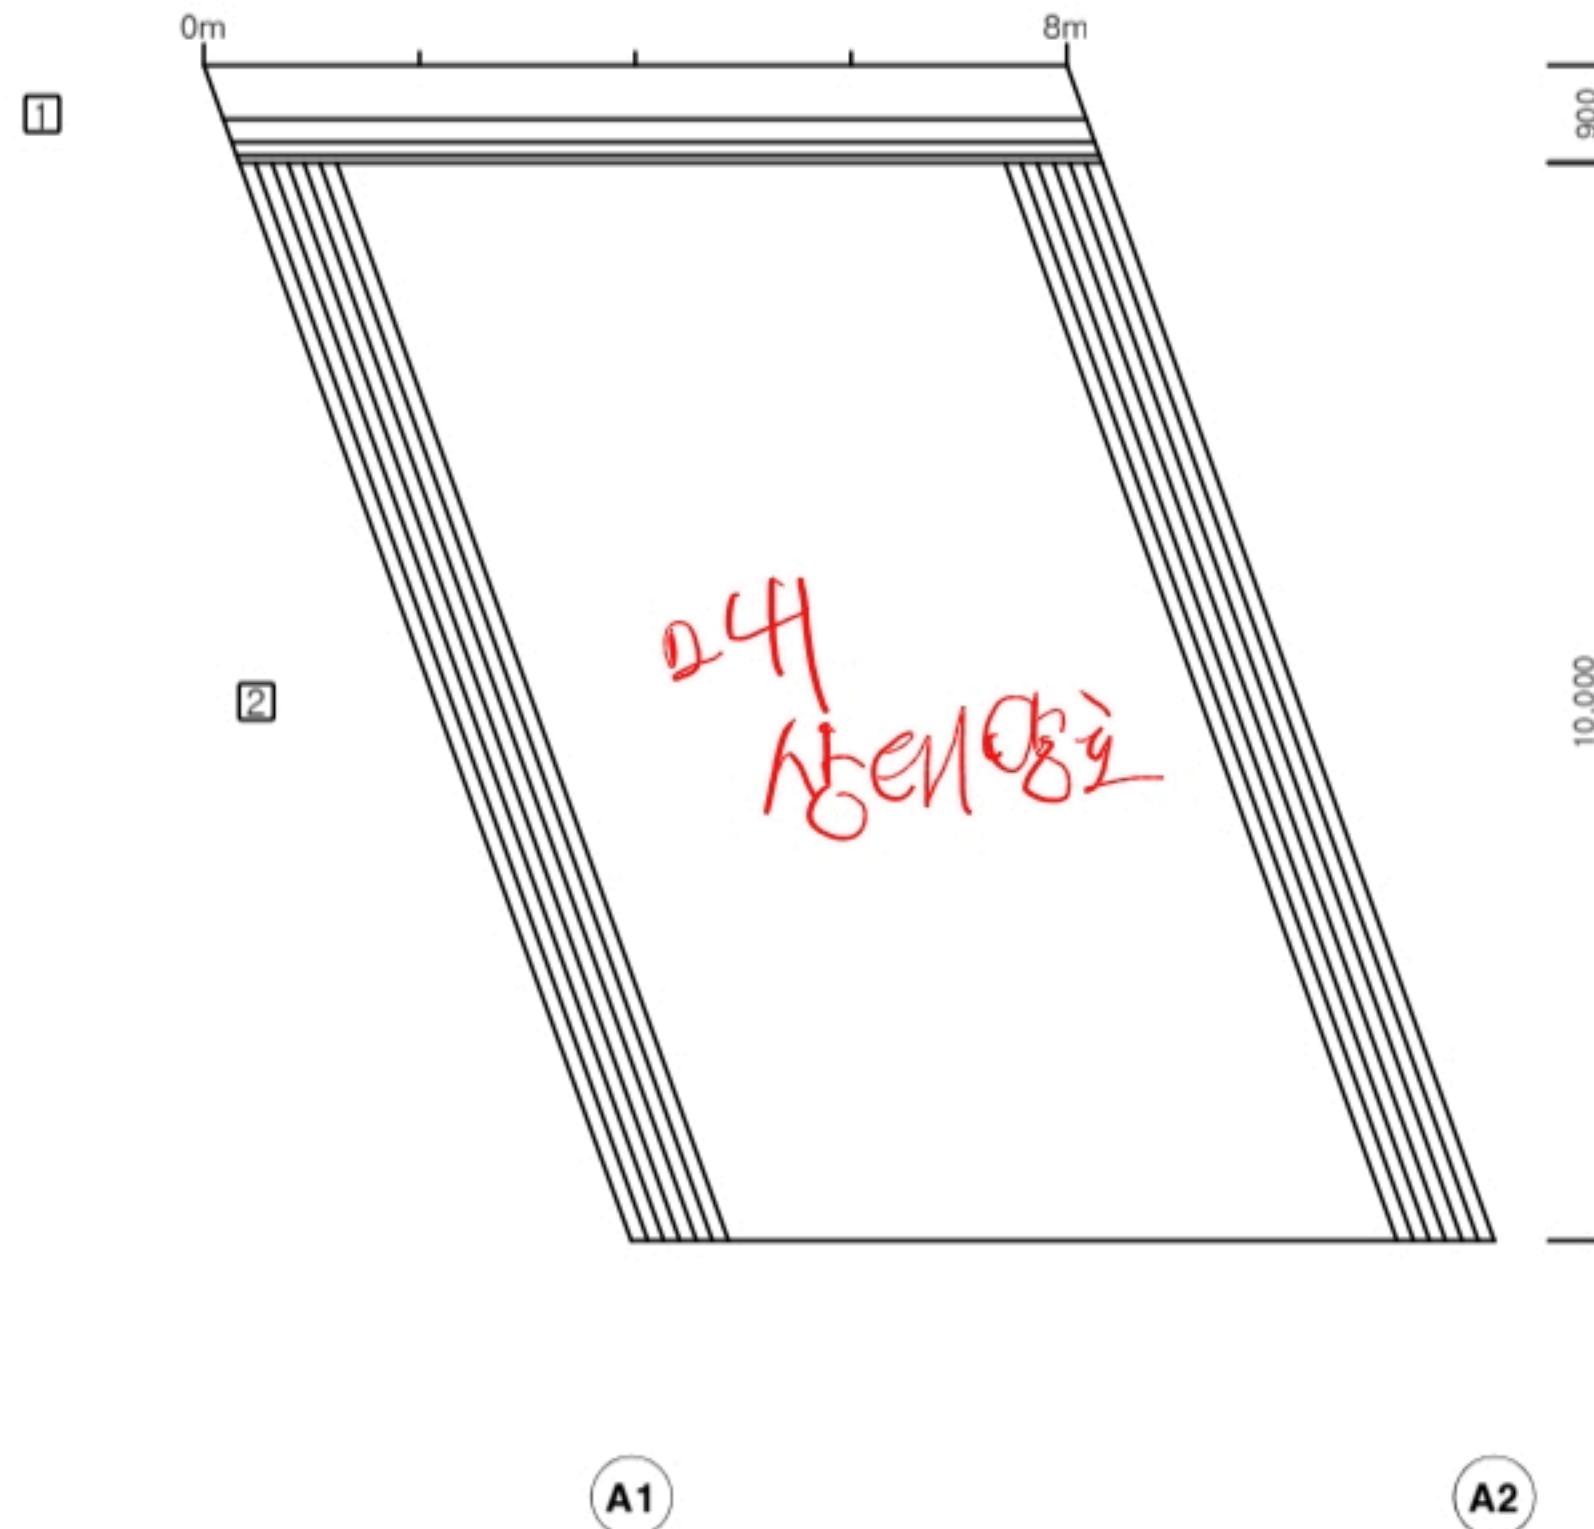


No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1									
2									
3									
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN


SECTION

용인방향
시점측

여주방향
종점측

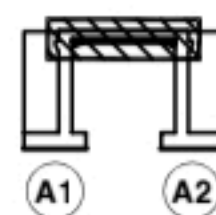

용인방향

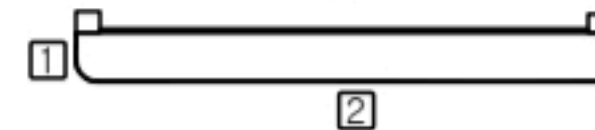


범	구분	내용	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역
표	파손, 탈락	상상균열	철근노출	구조물명
표	바리, 박락	재료분리	백 배	조사일자
표	표면오염	누수, 체수	좌굴, 변형	책 임 자
표	토사퇴적	보 수 부	부 식	도면번호
	기 타	배수구막힘		

002


ID : 교대 (A1) 외관조사망도

손상물량표

용인방향

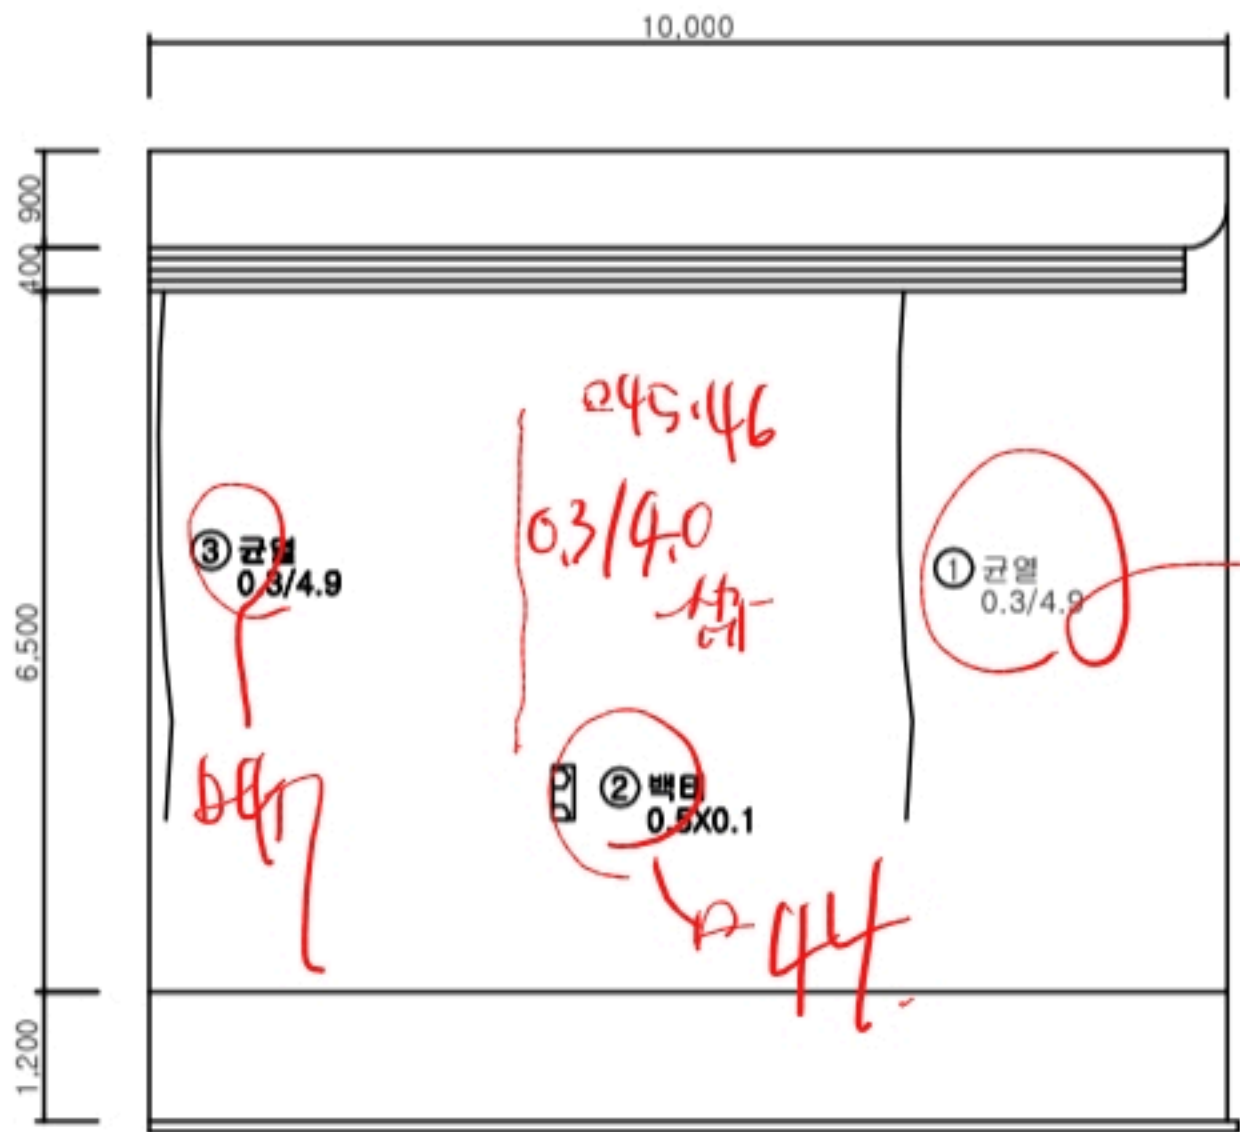

정면

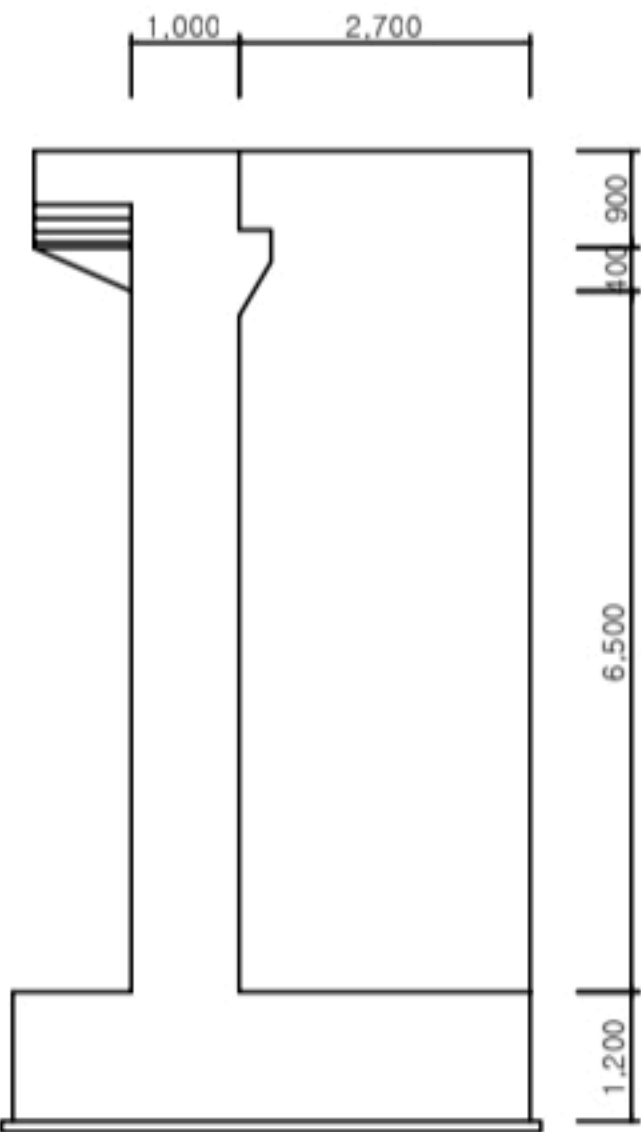

우측면

No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1	균열	-	0.3	4.9	-	1	4.90	m	
2	백태	-	-	0.5	0.1	1	0.05	m²	
3	균열	-	0.3	4.9	-	1	4.90	m	
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN


SECTION

범례	CW/0.2	균열	망상균열	철근노출	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역
	파손, 탈락	재표본리	백태	구조물명	백록육교	
	바리, 박락	누수, 체수	좌굴, 변형	조사일자	2024. 10	
	표면오염	보수부	부식	책임자	한은택	
	토사퇴적	기타	배수구막힘	도면번호	003	

ID : 교대 (A2) 외관조사망도

손상물량표

용인방향

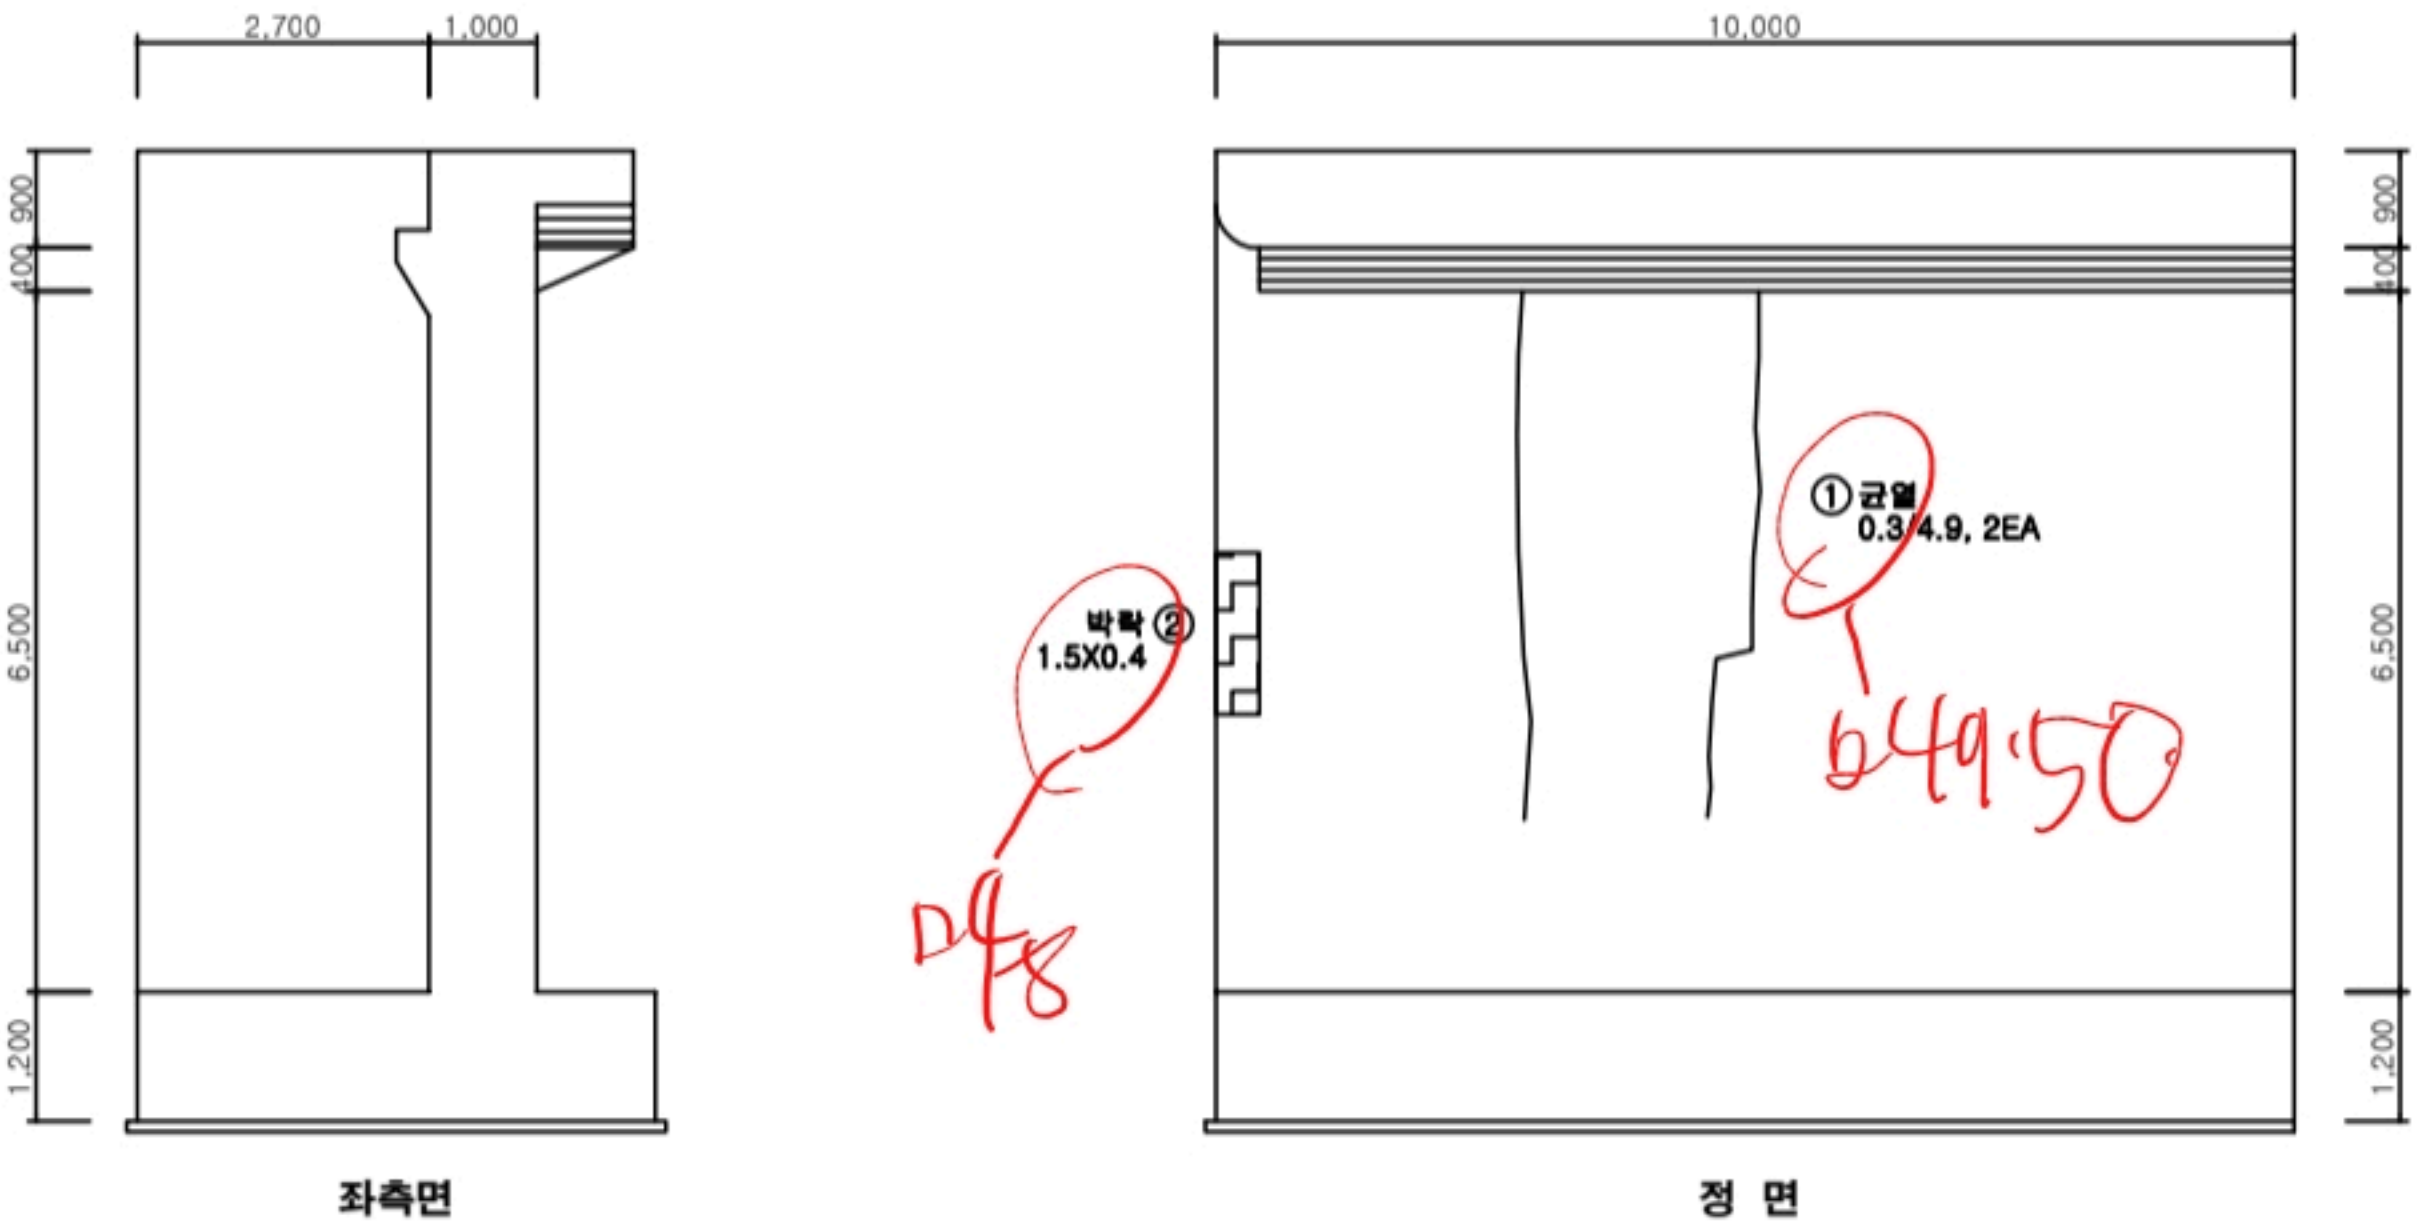


No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1	균열	-	0.3	4.9	-	2	1.00	m	
2	박락	-	-	1.5	0.4	1	1.00	m²	
3									
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN

SECTION

범례	CW/0.2	균열		망상균열		철근노출	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역	
		파손, 탈락		재표본리		백태	구조물명	백록육교	
		박리, 박락		누수, 체수		좌굴, 변형	조사일자	2024. 10	
		표면오염		보수부		부식	책임자	한은택	
		토사퇴적		기타		배수구막힘	도면번호	004	

용인방향
시점측

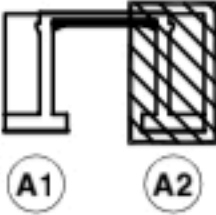

여주방향
종점측




11/4~18 여주진행

손상물량표

여주방향

← 용인

여주 →

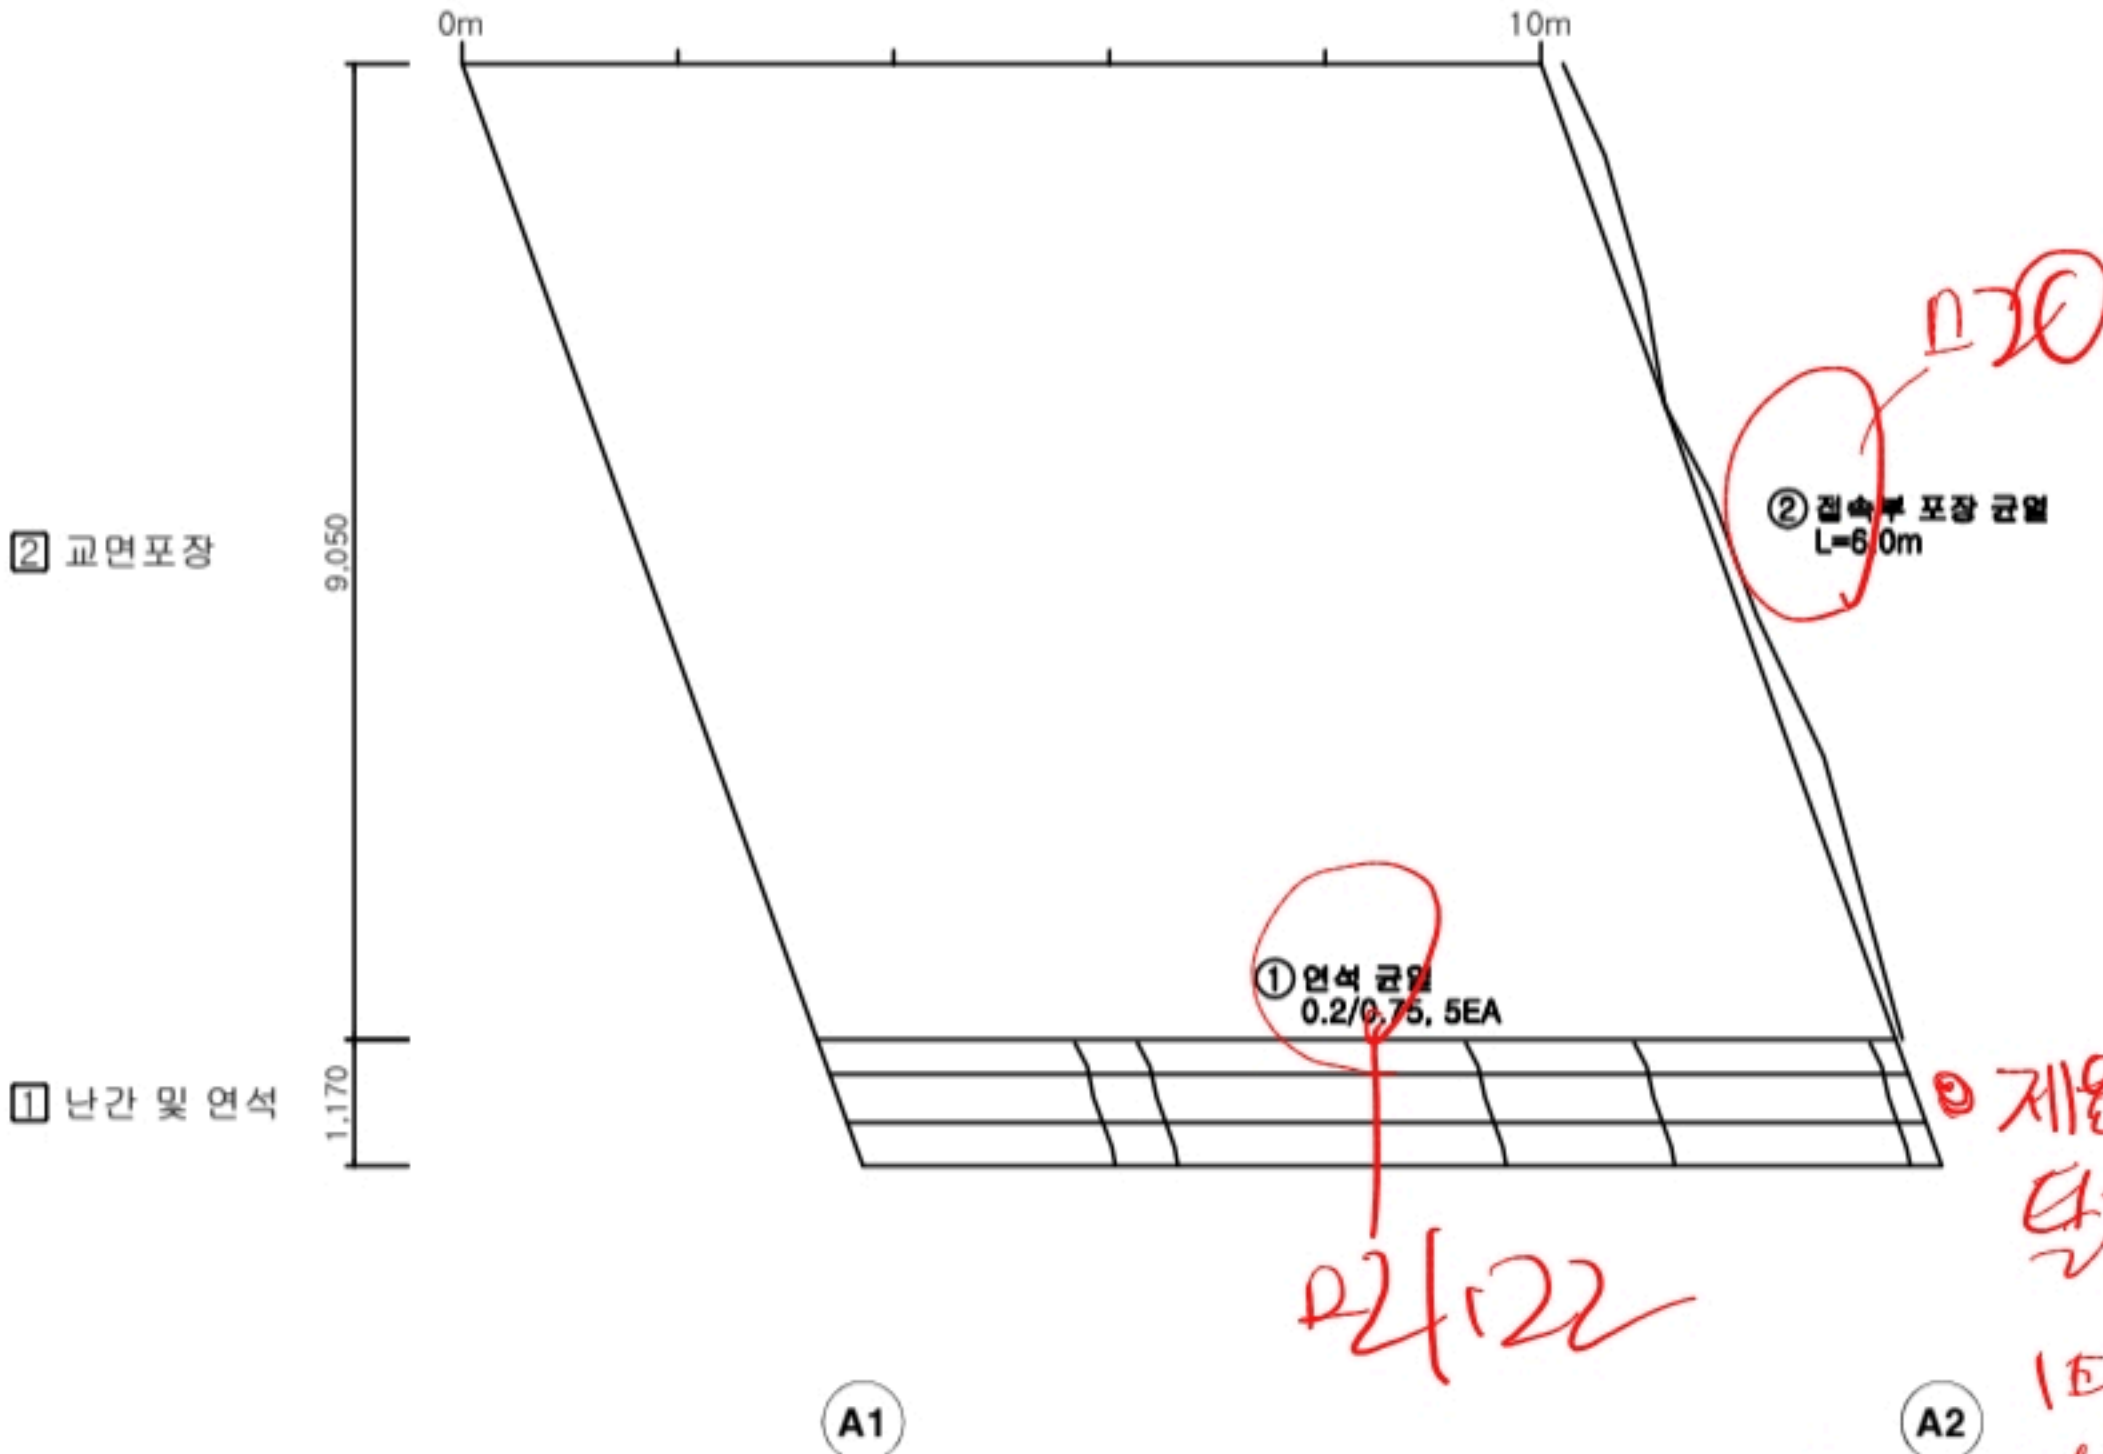

12/122
12년 교량 관점
제원판
단각
1타
신규
11/9


No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1	연석 균열	-	0.2	0.75	-	5	3.75	m	
2	접속부 포장 균열	-	-	6.0	-	1	6.00	m	
3									
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN

SECTION

용인방향
시점측

여주방향
중점측

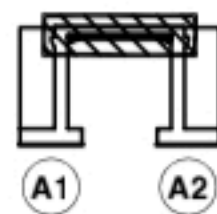

 CW/0.2	관 열	 망상균열	 철근노출	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역
 파손, 탈락	 재토분리	 백태	구조물명	백록육교	
 바리, 박락	 누수, 체수	 좌굴, 변형	조사일자	2024. 10	
 표면오염	 보수부	 부식	책임자	한은택	
 토사퇴적	 기타	 배수구막힘	도면번호	005	

ID : 바닥판 하면 (S1) 외관조사망도

손상물량표


DS1~53 진정 A1-A2..

여주방향

← 용인

DS55 측면

여주 →

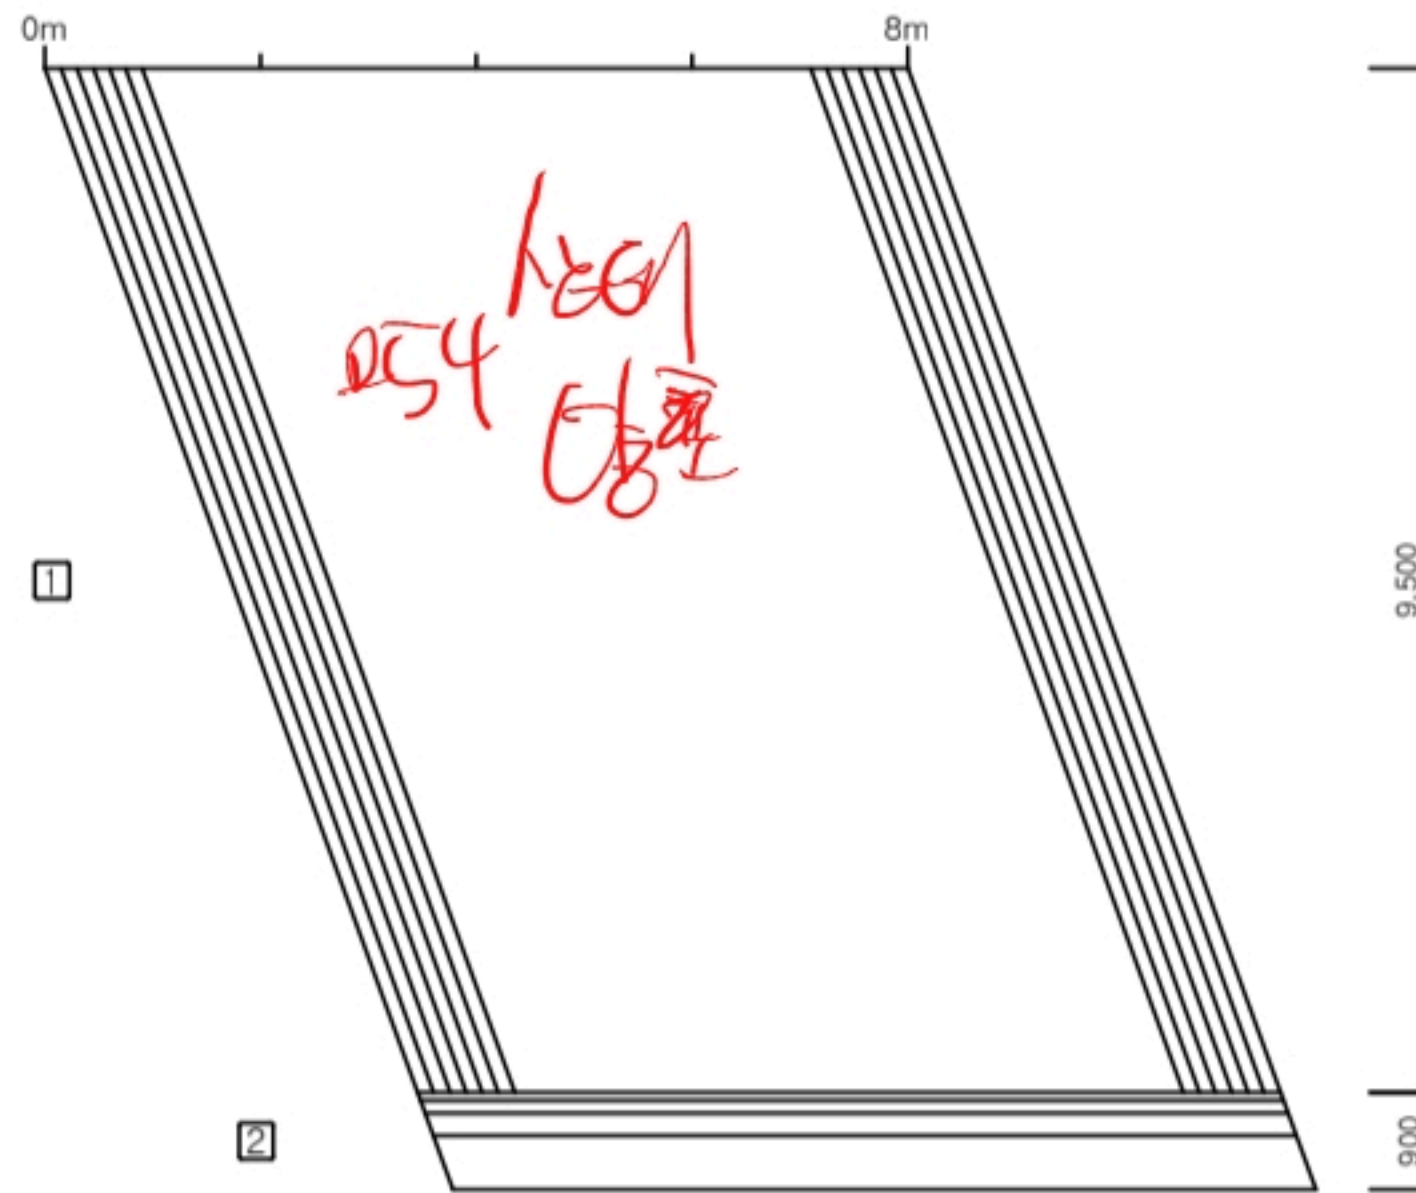


No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1									
2									
3									
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN


SECTION

← 용인방향
시점측

→ 여주방향
종점측

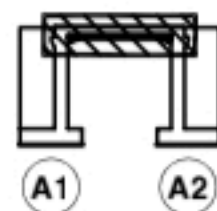

↑ 여주방향

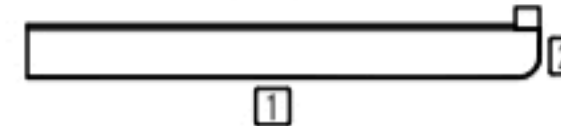


범	구분	구분	구분	구분	구분	구분	구분	구분	구분
범	CW/0.2	균열	망상균열	X-X	철근노출	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역	구조물명	백록육교
범	파손, 탈락	재토분리	누수, 체수	파괴, 변형	부식	조사일자	2024. 10	책임자	한은택
범	표면오염	보수부	기타	배수구막힘	도면번호		006		


ID : 교대 (A1) 외관조사망도

손상물량표

여주방향

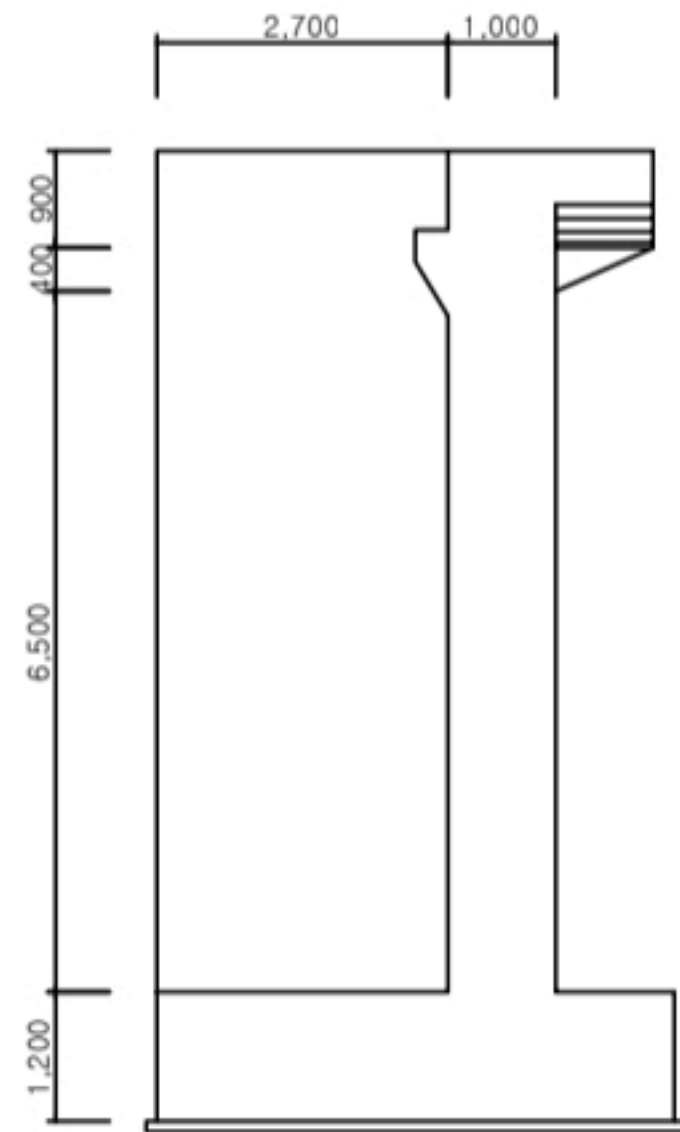

좌측면

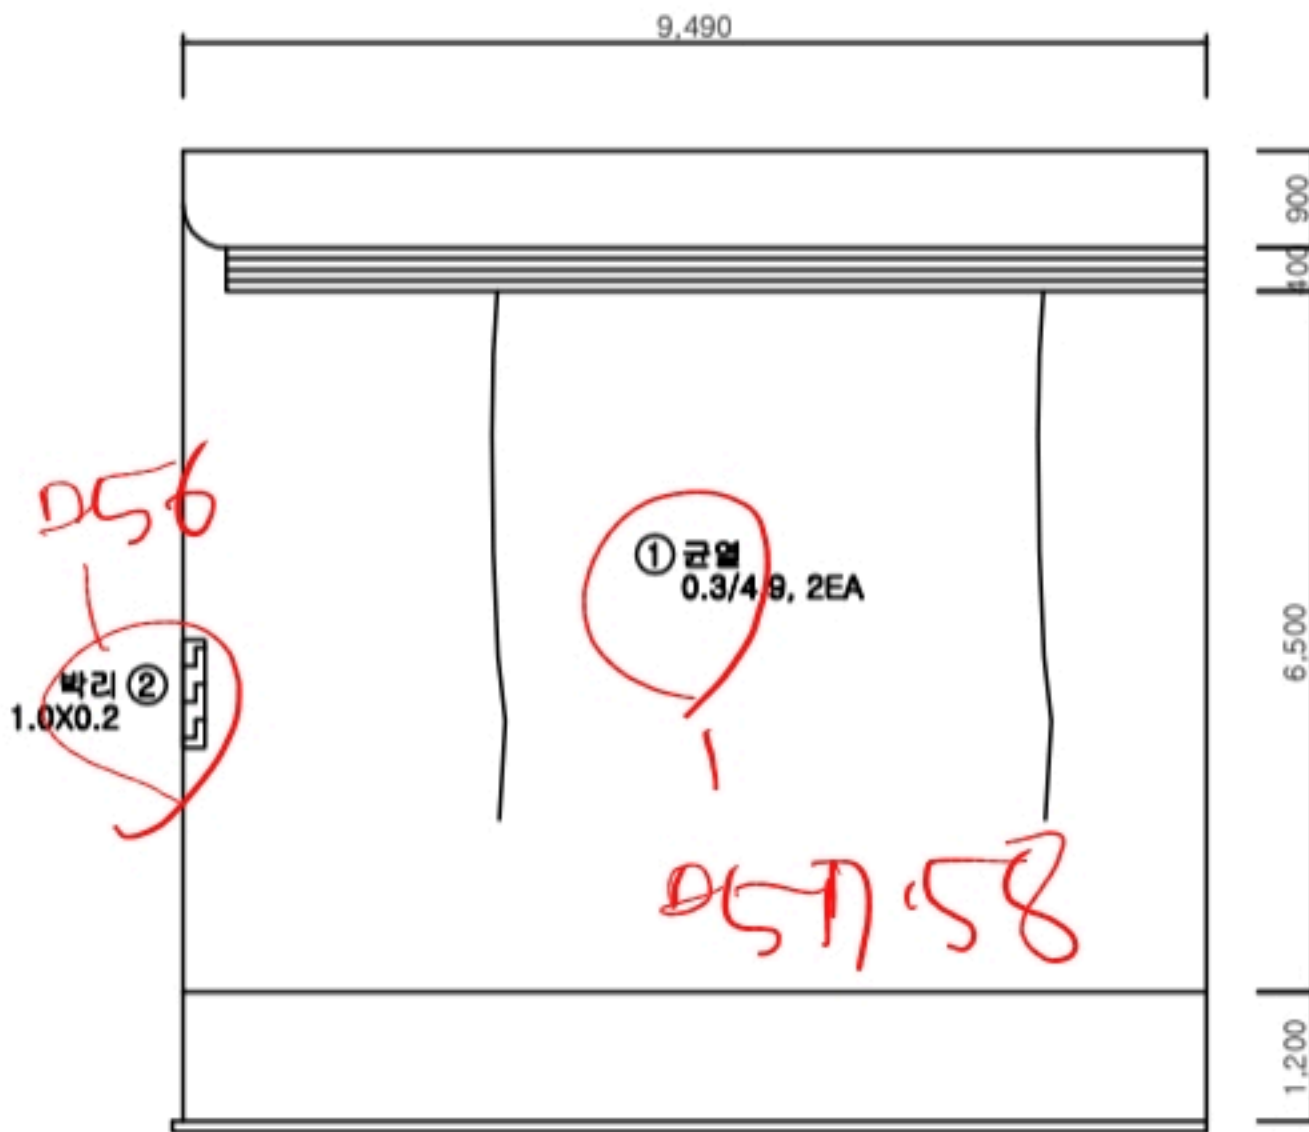


정면

No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1	균열	-	0.3	4.9	-	2	9.80	m	
2	박리	-	-	1.0	0.2	1	0.20	m²	
3									
4									
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN

SECTION

용인방향
시점측

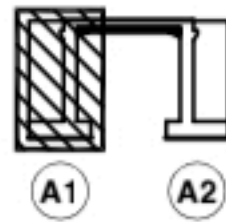

여주방향
종점측





범 례	 CW/0.2	 균열	 망상균열	 철근노출	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역
	 파손, 탈락	 재료분리	 백태	구조물명	백록육교	
레	 박리, 박락	 누수, 체수	 좌굴, 변형	조사일자	2024. 10	
	 표면오염	 보수부	 부식	책임자	한은택	
	 토사퇴적	 기타	 배수구막힘	도면번호	007	

ID : 교대 (A2) 외관조사망도

손상물량표

여주방향

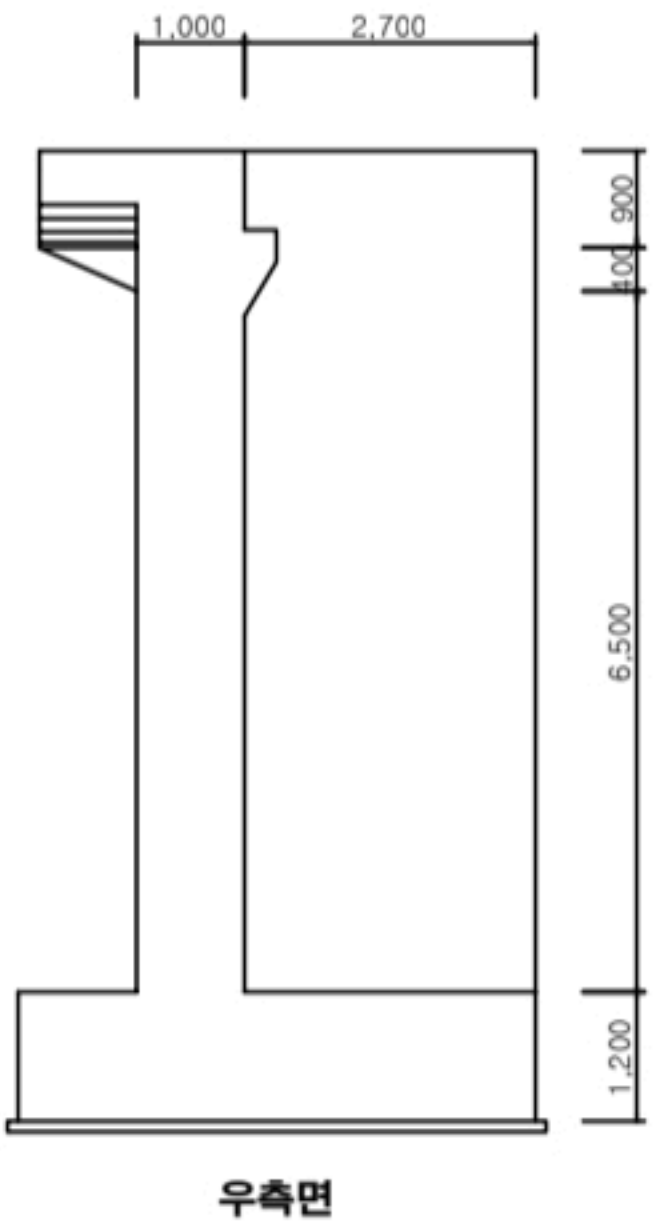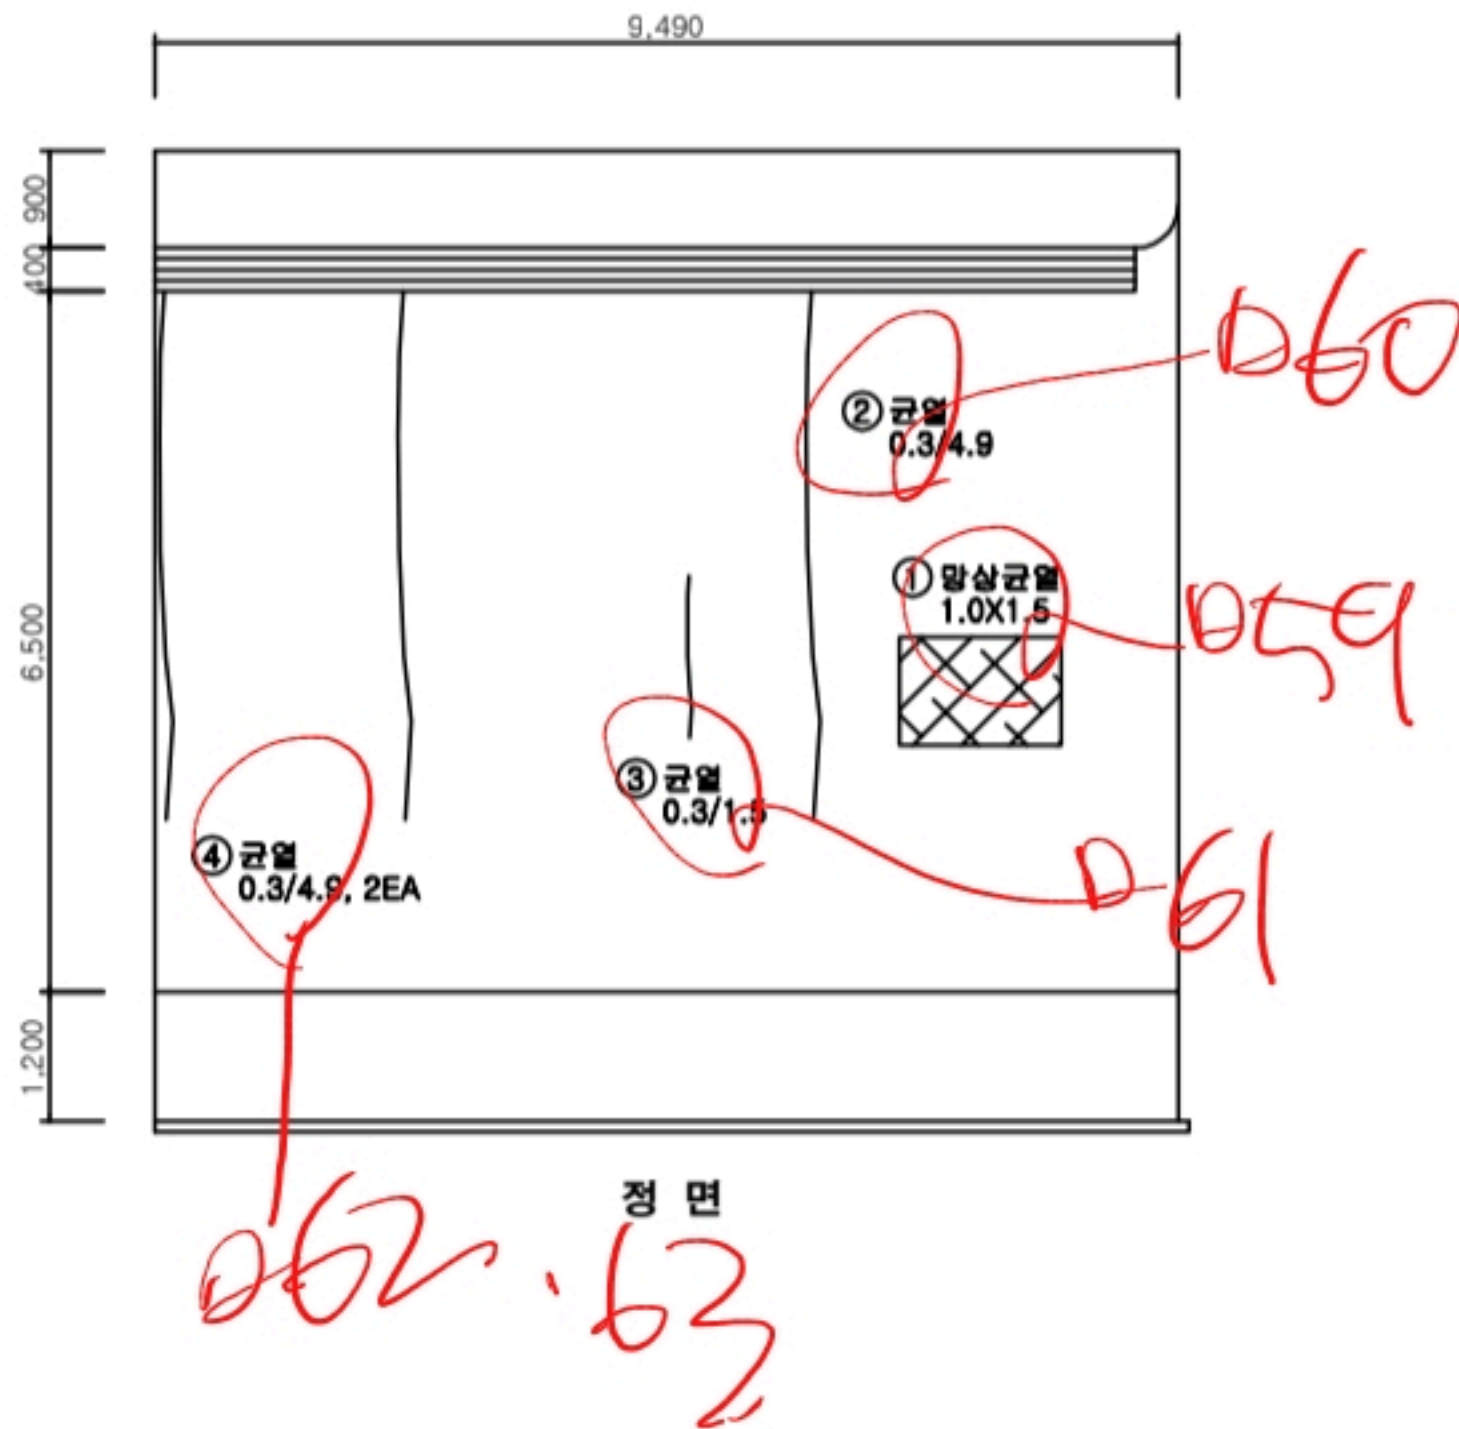

No.	손상내용	2024년 정기점검							비고
		결함정도				손상물량			
		깊이(mm)	폭(mm)	길이(m)	너비(m)	개소	물량	단위	
1	망상균열	-	-	1.0	1.5	1	1.50	m²	
2	균열	-	0.3	4.9	-	1	4.90	m	
3	균열	-	0.3	1.5	-	1	1.50	m	
4	균열	-	0.3	4.9	-	2	9.80	m	
5									
6									
7									
8									
9									
10									
11									
12									
13									
14									
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									

KEY PLAN

SECTION

범례	CW/0.2 균열	망상균열	철근노출	용역명	2024년 국도3호선 기타시설물 진압2교 등 31개소 정기안전점검 용역
	파손, 탈락	재료분리	백태	구조물명	백록육교
	바리, 박락	누수, 체수	좌굴, 변형	조사일자	2024. 10
	표면오염	보수부	부식	책임자	한은탁
	토사퇴적	기타	배수구막힘	도면번호	008

