
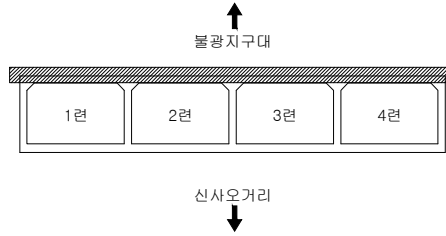


KEY PLAN

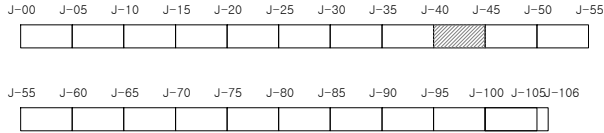


불 광 천 포 장 부 J40(1K 128) ~ J45(1K 248)

손 상 물 량 표

번 호	손 상 위 치	적 출 년 도	법 레	① - 2013 신 규	기 ① - 기 준 손 상	결 형 규 모				단 위	개 소	비 고
						내 용	폭	길이	길이			
1	40~41	S	2013			소성변형	6.0	6.0		㎡	1	신규
2	40	S	2013			탄성조인트파손	0.8	2.5		㎡	1	신규
3	40	S	2013			탄성조인트파손	0.8	1.0		㎡	1	신규
4	41~42	S	2013			망상균열	6.0	7.0		㎡	1	신규
5	41~42	S	2013			망상균열	9.0	3.0		㎡	1	신규
6	41~42	S	2013			탄성조인트파손	0.8	2.0		㎡	1	신규
7	41~42	S	2013			균열		22.0		m	1	신규
8	41~42	S	2013			망상균열	17.0	2.0		㎡	1	신규
9	42~43	S	2013			망상균열	4.5	2.0		㎡	1	신규
10	42~43	S	2013			망상균열	6.5	6.5		㎡	1	신규
11	43~44	S	2013			망상균열	6.0	4.0		㎡	1	신규
12	43~44	S	2013			망상균열	12.5	2.0		㎡	1	신규
13	43~44	S	2013			망상균열	3.0	5.0		㎡	1	신규
14	44~45	S	2013			망상균열	9.5	4.0		㎡	1	신규
15	44~45	S	2013			균열	0.5	26.0		m	1	신규
16												
17												
18												
19												
20												
21												
22												
23												
24												
25												
26												
27												
28												
29												
30												
31												
32												
33												

-1순위 : Type-7~9 (예일여고~역말사거리)
-2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
-3순위 : Type-1~7 (시점~예일여고) 및 포장균열

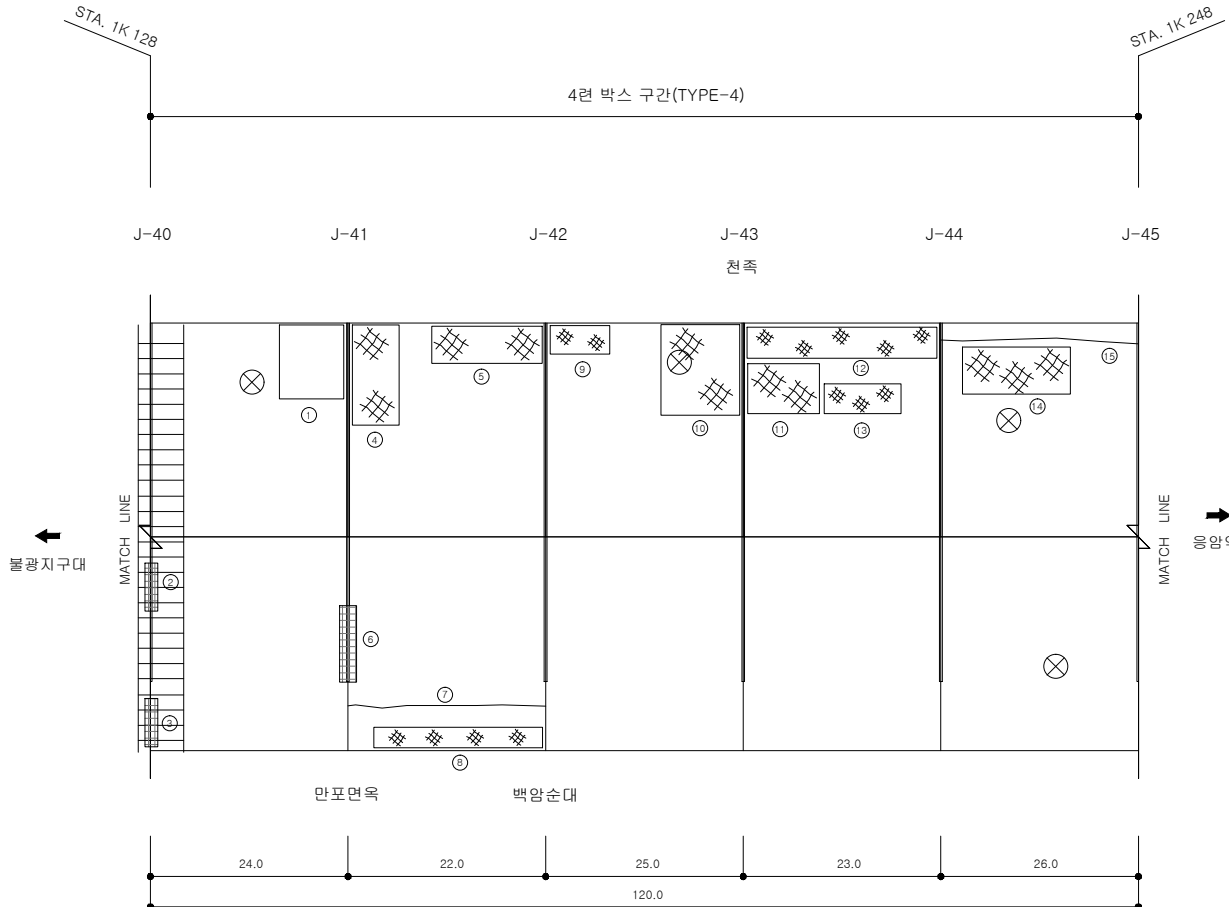

범 레



단 위

