
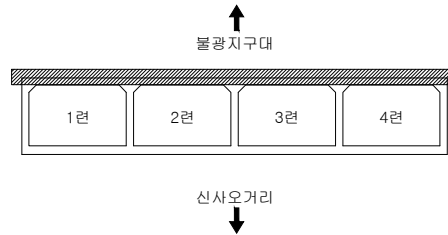


KEY PLAN

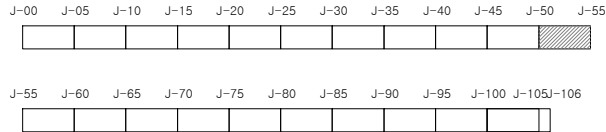


불광천포장부 J50(1K 373) ~ J53(1K 445)

손상물량표

범례		① ~ 2013 신규		기① - 기존손상				① 보수원료			
번 호	손 상 위 치		적출년도	결함규모							비 고
				내 용	폭	길이	깊이	물 량	단위	개소	
1	50-51	S	2013	균열	0.5	8.0		8.00	m	1	신규
2	50-51	S	2013	망상균열	2.0	15.0		30.00	m ²	1	신규
3	50-51	S	2013	아스콘파손	2.0	11.0		22.00	m ²	1	신규
4	50-51	S	2013	망상균열	25.0	2.0		50.00	m ²	1	신규
5	51	S	2013	탄성조인트파손	0.8	4.0		3.20	m ²	1	신규
6	51-52	S	2013	망상균열	5.0	3.0		15.00	m ²	1	신규
7	51-52	S	2013	망상균열	23.0	2.0		46.00	m ²	1	신규
8	52	S	2013	탄성조인트파손	0.8	2.3		1.84	m ²	1	신규
9	52-53	S	2013	망상균열	19.0	3.5		66.50	m ²	1	신규
10	52-53	S	2013	망상균열	24.0	2.0		48.00	m ²	1	신규
11	53	S	2013	탄성조인트파손	0.8	4.7		3.76	m ²	1	신규
12											
13											
14											
15											
16											
17											
18											
19											
20											
21											
22											
23											
24											
25											
26											
27											
28											
29											
30											
31											
32											
33											

-1순위 : Type-7~9 (예일여고~역말사거리)
 -2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
 -3순위 : Type-1~7 (시점~예일여고) 및 포장균열

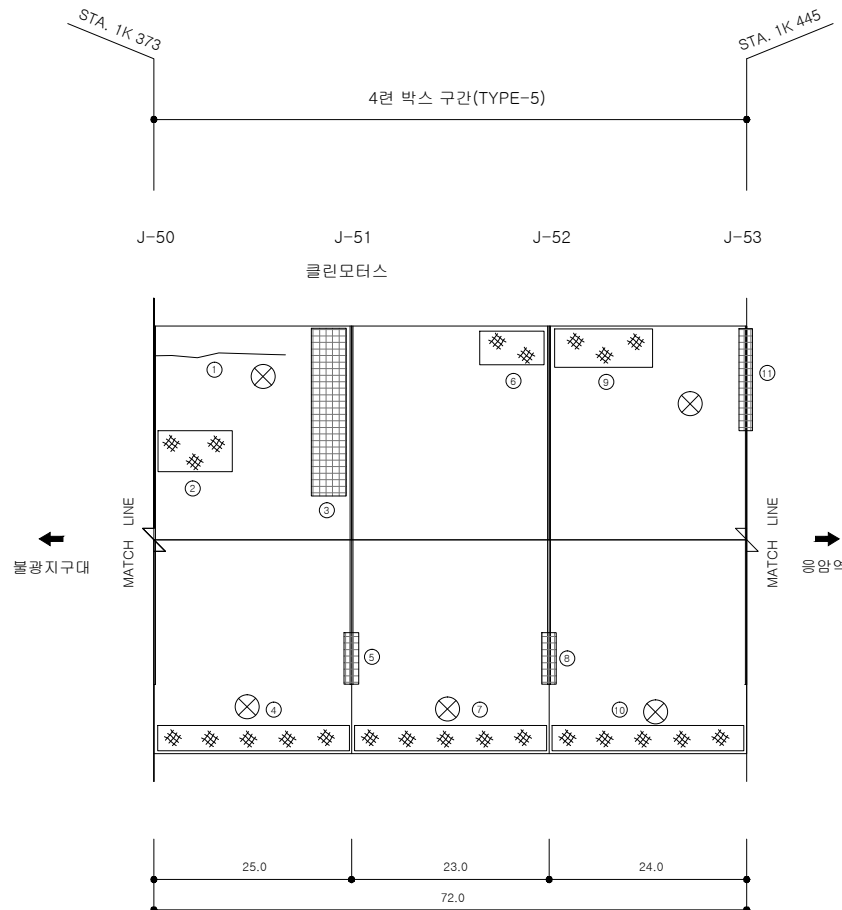

범례



발주처

서울특별시 서부도로사업소

용역사

(주)한국시설안전연구원

PROJECT

불광천1복개 정밀안전진단 및 녹번천복개 정밀점검 용역

TITLE

불광천포장부 J50(1K 373) ~ J53(1K 445)

SCALE

NONE

0-12