
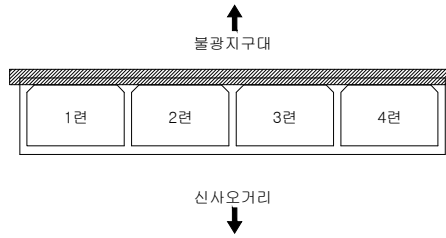


KEY PLAN

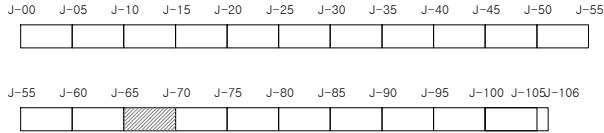

불 광 천 포 장 부 J65(1K 752) ~ J70(1K 880)


손 상 물 량 표

범 례			㉠ - 2013 신규				기㉡ - 기존순성				T 보수완료			
번 호	손 상 위 치		적출년도	결함규모						비 고				
				내 용	폭	길이	깊이	물 량	단위		개소			
1	65-66	S	2013	망상균열	5.0	26.0		130.0	m	1	신규			
2	65-66	S	2013	균열	1.0	26.0		26.0	m	1	신규			
3	65-66	S	2013	균열	1.0	26.0		26.0	m	1	신규			
4	66-67	S	2013	망상균열	5.0	23.0		115.0	m	1	신규			
5	66-67	S	2013	균열	0.5	23.0		23.0	m	1	신규			
6	66-67	S	2013	망상균열	7.0	8.0		56.0	m	1	신규			
7	67-68	S	2013	망상균열	5.0	23.0		115.0	m	1	신규			
8	67-68	S	2013	균열	0.5	23.0		23.0	m	1	신규			
9	67-68	S	2013	망상균열	2.0	23.0		46.0	m	1	신규			
10	68-69	S	2013	망상균열	5.0	26.0		130.0	m	1	신규			
11	68-69	S	2013	균열	0.5	26.0		26.0	m	1	신규			
12	68-69	S	2013	망상균열	2.0	20.0		40.0	m	1	신규			
13	68-69	S	2013	보수부 파손	1.0	5.0		5.00	m	1	신규			
14	68-69	S	2013	망상균열	2.0	26.0		52.0	m	1	신규			
15	69-70	S	2013	망상균열	3.5	20.0		70.0	m	1	신규			
16	69-70	S	2013	균열	0.5	30.0		30.0	m	1	신규			
17	69-70	S	2013	균열	1.0	5.0		5.0	m	1	신규			
18	69-70	S	2013	균열	1.0	5.0		5.0	m	1	신규			
19	66-67	S	2013	보수완료	1.0	18.0		18.0	m	1	기존보수			
20	66-67	S	2013	보수완료	1.0	15.0		15.0	m	1	기존보수			
21	67-68	S	2013	보수완료	1.0	18.0		18.0	m	1	기존보수			
22	67-68	S	2013	보수완료	1.0	5.0		5.00	m	1	기존보수			
23	68-69	S	2013	보수완료	1.0	26.0		26.0	m	1	기존보수			
24	69-70	S	2013	보수완료	1.0	25.0		25.0	m	1	기존보수			
25	69-70	S	2013	보수완료	1.0	28.0		28.0	m	1	기존보수			
26														
27														
28														
29														
30														
31														
32														
33														

-1순위 : Type-7~9 (예일여고~역말사거리)
 -2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
 -3순위 : Type-1~7 (시점~예일여고) 및 포장균열

불광지구대

MATCH LINE

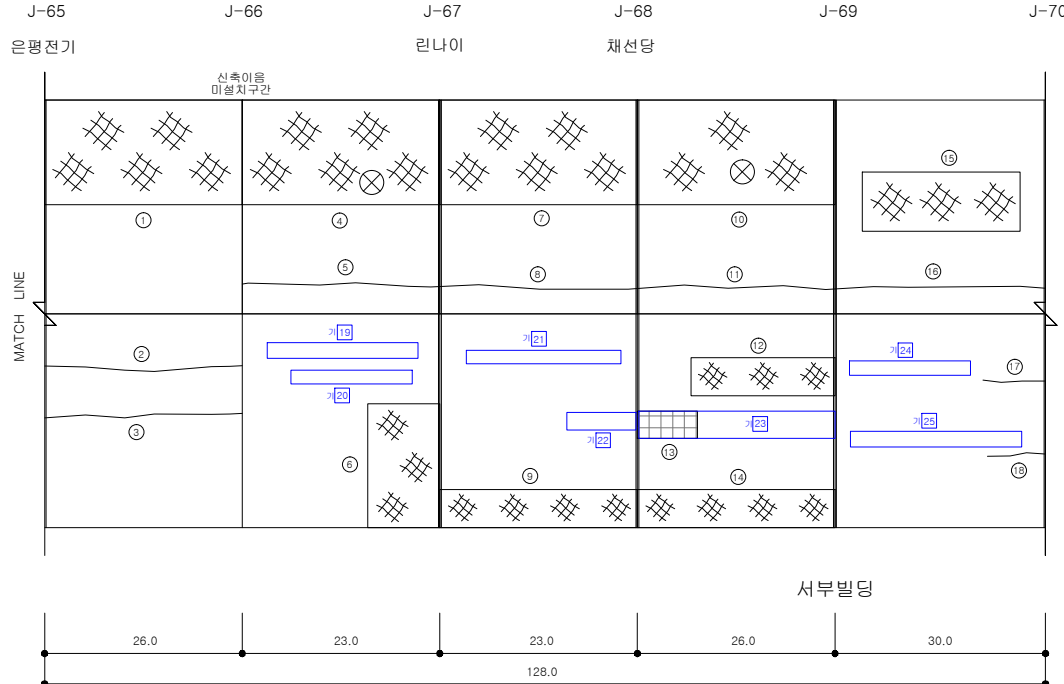

MATCH LINE

00 방향

범 례



단 위

/mm

T=mm

A=mxm

지름

두께

면적

발주처



서울특별시 서부도로사업소

용역사



(주)한국시설안전연구원

PROJECT

불광천1복개 정밀안전진단 및 북변천복개 정밀점검 용역

TITLE

불 광 천 포 장 부
J65(1K 752) ~ J70(1K 880)

SCALE

NOTE

0-16