
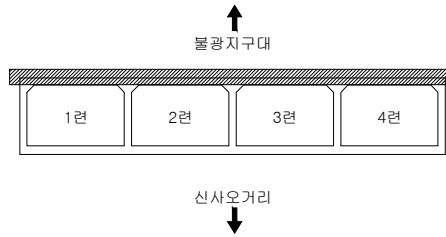


KEY PLAN

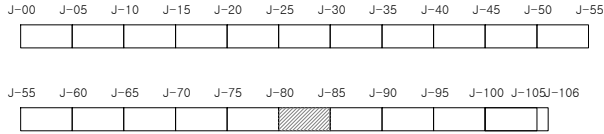


불 광 천 포 장 부 J80(2K 122) ~ J85(2K 245)

손 상 물 량 표

범 례			㉠ - 2013 신규		기㉡ - 기존순성		I 보수완료					
번 호	손 상 위 치		적출년도	결함규모						비 고		
				내 용	폭	길이	깊이	물 량	단위		개소	
1	80-81	S	2013	망상균열	2.0	24.0			48.0	m	1	신규
2	80-81	S	2013	소성변형	5.0	5.0			25.0	m	1	신규
3	80-81	S	2013	망상균열	2.0	4.0			8.00	m	1	신규
4	80-81	S	2013	포장마모	4.0	15.0			60.0	m	1	신규
5	81-82	S	2013	망상균열	2.0	23.5			94.0	m	1	신규
6	81-82	S	2013	소성변형	5.0	25.0			125.0	m	1	신규
7	81-82	S	2013	균열		5.5			5.50	m	1	신규
8	81-82	S	2013	망상균열	3.0	7.0			21.0	m	1	신규
9	82-83	S	2013	망상균열	3.0	10.0			30.0	m	1	신규
10	82-83	S	2013	균열		24.0			24.0	m	1	신규
11	82-83	S	2013	소성변형	8.0	10.0			80.0	m	1	신규
12	82-83	S	2013	균열	1.0	24.0			24.0	m	1	신규
13	83-84	S	2013	균열	1.5	8.0			8.00	m	1	신규
14	83-84	S	2013	균열	1.5	5.0			5.00	m	1	신규
15	83-84	S	2013	균열		24.0			24.0	m	1	신규
16	83-84	S	2013	소성변형	4.0	7.0			28.0	m	1	신규
17	83-84	S	2013	균열	1.0	24.0			24.0	m	1	신규
18	83-84	S	2013	균열	1.0	24.0			24.0	m	1	신규
19	84-85	S	2013	망상균열	1.5	26.0			39.0	m	1	신규
20	84-85	S	2013	망상균열	3.0	14.0			42.0	m	1	신규
21	84-85	S	2013	균열		26.0			26.0	m	1	신규
22												
23												
24												
25												
26												
27												
28												
29												
30												
31												
32												
33												

-1순위 : Type-7~9 (예일여고~역말사거리)
 -2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
 -3순위 : Type-1~7 (시점~예일여고) 및 포장균열

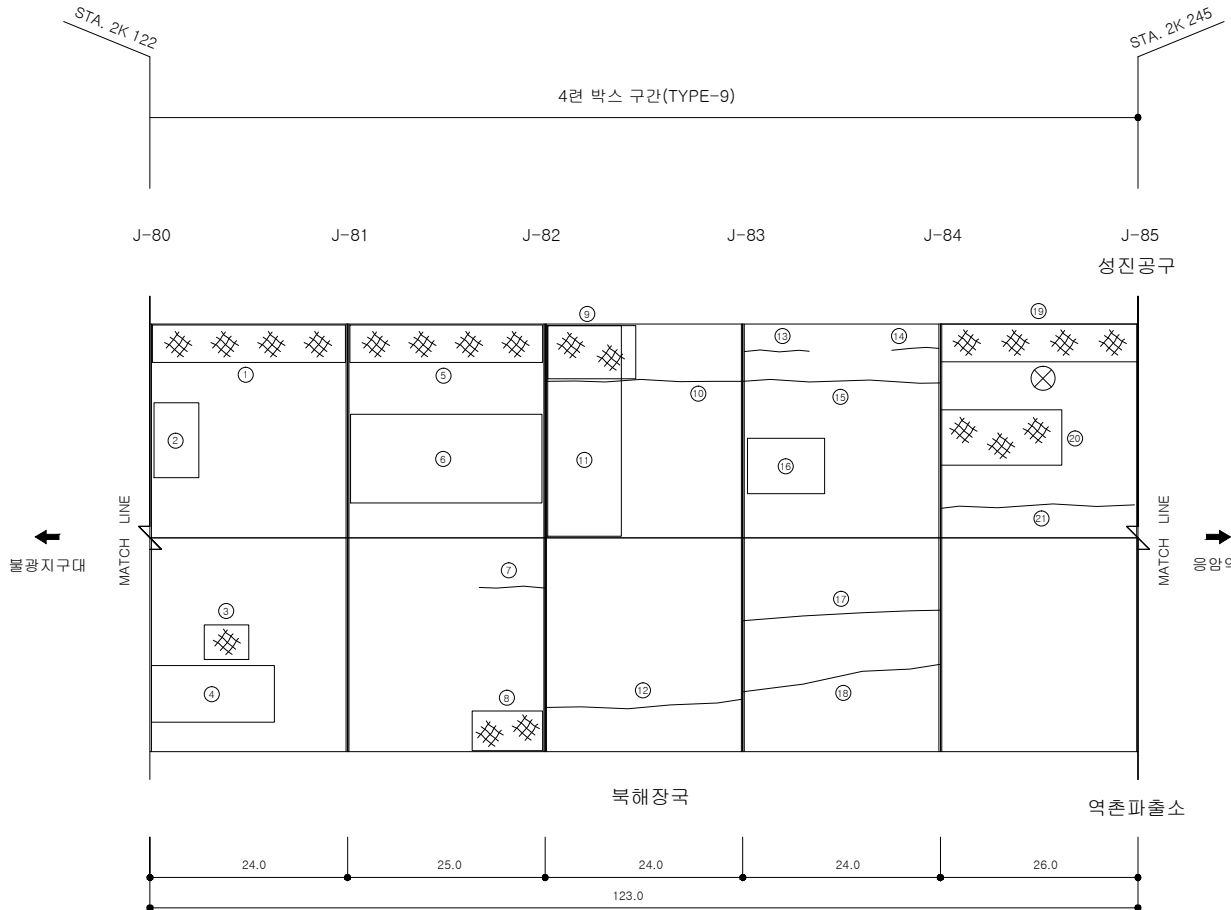

범 례



단 위

