
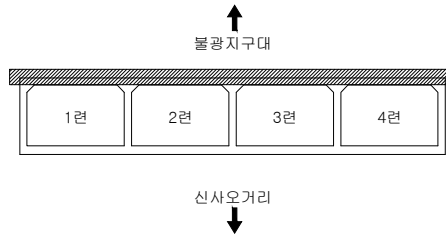


KEY PLAN

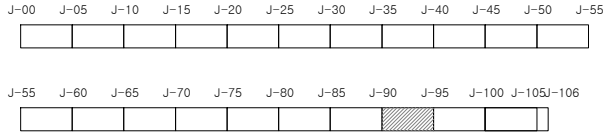


불 광 천 포 장 부 J90(2K 368) ~ J95(2K 489)

손 상 물 량 표

법 레			㉠ 2013 신규			기㉡ - 기존손상			㉢ 보수완료		
번 호	손 상 위 치	적출년도	결함규모							비 고	
			내 용	폭	길이	길이	물 량	단위	개소		
1	90-91	S	2013	망상균열	4.5	31.0		139.5	m	1	신규
2	90-91	S	2013	균열		27.0		27.0	m	1	신규
3	91	S	2013	후타재파손	0.8	8.0		6.40	m	1	신규
4	90-91	S	2013	망상균열	8.0	9.0		72.0	m	1	신규
5	91-92	S	2013	균열	1.5	10.0		15.0	m	1	신규
6	91-92	S	2013	균열	1.5	5.0		7.50	m	1	신규
7	91-92	S	2013	망상균열	6.5	11.5		74.75	m	1	신규
8	91-92	S	2013	균열		25.0		25.0	m	1	신규
9	91-92	S	2013	망상균열	3.0	25.0		75.0	m	1	신규
10	91-92	S	2013	균열	1.0	25.0		25.0	m	1	신규
11	91-92	S	2013	망상균열	2.0	10.0		20.0	m	1	신규
12	92-93	S	2013	균열	1.0	20.0		20.0	m	1	신규
13	92-93	S	2013	균열		25.0		25.0	m	1	신규
14	92-93	S	2013	망상균열	3.0	25.0		75.0	m	1	신규
15	92-93	S	2013	망상균열	2.0	25.0		50.0	m	1	신규
16	93-94	S	2013	균열		25.0		25.0	m	1	신규
17	93-94	S	2013	균열	1.0	25.0		25.0	m	1	신규
18	93-94	S	2013	균열		25.0		25.0	m	1	신규
19	93-94	S	2013	망상균열	2.0	10.0		20.0	m	1	신규
20	94	S	2013	후타재마모	0.7	3.0		2.10	m	1	신규
21	94	S	2013	후타재마모	0.7	2.5		1.54	m	1	신규
22	94-95	S	2013	균열		1.0		1.00	m	1	신규
23	94-95	S	2013	균열		2.0		2.00	m	1	신규
24	94-95	S	2013	균열		14.0		14.00	m	1	신규
25	95	S	2013	후타재마모	0.7	7.8		5.46	m	1	신규
26	94-95	S	2013	망상균열	2.0	8.0		16.0	m	1	신규
27											
28											
29											
30											
31											
32											
33											

-1순위 : Type-7~9 (예일여고~역말사거리)
 -2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
 -3순위 : Type-1~7 (시점~예일여고) 및 포장균열

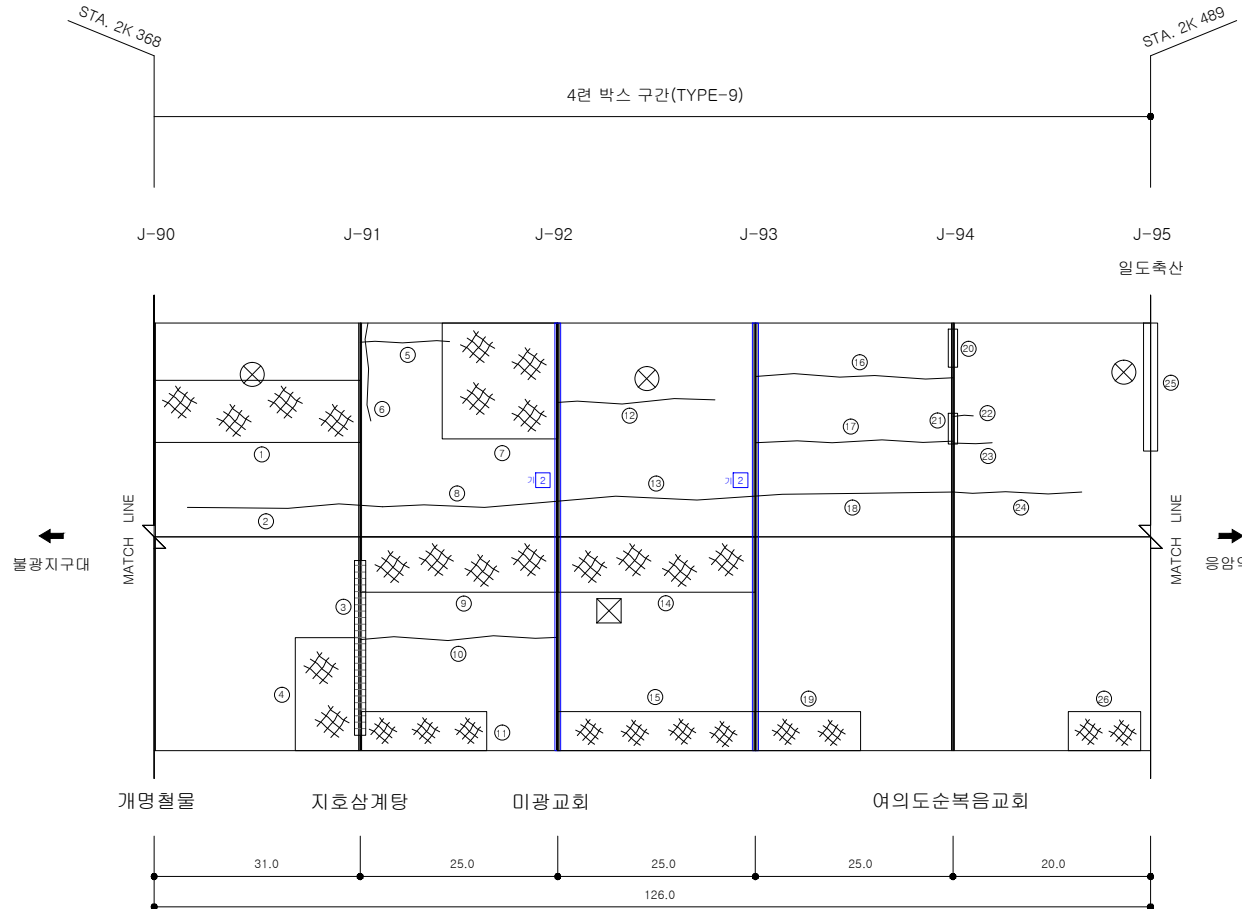

범 레



단 위

