



KEY PLAN

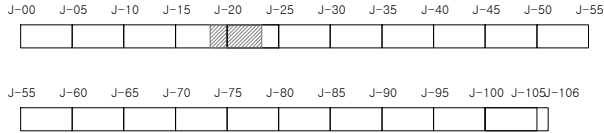

불광지구대  
↑  
신사오거리  
↓



불광천포장부 J18(OK 532) ~ J23(OK 683)

손상물량표

| 범 례 |         | ① ~ 2013 신규 |      |           | 가① - 기존손상 |      |    | ① 보수완료 |        |     |     |      |
|-----|---------|-------------|------|-----------|-----------|------|----|--------|--------|-----|-----|------|
| 번 호 | 손 상 위 치 |             | 적출년도 | 결함규모      |           |      |    |        |        |     | 비 고 |      |
|     |         |             |      | 내 용       | 폭         | 깊이   | 깊이 | 물 량    | 단위     | 개 소 |     |      |
| 1   | 18-19   | S           | 2013 | 망상균열      | 5.0       | 10.0 |    |        | 50.00  | m   | 1   | 신규   |
| 2   | 18-19   | S           | 2013 | 망상균열      | 3.0       | 10.0 |    |        | 30.00  | m   | 1   | 신규   |
| 3   | 18-19   | S           | 2013 | 소성변형      | 3.0       | 5.0  |    |        | 15.00  | m   | 1   | 신규   |
| 4   | 18-19   | S           | 2013 | 균열        |           | 4.3  |    |        | 4.30   | m   | 1   | 신규   |
| 5   | 18-19   | S           | 2013 | 망상균열      | 9.0       | 5.0  |    |        | 45.00  | m   | 1   | 신규   |
| 6   | 18-19   | S           | 2013 | 망상균열      | 20.0      | 5.0  |    |        | 100.00 | m   | 1   | 신규   |
| 7   | 19      | S           | 2013 | 구스조인트소성변형 | 0.3       | 7.3  |    |        | 2.19   | m   | 1   | 신규   |
| 8   | 19-20   | S           | 2013 | 망상균열      | 2.0       | 4.0  |    |        | 8.00   | m   | 1   | 신규   |
| 9   | 19-20   | S           | 2013 | 균열        | 1.0       | 7.5  |    |        | 7.50   | m   | 1   | 신규   |
| 10  | 19-20   | S           | 2013 | 균열        | 1.0       | 3.0  |    |        | 3.00   | m   | 1   | 신규   |
| 11  | 19-20   | S           | 2013 | 보수완료      | 1.5       | 1.5  |    |        | 2.25   | m   | 2   | 기존보수 |
| 12  | 19-20   | S           | 2013 | 균열        | 1.0       | 4.0  |    |        | 4.00   | m   | 1   | 신규   |
| 13  | 19-20   | S           | 2013 | 망상균열      | 6.0       | 3.0  |    |        | 18.00  | m   | 1   | 신규   |
| 14  | 20-21   | S           | 2013 | 망상균열      | 15.0      | 2.0  |    |        | 30.00  | m   | 1   | 신규   |
| 15  | 20-21   | S           | 2013 | 망상균열      | 5.0       | 3.0  |    |        | 15.00  | m   | 1   | 신규   |
| 16  | 20-21   | S           | 2013 | 균열        | 1.0       | 3.5  |    |        | 3.50   | m   | 1   | 신규   |
| 17  | 21-22   | S           | 2013 | 망상균열      | 30.0      | 2.0  |    |        | 60.00  | m   | 1   | 신규   |
| 18  | 21-22   | S           | 2013 | 망상균열      | 14.0      | 2.0  |    |        | 28.00  | m   | 1   | 신규   |
| 19  | 22-23   | S           | 2013 | 망상균열      | 5.0       | 4.0  |    |        | 20.00  | m   | 1   | 신규   |
| 20  | 22-23   | S           | 2013 | 균열        |           | 16.0 |    |        | 16.00  | m   | 1   | 신규   |
| 21  | 22-23   | S           | 2013 | 망상균열      | 15.0      | 2.0  |    |        | 30.00  | m   | 1   | 신규   |
| 22  |         |             |      |           |           |      |    |        |        |     |     |      |
| 23  |         |             |      |           |           |      |    |        |        |     |     |      |
| 24  |         |             |      |           |           |      |    |        |        |     |     |      |
| 25  |         |             |      |           |           |      |    |        |        |     |     |      |
| 26  |         |             |      |           |           |      |    |        |        |     |     |      |
| 27  |         |             |      |           |           |      |    |        |        |     |     |      |
| 28  |         |             |      |           |           |      |    |        |        |     |     |      |
| 29  |         |             |      |           |           |      |    |        |        |     |     |      |
| 30  |         |             |      |           |           |      |    |        |        |     |     |      |
| 31  |         |             |      |           |           |      |    |        |        |     |     |      |
| 32  |         |             |      |           |           |      |    |        |        |     |     |      |
| 33  |         |             |      |           |           |      |    |        |        |     |     |      |


-1순위 : Type-7~9 (예일여고~역말사거리)  
-2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상  
-3순위 : Type-1~7 (시점~예일여고) 및 포장균열

← 불광지구대

MATCH LINE

MATCH LINE

→ 신사오거리

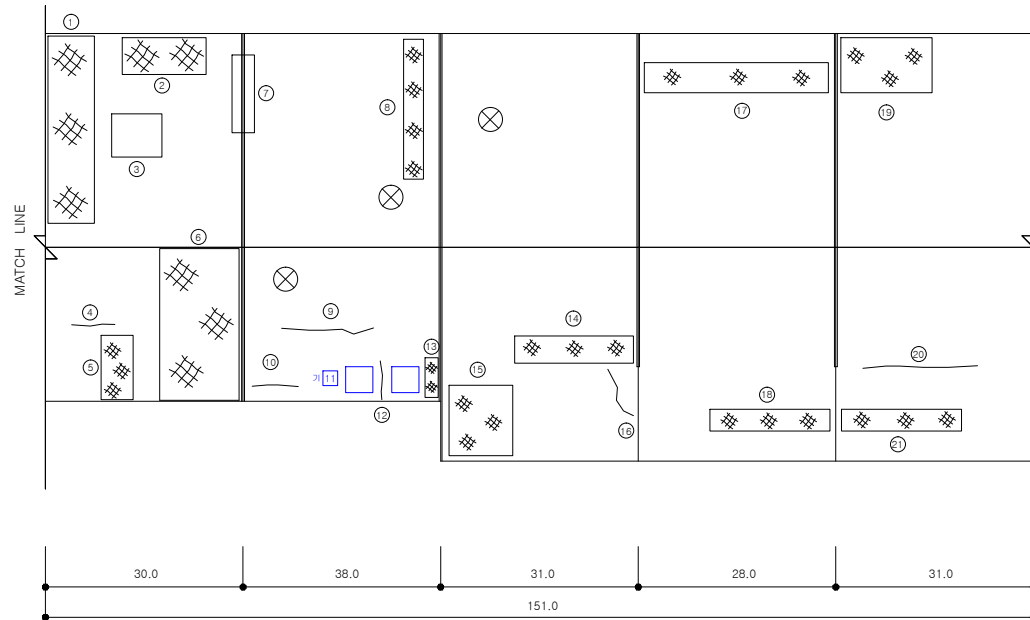

범례



단위

/mm

T=mm

A=mxm

지름

두께

면적

발주처

서울특별시 서부도로사업소

용역사

(주)한국시설안전연구원

PROJECT

불광천1복개 정밀안전진단 및 녹번천복개 정밀점검 용역

TITLE

불광천포장부 J18(OK 532) ~ J23(OK 683)

SCALE

NOTE

0~5