



KEY PLAN

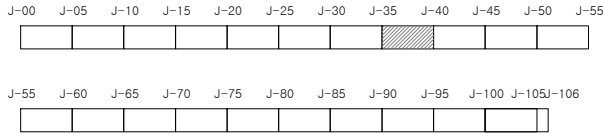

↑
불광지구대
↓
신사오거리




불 광 천 포 장 부 J35(0K 999) ~ J40(1K 128)

손 상 물 량 표

번 호	손 상 위 치	적출년도	결함규모					단 위	개 소	비 고
			내 용	폭	길이	깊이	물 량			
1	35	S	2013	후타재파손	0.8	22.0		m	1	신규
2	35-36	S	2013	균열		25.0		m	1	신규
3	35-36	S	2013	균열		25.0		m	1	신규
4	35-36	S	2013	균열	0.5	5.0		m	2	신규
5	36	S	2013	후타재파손	0.7	8.0		m	1	신규
6	36-37	S	2013	균열		29.0		m	1	신규
7	36-37	S	2013	파손	4.0	4.0		m	1	신규
8	36-37	S	2013	파손	4.0	4.0		m	1	신규
9	37-38	S	2013	균열		10.0		m	1	신규
10	37-38	S	2013	포장마모	10.0	4.0		m	1	신규
11	37-38	S	2013	망상균열	29.0	6.0		m	1	신규
12	38	S	2013	후타재마모	0.8	7.5		m	1	신규
13	38-39	S	2013	포장마모	23.0	4.0		m	1	신규
14	38-39	S	2013	포장파손	2.5	3.0		m	1	신규
15	38-39	S	2013	탄성조인트파손	0.2	0.3		m	1	신규
16	38-39	S	2013	망상균열	7.0	3.0		m	1	신규
17	38-39	S	2013	망상균열	22.0	3.0		m	1	신규
18	39	S	2013	보수완료	2.0	5.0		m	1	기존보수
19	39-40	S	2013	망상균열	24.0	3.0		m	1	신규
20										
21										
22										
23										
24										
25										
26										
27										
28										
29										
30										
31										
32										
33										

-1순위 : Type-7~9 (예일여고~역말사거리)
 -2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
 -3순위 : Type-1~7 (시점~예일여고) 및 포장균열

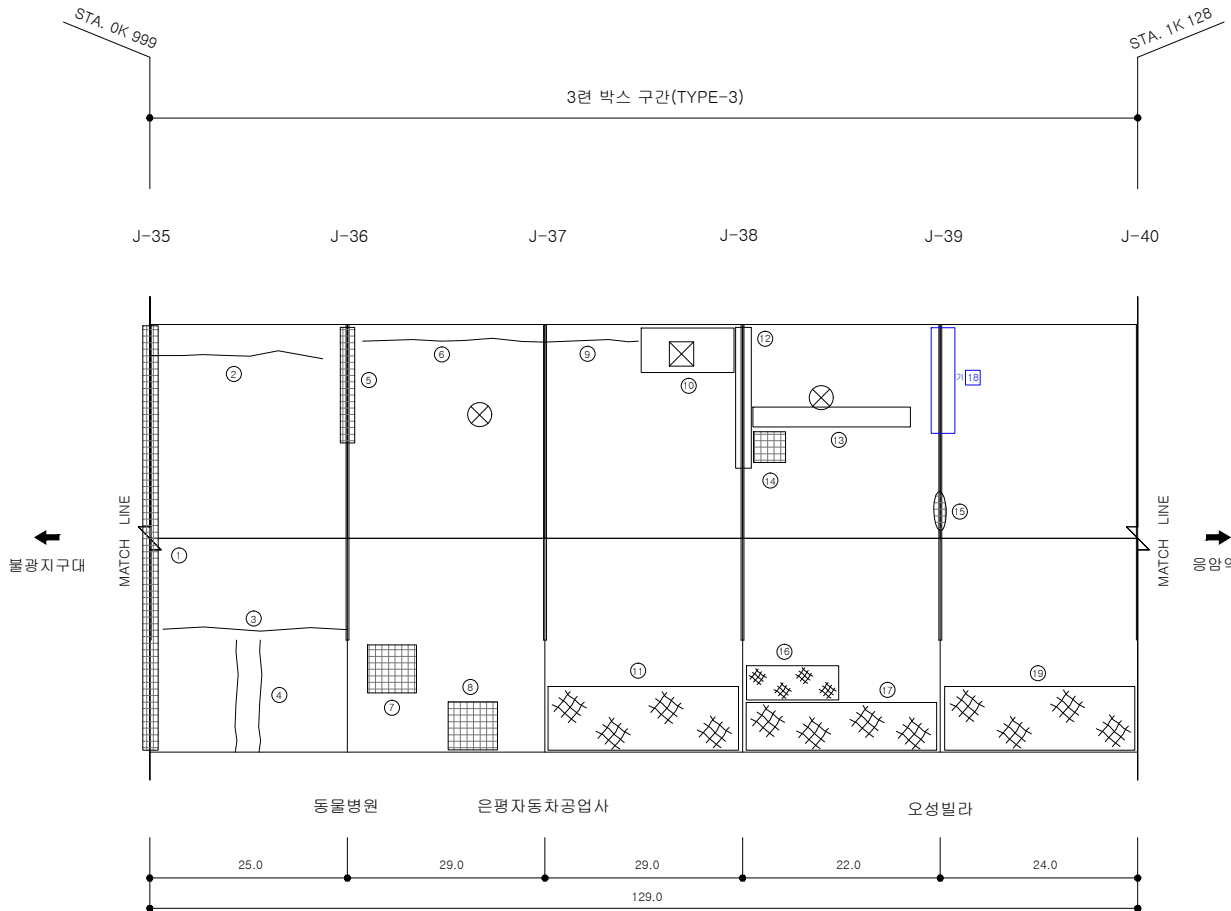

범 레



단 위

