
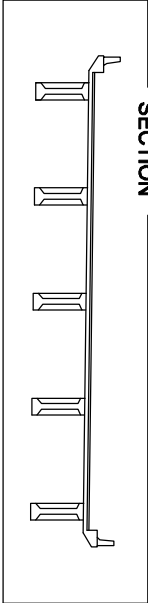



(구)남안강교 외관조사망도 바닥판 가로보 S18

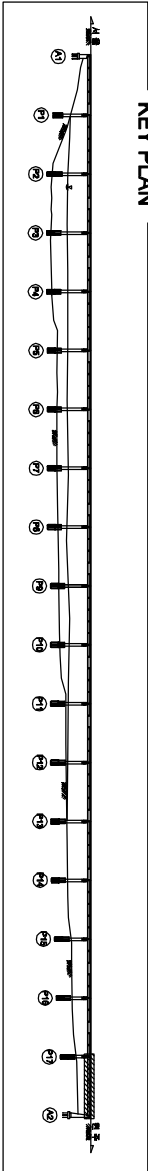


손상량량표

번호	손상 내용	손상 규모			단위	비고
		폭	길이	수량	수량	
1	철근노출	0.1	0.2	1	0.02	m ²
2	철근노출	0.1	0.3	1	0.03	m ²
3	철근노출	0.1	0.2	1	0.02	m ²
4	철근노출	0.2	0.5	1	0.10	m ²
5	철근노출	0.5	1.5	1	0.30	m ²
6	철근노출	0.3	0.5	1	0.15	m ²
7	철근노출	0.1	0.1	2	0.02	m ²
8	배면	1.7	0.5	1	0.85	m ²
9						
10						
11						
12						
13						
14						
15						
16						
17						
18						
19						
20						
21						
22						
23						
24						
25						
26						
27						


<CB3>

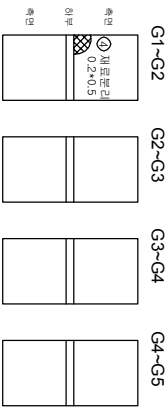


<CB4>

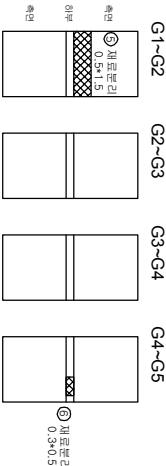

<CB5>

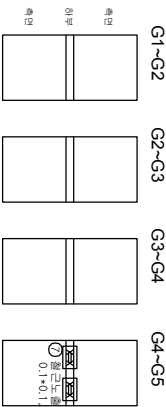

<CB6>

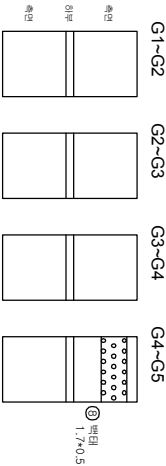

영역명	(구)남안강교 정기점검	발주처	경기도여주시	용역사	(주)명성엔지니어링	도면명	바닥판 가로보 S18	도면	73
-----	--------------	-----	--------	-----	------------	-----	-------------	----	----