
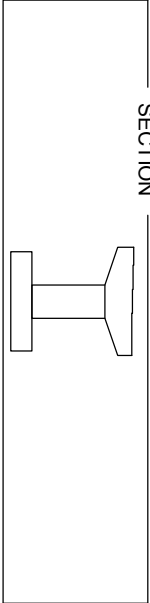



(구)남한강교 외관조사망도 교각 P17

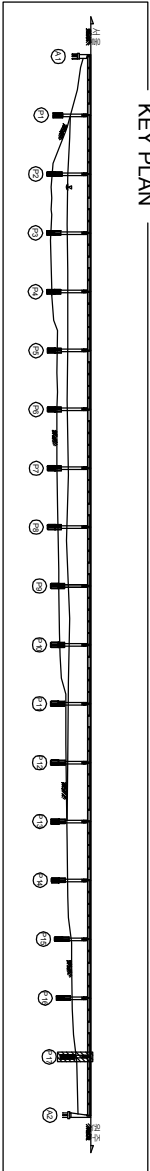

손상 물량 표

번호	손상 내용	손상 규모			단위	비고
		폭	길이	수량	물량	
1	벽면	0.2	0.3	1	0.06	m ²
2	철근노출	0.2	2.0	1	0.40	m ²
3	균열(Cw=0.3mm/0.1mm)	0.5	0.5	2	1.00	m
4	균열(Cw=0.3mm/0.6)	0.5	0.5	1	0.50	m
5	벽면	0.3	0.8	1	0.24	m ²
6	균열(Cw=0.3mm/0.1mm)	0.8	1	1	0.80	m
7	균열(Cw=0.3mm/0.1mm)	0.5	1	1	0.50	m
8						
9						
10						
11						
12						
13						
14						
15						
16						
17						
18						
19						
20						
21						
22						
23						
24						
25						
26						
27						

< 서울 방향 >

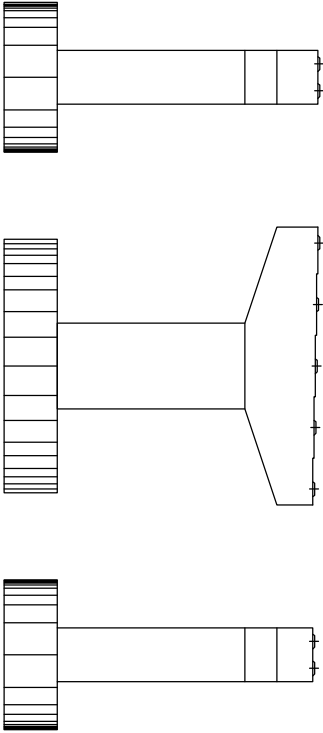

< 원주 방향 >

