



호남고속선 오송고가(T2)_100(2.525~2.540km, S26-1, S26-2)

P25

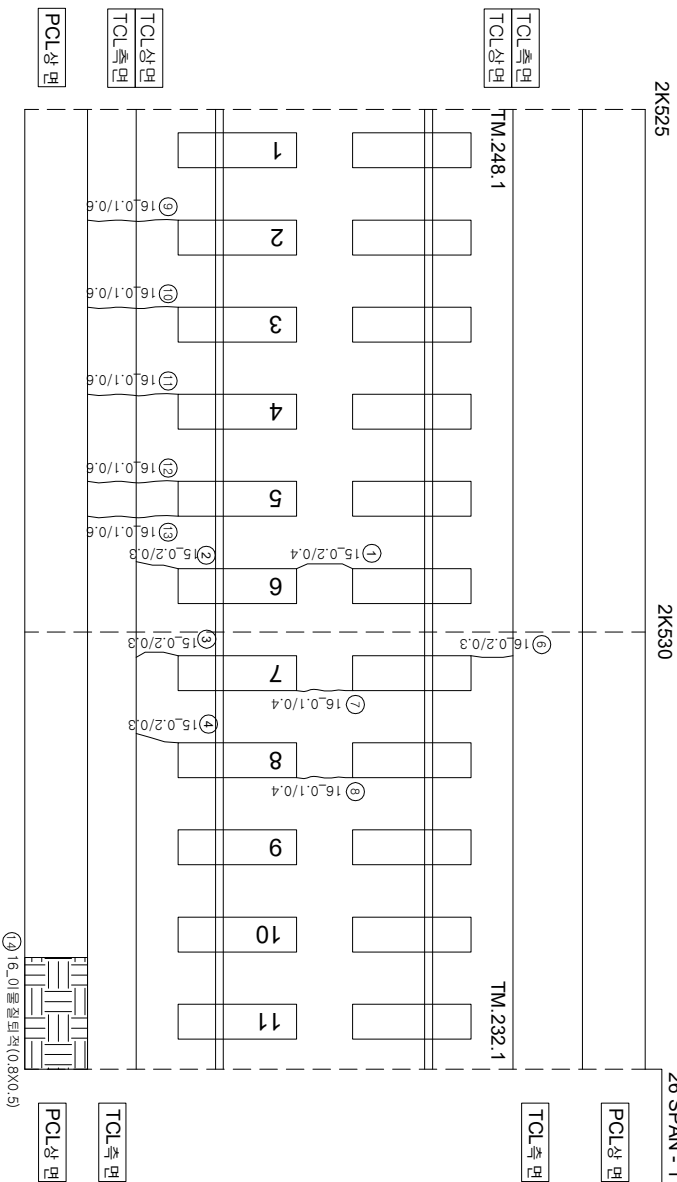

12 (주요)

(악화)

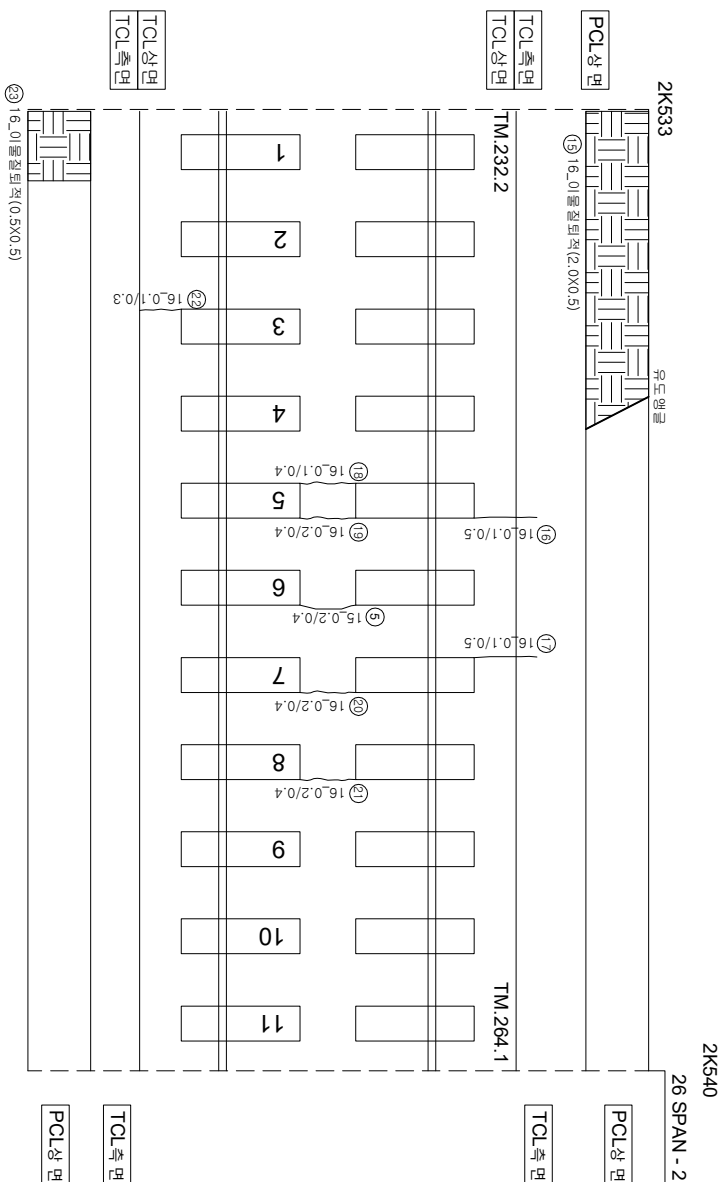

12 (주요)

(약 10분)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열 0.2	mm	0.4 m		56				
2	균열 0.2	mm	0.3 m		57				
3	균열 0.2	mm	0.3 m		58				
4	균열 0.2	mm	0.3 m		59				
5	균열 0.2	mm	0.4 m		60				
6	균열 0.2	mm	0.3 m		61				
7	균열 0.1	mm	0.4 m		62				
8	균열 0.1	mm	0.4 m		63				
9	균열 0.1	mm	0.6 m		64				
10	균열 0.1	mm	0.6 m		65				
11	균열 0.1	mm	0.6 m		66				
12	균열 0.1	mm	0.6 m		67				
13	균열 0.1	mm	0.6 m		68				
14	이물침투적 0.8	m	0.5 m		69				
15	이물침투적 2.0	m	0.5 m		70				
16	균열 0.1	mm	0.5 m		71				
17	균열 0.1	mm	0.5 m		72				
18	균열 0.1	mm	0.4 m		73				
19	균열 0.2	mm	0.4 m		74				
20	균열 0.2	mm	0.4 m		75				
21	균열 0.2	mm	0.4 m		76				
22	균열 0.1	mm	0.6 m		77				
23	이물침투적 0.5	m	0.5 m		78				
24					79				
25					80				
26					81				
27					82				
28					83				
29					84				
30					85				
31					86				
32					87				
33					88				
34					89				
35					90				
36					91				
37					92				
38					93				
39					94				
40					95				
41					96				
42					97				
43					98				
44					99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

[illegible]