


한남고속선 학전터널 - 토공노반 - 26(6.680~6.690km, L=10m)

6K680

6K690

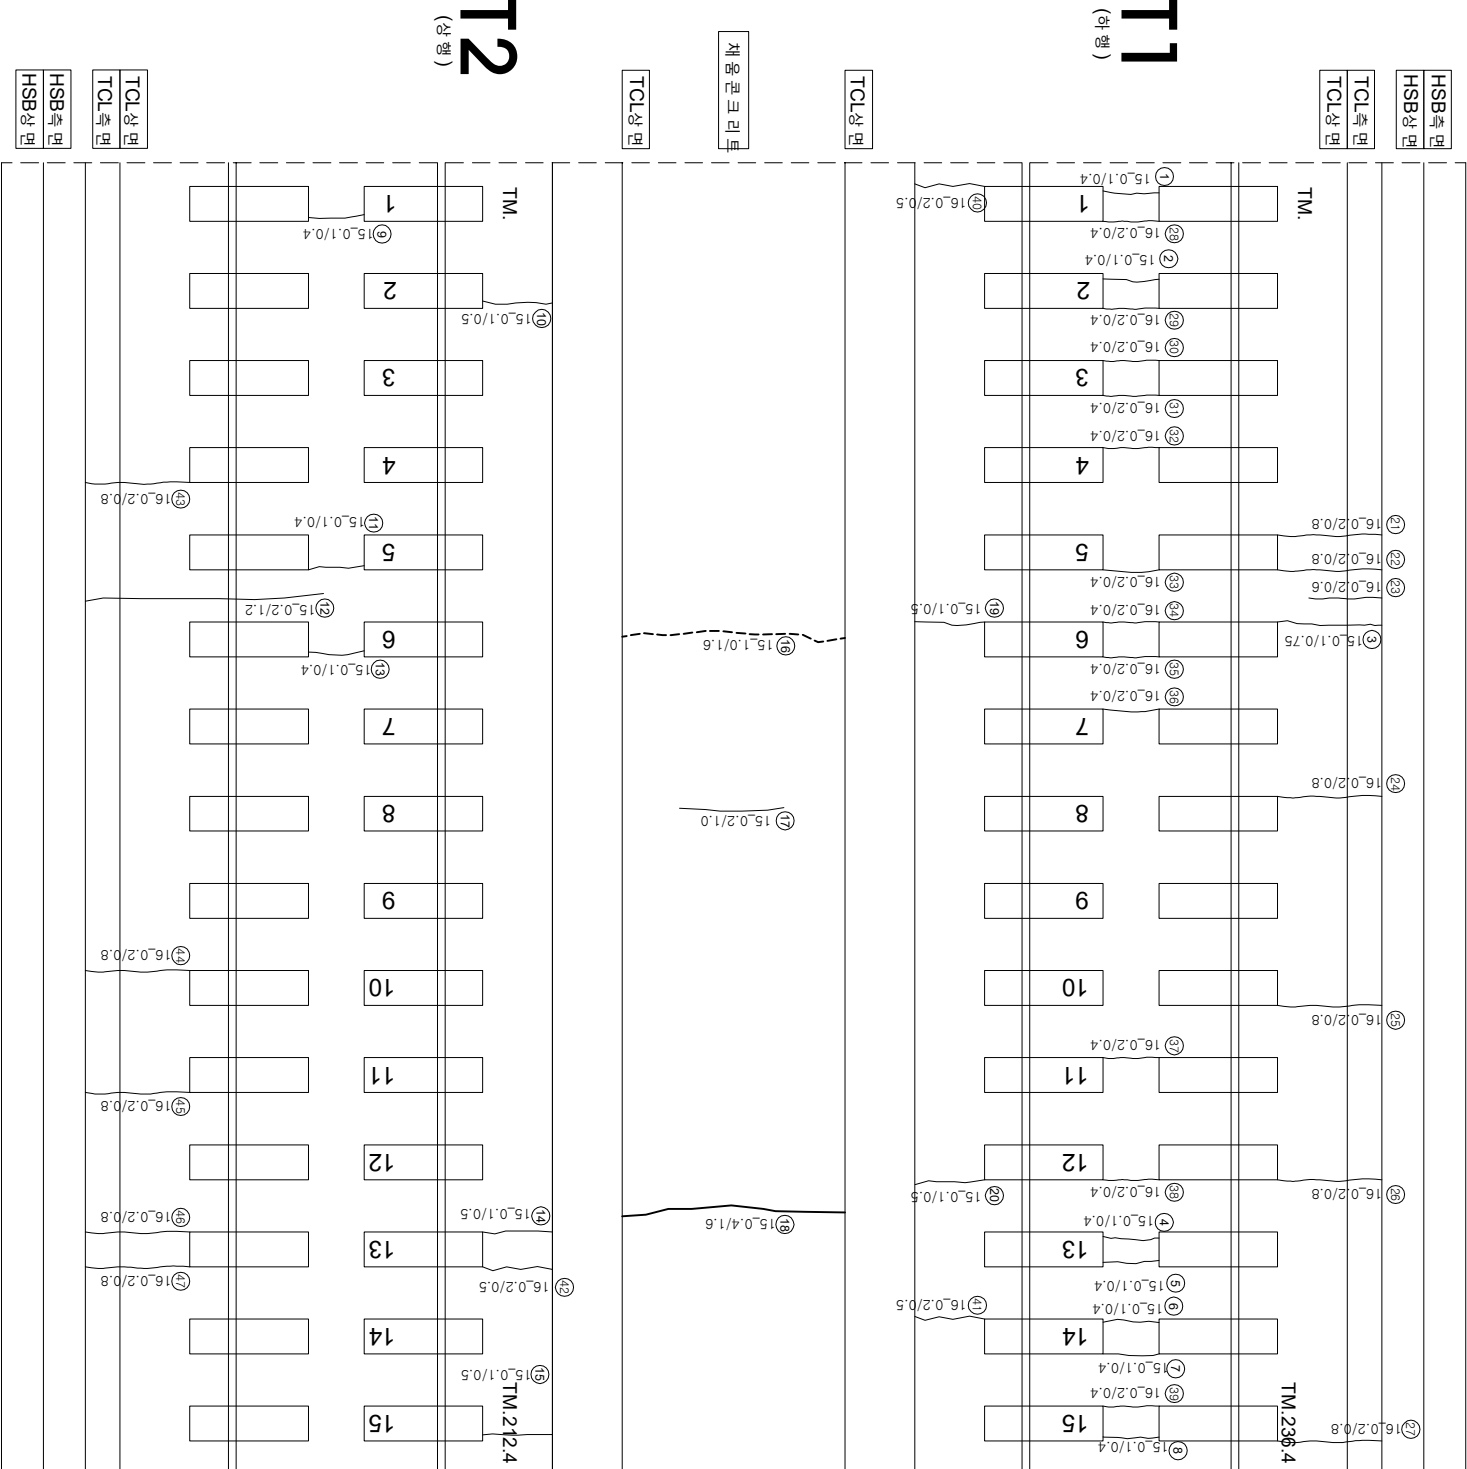

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		56				
2	균열	0.1 mm	0.4 m		57				
3	균열	0.1 mm	0.8 m		58				
4	균열	0.1 mm	0.4 m		59				
5	균열	0.1 mm	0.4 m		60				
6	균열	0.1 mm	0.4 m		61				
7	균열	0.1 mm	0.4 m		62				
8	균열	0.1 mm	0.4 m		63				
9	균열	0.1 mm	0.4 m		64				
10	균열	0.1 mm	0.5 m		65				
11	균열	0.1 mm	0.4 m		66				
12	균열	0.2 mm	1.2 m		67				
13	균열	0.1 mm	0.4 m		68				
14	균열	0.1 mm	0.5 m		69				
15	균열	0.1 mm	0.5 m		70				
16	균열	1.0 mm	1.5 m		71				
17	균열	0.2 mm	1.0 m		72				
18	균열	0.4 mm	1.6 m		73				
19	균열	0.1 mm	0.6 m		74				
20	균열	0.1 mm	0.6 m		75				
21	균열	0.2 mm	0.8 m		76				
22	균열	0.2 mm	0.8 m		77				
23	균열	0.2 mm	0.8 m		78				
24	균열	0.2 mm	0.8 m		79				
25	균열	0.2 mm	0.8 m		80				
26	균열	0.2 mm	0.8 m		81				
27	균열	0.2 mm	0.8 m		82				
28	균열	0.2 mm	0.4 m		83				
29	균열	0.2 mm	0.4 m		84				
30	균열	0.2 mm	0.4 m		85				
31	균열	0.2 mm	0.4 m		86				
32	균열	0.2 mm	0.4 m		87				
33	균열	0.2 mm	0.4 m		88				
34	균열	0.2 mm	0.4 m		89				
35	균열	0.2 mm	0.4 m		90				
36	균열	0.2 mm	0.4 m		91				
37	균열	0.2 mm	0.4 m		92				
38	균열	0.2 mm	0.4 m		93				
39	균열	0.2 mm	0.4 m		94				
40	균열	0.2 mm	0.5 m		95				
41	균열	0.2 mm	0.5 m		96				
42	균열	0.2 mm	0.5 m		97				
43	균열	0.2 mm	0.8 m		98				
44	균열	0.2 mm	0.8 m		99				
45	균열	0.2 mm	0.8 m		100				
46	균열	0.2 mm	0.8 m		101				
47	균열	0.2 mm	0.8 m		102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

시	행 사	영 역	영 역	공 공 사	관 령 지		단 계		
					개 설 전 지	분 야 별 관 영 지			
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검공역	(주) 한국국조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 복 영	간 원 강 김 경 기 문 준 석	원	 0220 (0.3m이하 : 흑색)	 한목도상판리	 재료관리
							 0420 (0.3m초과 0.5m이하 : 황색)	 양상	 철타노출
							 0620 (0.5m초과 1.0m미만 : 적색)	 박리, 박락, 파손	 누수, 슬럼프
							 1020 (1.0m이상 : 분홍색)	 백태	 시공이음 분리, 종분리