


한남고속선 학전터널 - 토공노반 - 61(7.030~7.040km, L=10m)

7K030

7K040

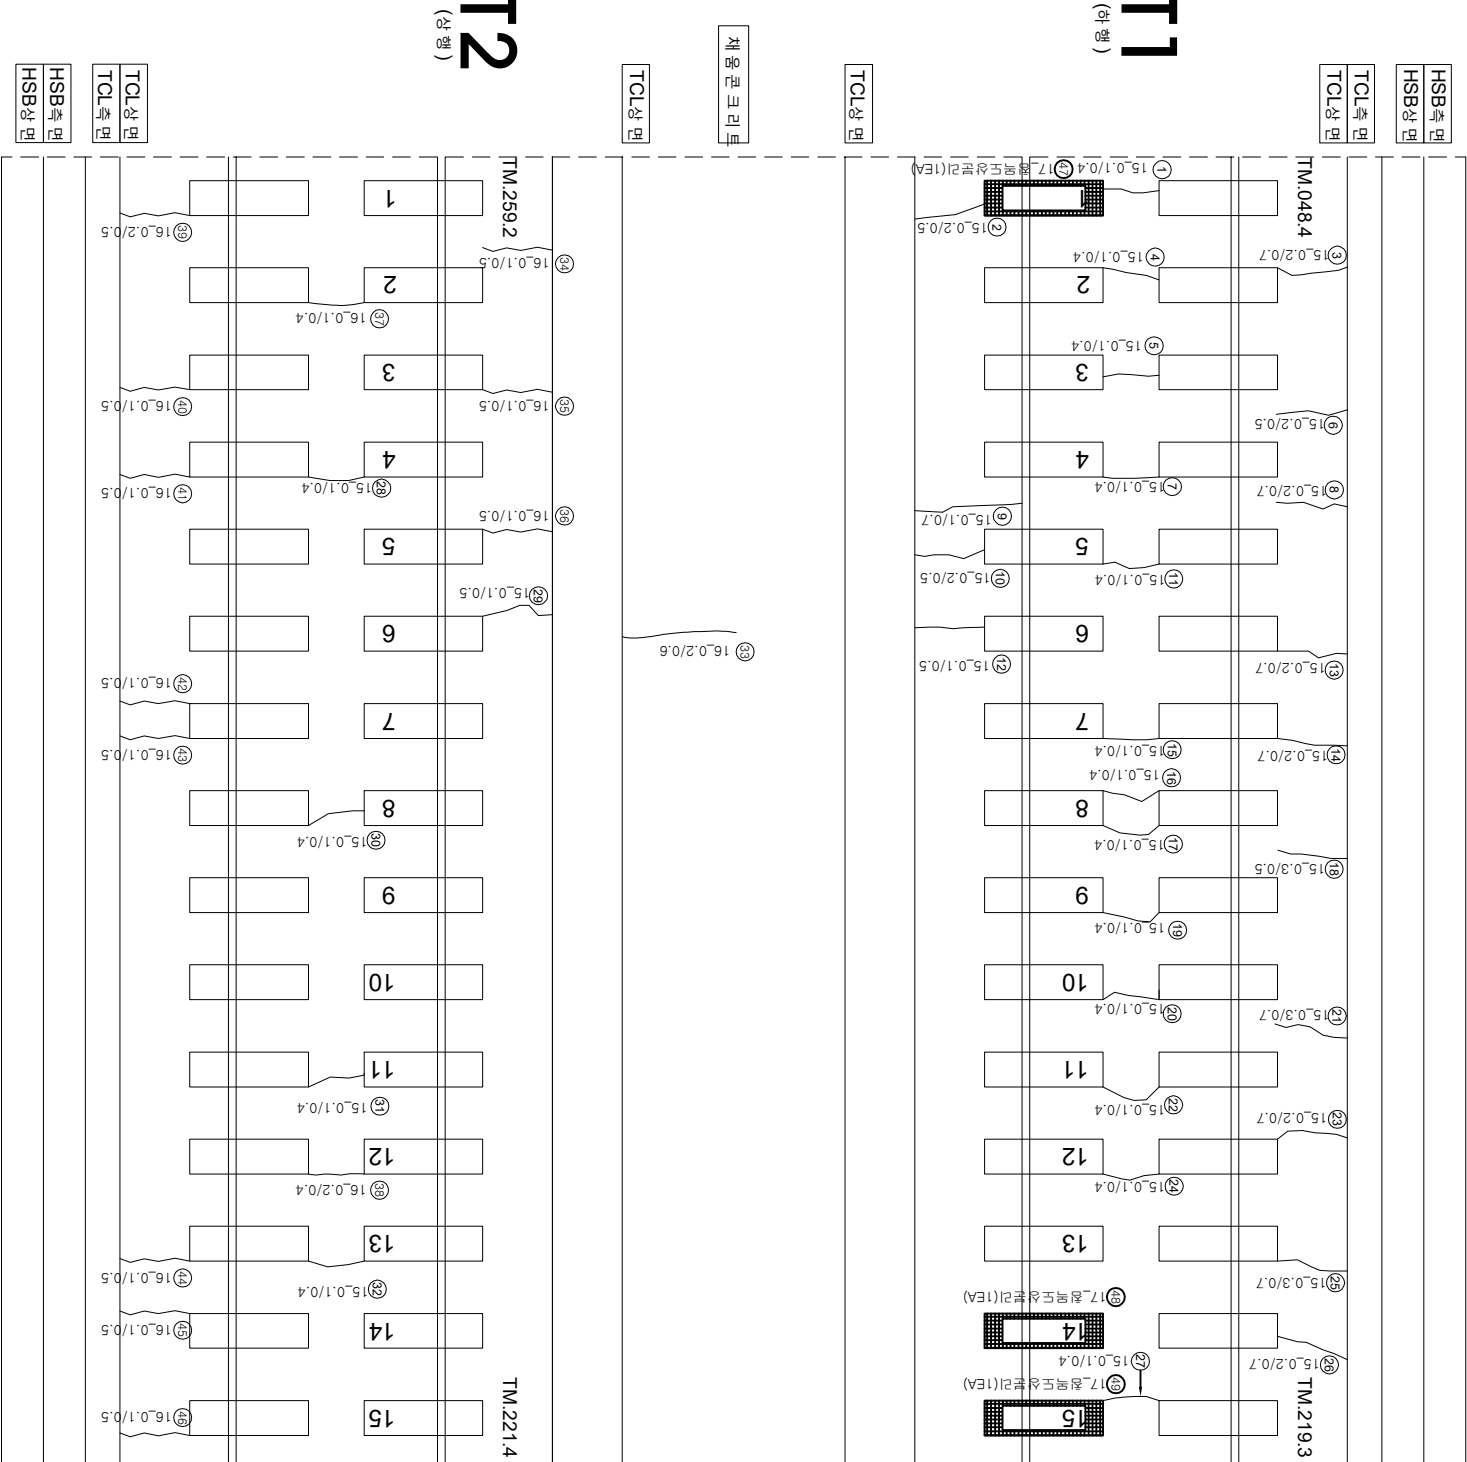

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		56				
2	균열	0.2 mm	0.5 m		57				
3	균열	0.2 mm	0.7 m		58				
4	균열	0.1 mm	0.4 m		59				
5	균열	0.1 mm	0.4 m		60				
6	균열	0.2 mm	0.5 m		61				
7	균열	0.1 mm	0.4 m		62				
8	균열	0.2 mm	0.7 m	복합소	63				
9	균열	0.1 mm	0.7 m		64				
10	균열	0.2 mm	0.5 m		65				
11	균열	0.1 mm	0.4 m		66				
12	균열	0.1 mm	0.5 m		67				
13	균열	0.2 mm	0.7 m		68				
14	균열	0.2 mm	0.7 m		69				
15	균열	0.1 mm	0.4 m		70				
16	균열	0.1 mm	0.4 m		71				
17	균열	0.1 mm	0.4 m		72				
18	균열	0.3 mm	0.5 m		73				
19	균열	0.1 mm	0.4 m		74				
20	균열	0.1 mm	0.4 m		75				
21	균열	0.3 mm	0.7 m		76				
22	균열	0.1 mm	0.4 m		77				
23	균열	0.2 mm	0.7 m		78				
24	균열	0.1 mm	0.4 m		79				
25	균열	0.3 mm	0.7 m		80				
26	균열	0.2 mm	0.7 m		81				
27	균열	0.1 mm	0.4 m		82				
28	균열	0.1 mm	0.4 m		83				
29	균열	0.1 mm	0.5 m		84				
30	균열	0.1 mm	0.4 m		85				
31	균열	0.1 mm	0.4 m		86				
32	균열	0.1 mm	0.4 m		87				
33	균열	0.2 mm	0.8 m		88				
34	균열	0.1 mm	0.5 m		89				
35	균열	0.1 mm	0.5 m		90				
36	균열	0.1 mm	0.5 m		91				
37	균열	0.1 mm	0.4 m		92				
38	균열	0.2 mm	0.4 m		93				
39	균열	0.2 mm	0.5 m		94				
40	균열	0.1 mm	0.5 m		95				
41	균열	0.1 mm	0.5 m		96				
42	균열	0.1 mm	0.5 m		97				
43	균열	0.1 mm	0.5 m		98				
44	균열	0.1 mm	0.5 m		99				
45	균열	0.1 mm	0.5 m		100				
46	균열	0.1 mm	0.5 m		101				
47	침투도상본리		1.0 ea	신규	102				
48	침투도상본리		1.0 ea	신규	103				
49	침투도상본리		1.0 ea	신규	104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

시	행	사	용	역	영	사	단		
							과업 책임지	장 소	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	간 윤 강 김 경 기 문 준 기	영원	 02220 (0.3m이하 : 목박)	 철로받판리	 철로받판리
							 04220 (0.3m초과 0.5m이하 : 광박)	 영상	 철근노출
							 06220 (0.5m초과 1.0m미만 : 목박)	 바리,바라,파손	 누수수은부
							 10220 (1.0m이상 : 통형)	 벽타	 시공이음판리,통판리