


하남고수전산포-토아반-1(8.692~8.701km, L=8m)

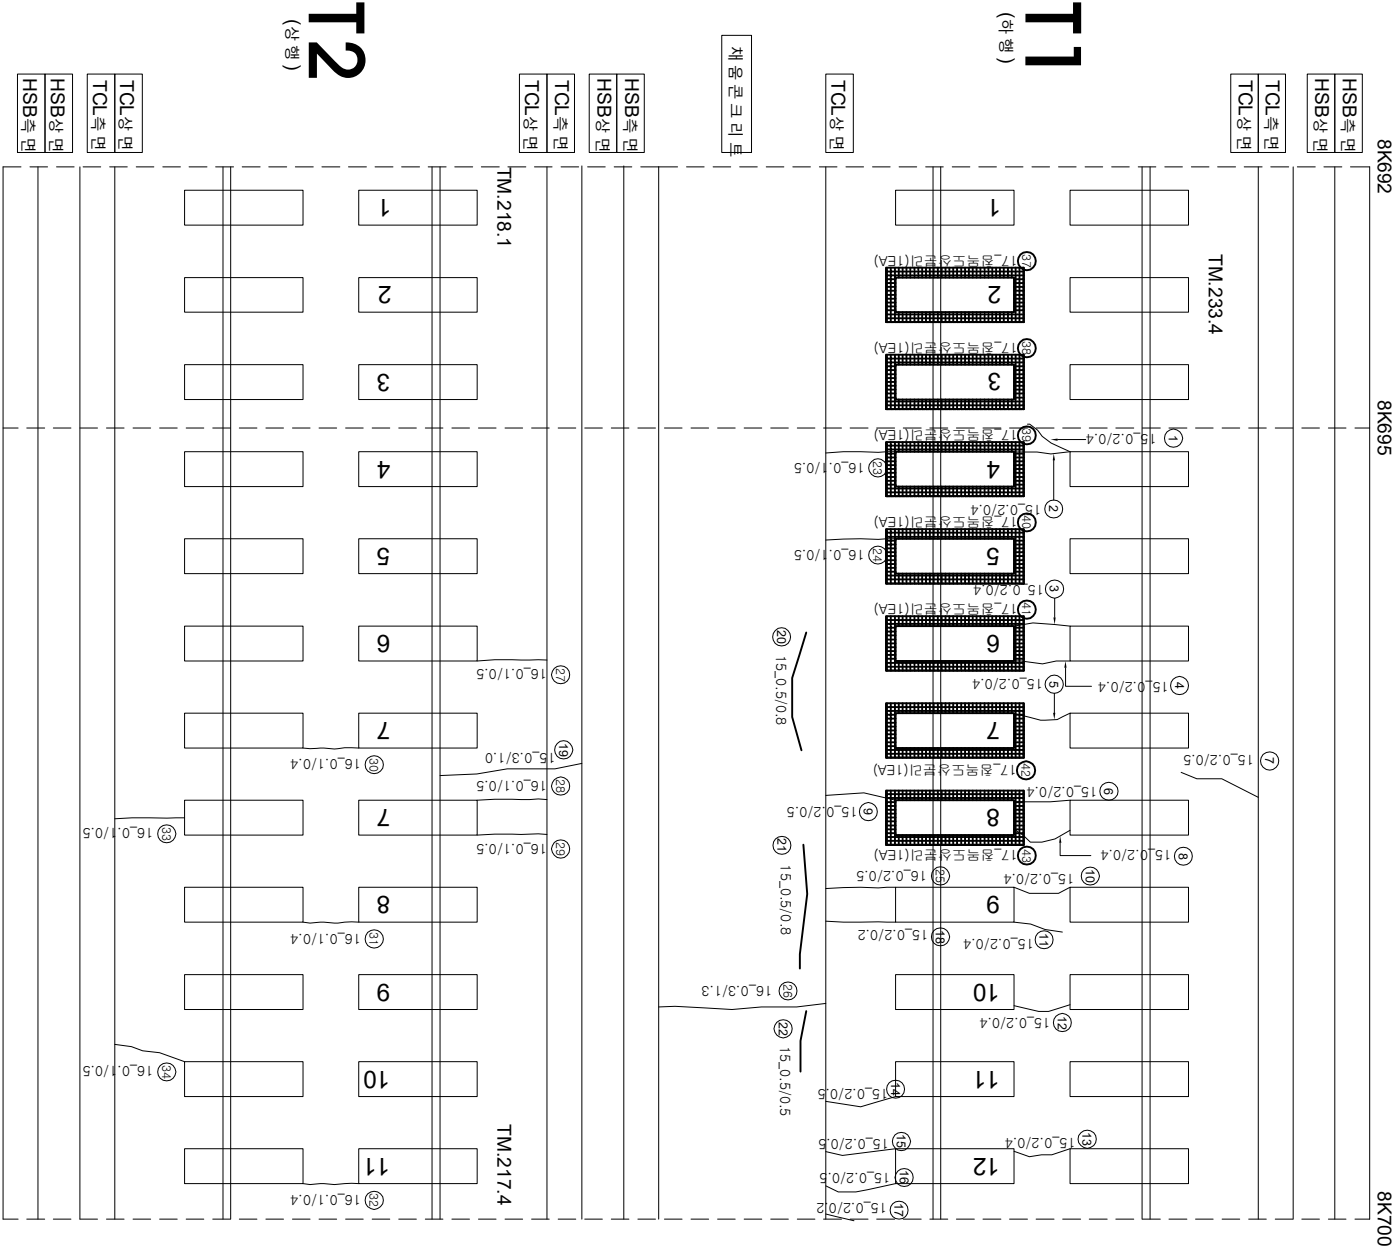

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1					66				
2					67				
3	균열	0.2	mm	0.4	m				
4	균열	0.2	mm	0.4	m				
5	균열	0.2	mm	0.4	m				
6	균열	0.2	mm	0.4	m				
7	균열	0.2	mm	0.4	m				
8	균열	0.2	mm	0.4	m				
9	균열	0.2	mm	0.5	m				
10	균열	0.2	mm	0.4	m				
11	균열	0.2	mm	0.5	m				
12	균열	0.2	mm	0.4	m				
13	균열	0.2	mm	0.4	m				
14	균열	0.2	mm	0.4	m				
15	균열	0.2	mm	0.4	m				
16	균열	0.2	mm	0.4	m				
17	균열	0.2	mm	0.4	m				
18	균열	0.2	mm	0.4	m				
19	균열	0.2	mm	0.4	m				
20	균열	0.2	mm	0.5	m				
21	균열	0.3	mm	1.0	m				
22	균열	0.5	mm	0.8	m				
23	균열	0.5	mm	0.8	m				
24	균열	0.5	mm	0.5	m				
25	균열	0.1	mm	0.5	m				
26	균열	0.1	mm	0.5	m				
27	균열	0.2	mm	0.5	m				
28	균열	0.3	mm	1.3	m				
29	균열	0.1	mm	0.5	m				
30	균열	0.1	mm	0.5	m				
31	균열	0.1	mm	0.5	m				
32	균열	0.1	mm	0.4	m				
33	균열	0.1	mm	0.4	m				
34	균열	0.1	mm	0.4	m				
35	균열	0.1	mm	0.5	m				
36	균열	0.1	mm	0.5	m				
37	잔열도상분리				신규	102			
38	잔열도상분리				신규	103			
39	잔열도상분리				신규	104			
40	잔열도상분리				신규	105			
41	잔열도상분리				신규	106			
42	잔열도상분리				신규	107			
43	잔열도상분리				신규	108			
44						109			
45						110			
46						111			
47						112			
48						113			
49						114			
50						115			
51						116			
52						117			
53						118			
54						119			
55						120			
56						121			
57						122			
58						123			
59						124			
60						125			
61						126			
62						127			
63						128			
64						129			
65						130			

시	행	사	용	역	영	사	단		
							과업 책임지	장 소	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	간원강 김경기 문정기	영원	 0220 (0.3m이하 : 목책)	 영문도강반리	 차로반리
							 0420 (0.3m초과 0.5m이하 : 광책)	 영상간열	 철근노출
							 0620 (0.5m초과 1.0m미만 : 목책)	 반리, 반라, 파손	 누수수은부
							 1020 (1.0m이상 : 통책)	 반대	 시공이음반리, 통반리