


호남고속선 갈산터널_264(11.681~11.691km, S264)

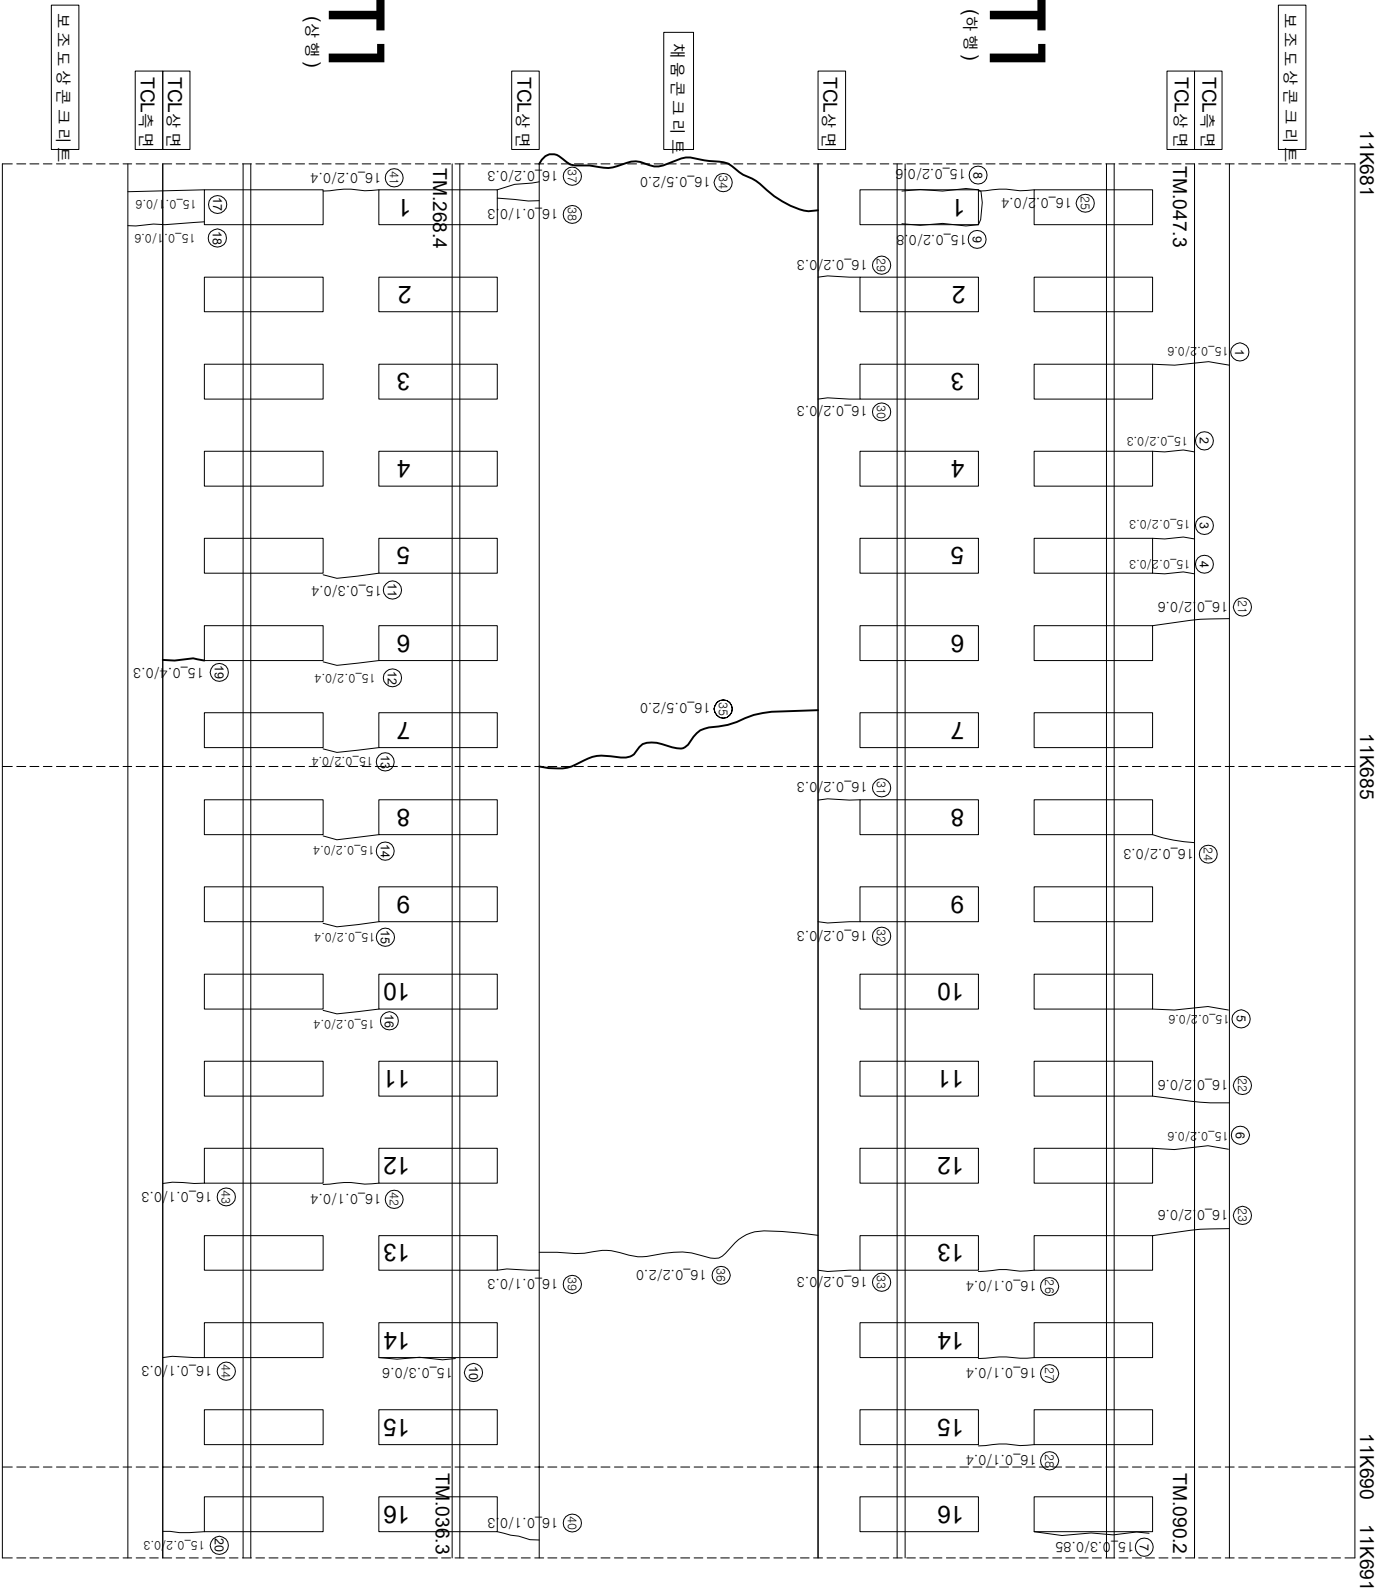

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열 0.2	mm	0.60 m		56				
2	균열 0.2	mm	0.60 m		57				
3	균열 0.2	mm	0.30 m		58				
4	균열 0.2	mm	0.50 m		59				
5	균열 0.2	mm	0.60 m		60				
6	균열 0.3	mm	0.60 m		61				
7	경계부 균열 0.2	mm	0.60 m		62				
8	경계부 균열 0.2	mm	0.60 m		63				
9	경계부 균열 0.2	mm	0.80 m		64				
10	경계부 균열 0.3	mm	0.60 m		65				
11	균열 0.3	mm	0.40 m		66				
12	균열 0.2	mm	0.40 m		67				
13	균열 0.2	mm	0.40 m		68				
14	균열 0.2	mm	0.40 m		69				
15	균열 0.2	mm	0.40 m		70				
16	균열 0.2	mm	0.40 m		71				
17	균열 0.1	mm	0.60 m		72				
18	균열 0.1	mm	0.60 m		73				
19	균열 0.4	mm	0.30 m		74				
20	균열 0.2	mm	0.30 m		75				
21	균열 0.2	mm	0.60 m		76				
22	균열 0.2	mm	0.60 m		77				
23	균열 0.2	mm	0.60 m		78				
24	균열 0.2	mm	0.30 m		79				
25	균열 0.2	mm	0.40 m		80				
26	균열 0.1	mm	0.40 m		81				
27	균열 0.1	mm	0.40 m		82				
28	균열 0.1	mm	0.40 m		83				
29	균열 0.2	mm	0.30 m		84				
30	균열 0.2	mm	0.30 m		85				
31	균열 0.2	mm	0.30 m		86				
32	균열 0.2	mm	0.30 m		87				
33	균열 0.2	mm	0.30 m		88				
34	균열 0.5	mm	2.00 m		89				
35	균열 0.5	mm	2.00 m		90				
36	균열 0.2	mm	2.00 m		91				
37	균열 0.2	mm	0.30 m		92				
38	균열 0.1	mm	0.30 m		93				
39	균열 0.1	mm	0.30 m		94				
40	균열 0.1	mm	0.30 m		95				
41	균열 0.2	mm	0.40 m		96				
42	균열 0.1	mm	0.40 m		97				
43	균열 0.1	mm	0.30 m		98				
44	균열 0.1	mm	0.30 m		99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				