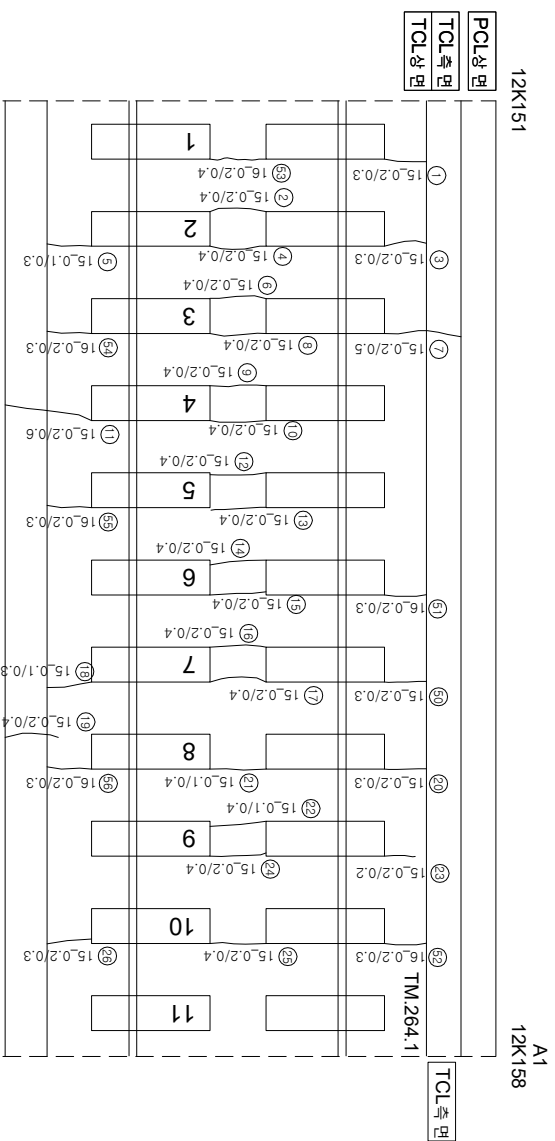
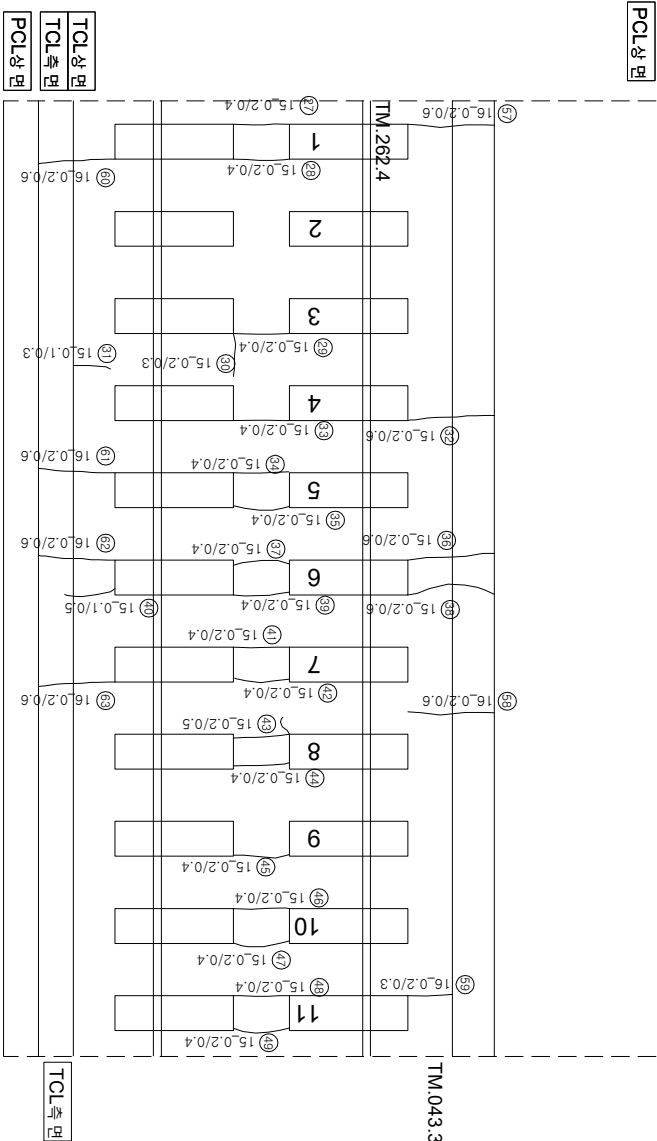


한글교과선금강교_1(12.151~12.158, 전수부)


$$\begin{pmatrix} \text{아} \\ \text{0} \end{pmatrix}$$
$$\begin{pmatrix} \text{아} \\ \text{아} \\ 0 \end{pmatrix}$$


12 (앞
0후
0앞)

(주요사항)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2 mm	0.3 m		56	균열	0.2 mm	0.3 m	
2	균열	0.2 mm	0.4 m		57	균열	0.2 mm	0.6 m	
3	균열	0.2 mm	0.3 m		58	균열	0.2 mm	0.6 m	
4	균열	0.2 mm	0.4 m		59	균열	0.2 mm	0.3 m	
5	균열	0.1 mm	0.3 m		60	균열	0.2 mm	0.6 m	
6	균열	0.2 mm	0.4 m		61	균열	0.2 mm	0.6 m	
7	균열	0.2 mm	0.5 m		62	균열	0.2 mm	0.6 m	
8	균열	0.2 mm	0.4 m		63	균열	0.2 mm	0.6 m	
9	균열	0.2 mm	0.4 m		64				
10	균열	0.2 mm	0.4 m		65				
11	균열	0.2 mm	0.6 m		66				
12	균열	0.2 mm	0.4 m		67				
13	균열	0.2 mm	0.4 m		68				
14	균열	0.2 mm	0.4 m		69				
15	균열	0.2 mm	0.4 m		70				
16	균열	0.2 mm	0.4 m		71				
17	균열	0.2 mm	0.4 m		72				
18	균열	0.1 mm	0.3 m		73				
19	균열	0.2 mm	0.4 m		74				
20	균열	0.2 mm	0.3 m		75				
21	균열	0.1 mm	0.4 m		76				
22	균열	0.1 mm	0.4 m		77				
23	균열	0.2 mm	0.2 m		78				
24	균열	0.2 mm	0.4 m		79				
25	균열	0.2 mm	0.4 m		80				
26	균열	0.2 mm	0.3 m		81				
27	균열	0.2 mm	0.4 m		82				
28	균열	0.2 mm	0.4 m		83				
29	균열	0.2 mm	0.4 m		84				
30	균열	0.2 mm	0.3 m		85				
31	균열	0.1 mm	0.3 m		86				
32	균열	0.2 mm	0.6 m		87				
33	균열	0.2 mm	0.4 m		88				
34	균열	0.2 mm	0.4 m		89				
35	균열	0.2 mm	0.4 m		90				
36	균열	0.2 mm	0.6 m		91				
37	균열	0.2 mm	0.4 m		92				
38	균열	0.2 mm	0.6 m		93				
39	균열	0.2 mm	0.4 m		94				
40	균열	0.1 mm	0.5 m		95				
41	균열	0.2 mm	0.4 m		96				
42	균열	0.2 mm	0.4 m		97				
43	균열	0.2 mm	0.5 m		98				
44	균열	0.2 mm	0.4 m		99				
45	균열	0.2 mm	0.4 m		100				
46	균열	0.2 mm	0.4 m		101				
47	균열	0.2 mm	0.4 m		102				
48	균열	0.2 mm	0.4 m		103				
49	균열	0.2 mm	0.4 m		104				
50	균열	0.1 mm	0.3 m		105				
51	균열	0.2 mm	0.3 m		106				
52	균열	0.2 mm	0.3 m		107				
53	균열	0.2 mm	0.4 m		108				
54	균열	0.2 mm	0.3 m		109				
55	균열	0.2 mm	0.3 m		110				

 한국철도공사 KOREA RAILROAD	시행사	용역명	용역사	이력영		영원	
				계약일지	창의일지	건	
			(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (제) 한국건설품질연구원	김경기 윤석기			
				0.220 (0.3mm이하 : 흑색)	정목도상본리		재료본리
				0.420 (0.5mm초과 0.5mm이하 : 청색)	양산		철근노출
			0.620 (0.5mm초과 1.0mm미만 : 적색)	바리, 바리 파손		누수습윤부	
			1.020 (1.0mm이상 : 분홍색)	백태		시공이음본리, 종본리	