




와 남극권 - 북위 10(14.650~14.660km, L=10m)

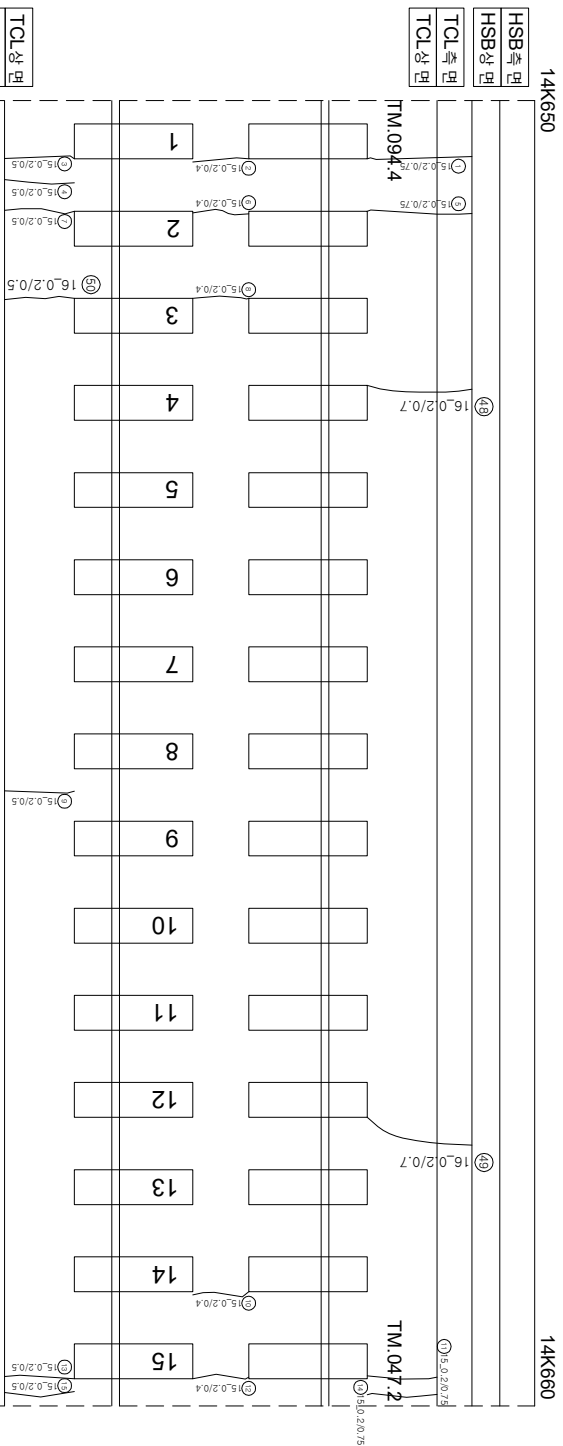

(아와
아) (아와
아)

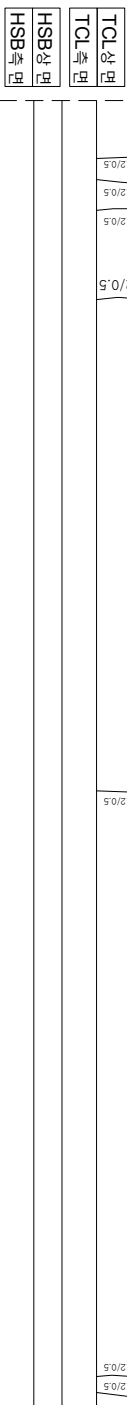

채움콘크리트

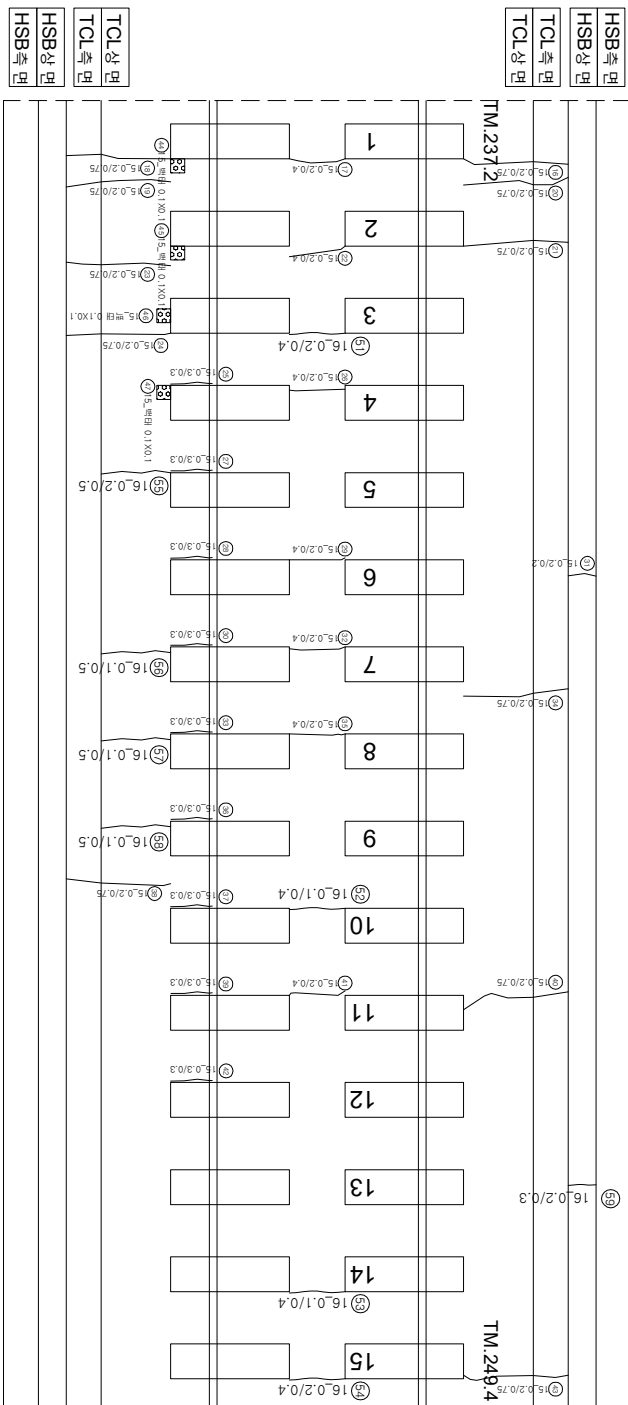

12 (주요)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2	0.75 m		56	균열	0.1	0.5 m	
2	균열	0.2	mm	0.4 m	57	균열	0.1	0.5 m	
3	균열	0.2	mm	0.5 m	58	균열	0.1	mm	0.5 m
4	균열	0.2	mm	0.5 m	59	균열	0.2	mm	0.3 m
5	균열	0.2	mm	0.75 m	60				
6	균열	0.2	mm	0.4 m	61				
7	균열	0.2	mm	0.5 m	62				
8	균열	0.2	mm	0.4 m	63				
9	균열	0.2	mm	0.5 m	64				
10	균열	0.2	mm	0.4 m	65				
11	균열	0.2	mm	0.75 m	66				
12	균열	0.2	mm	0.4 m	67				
13	균열	0.2	mm	0.5 m	68				
14	균열	0.2	mm	0.75 m	69				
15	균열	0.2	mm	0.5 m	70				
16	균열	0.2	mm	0.75 m	71				
17	균열	0.2	mm	0.4 m	72				
18	균열	0.2	mm	0.75 m	73				
19	균열	0.2	mm	0.75 m	74				
20	균열	0.2	mm	0.75 m	75				
21	균열	0.2	mm	0.75 m	76				
22	균열	0.2	mm	0.4 m	77				
23	균열	0.2	mm	0.75 m	78				
24	균열	0.2	mm	0.75 m	79				
25	균열부 균열	0.3	mm	0.3 m	80				
26	균열	0.2	mm	0.4 m	81				
27	균열부 균열	0.3	mm	0.3 m	82				
28	균열부 균열	0.3	mm	0.3 m	83				
29	균열	0.2	mm	0.4 m	84				
30	균열부 균열	0.3	mm	0.3 m	85				
31	균열	0.2	mm	0.2 m	86				
32	균열	0.2	mm	0.4 m	87				
33	균열부 균열	0.3	mm	0.3 m	88				
34	균열	0.2	mm	0.75 m	89				
35	균열	0.2	mm	0.4 m	90				
36	균열부 균열	0.3	mm	0.3 m	91				
37	균열부 균열	0.3	mm	0.3 m	92				
38	균열	0.2	mm	0.75 m	93				
39	균열부 균열	0.3	mm	0.3 m	94				
40	균열	0.2	mm	0.75 m	95				
41	균열	0.2	mm	0.4 m	96				
42	균열부 균열	0.3	mm	0.3 m	97				
43	균열	0.2	mm	0.75 m	98				
44	균열	0.1	m	0.1 m	99				
45	균열	0.1	m	0.1 m	100				
46	균열	0.1	m	0.1 m	101				
47	균열	0.1	m	0.1 m	102				
48	균열	0.2	mm	0.7 m	103				
49	균열	0.2	mm	0.7 m	104				
50	균열	0.2	mm	0.5 m	105				
51	균열	0.2	mm	0.4 m	106				
52	균열	0.1	mm	0.4 m	107				
53	균열	0.1	mm	0.4 m	108				
54	균열	0.2	mm	0.4 m	109				
55	균열	0.2	mm	0.5 m	110				

 한국철도공사 KOREA RAILROAD	시행사	공역명	공역사	건설현황		구분	비고	
			(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이북영	가온강 김정기 윤석기	전체		
					0.2220 (0.3m이하 : 철책)	원목·도랑방리		제초방리
					0.4420 (0.3m초과 0.5m이하 : 경벽)	양상		철근노출
					0.6920 (0.5m초과 1.0m미만 : 격벽)	바리, 바리, 파손		누수 수문부
					1.0220 (1.0m이상 : 분隔壁)	변대		시공이음판리, 홍판리