


호남고속선 장재터널_263(21.502~21.515km, S262)

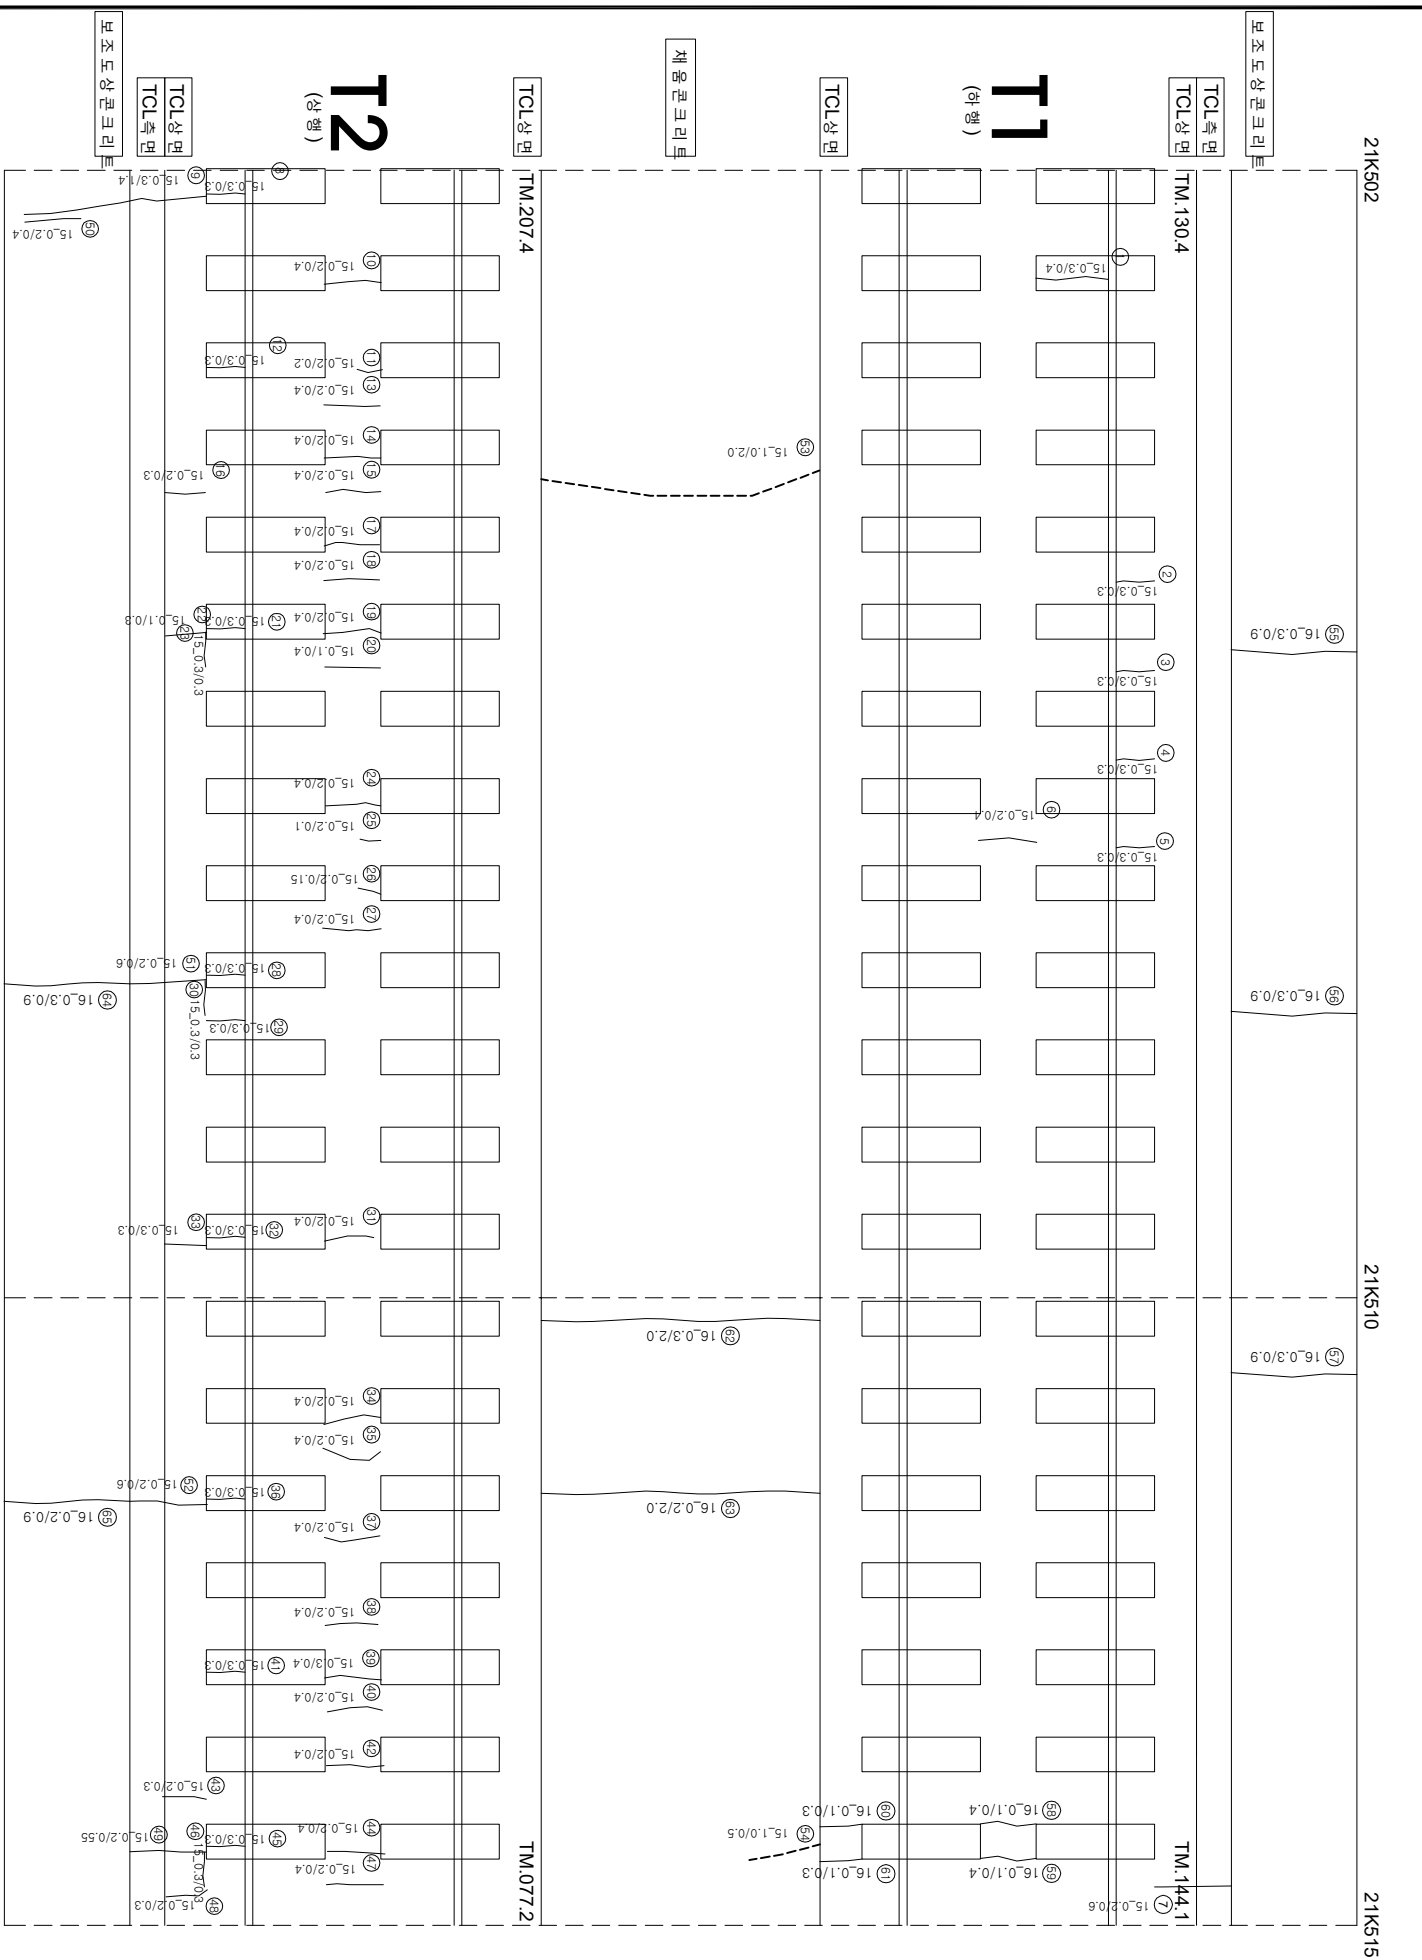

연번	손상	폭	연장	비고	연번	손상	폭	연장	비고		
1	균열	0.3	mm	0.4	m	56	균열	0.3	mm	0.9	m
2	강철부 균열	0.3	mm	0.3	m	57	균열	0.3	mm	0.9	m
3	강철부 균열	0.3	mm	0.3	m	58	균열	0.1	mm	0.4	m
4	강철부 균열	0.3	mm	0.3	m	59	균열	0.1	mm	0.4	m
5	강철부 균열	0.3	mm	0.3	m	60	균열	0.1	mm	0.3	m
6	균열	0.2	mm	0.4	m	61	균열	0.1	mm	0.3	m
7	균열	0.2	mm	0.6	m	62	균열	0.3	mm	2.0	m
8	균열	0.3	mm	0.3	m	63	균열	0.2	mm	2.0	m
9	균열	0.3	mm	1.4	m	64	균열	0.3	mm	0.9	m
10	균열	0.2	mm	0.4	m	65	균열	0.2	mm	0.9	m
11	균열	0.2	mm	0.2	m	66					
12	균열	0.3	mm	0.3	m	67					
13	균열	0.2	mm	0.4	m	68					
14	균열	0.2	mm	0.4	m	69					
15	균열	0.2	mm	0.4	m	70					
16	균열	0.2	mm	0.3	m	71					
17	균열	0.2	mm	0.4	m	72					
18	균열	0.2	mm	0.4	m	73					
19	균열	0.2	mm	0.4	m	74					
20	균열	0.1	mm	0.4	m	75					
21	균열	0.3	mm	0.3	m	76					
22	균열	0.1	mm	0.3	m	77					
23	균열	0.3	mm	0.3	m	78					
24	균열	0.2	mm	0.4	m	79					
25	균열	0.2	mm	0.1	m	80					
26	균열	0.2	mm	0.2	m	81					
27	균열	0.2	mm	0.4	m	82					
28	균열	0.3	mm	0.3	m	83					
29	균열	0.3	mm	0.3	m	84					
30	균열	0.3	mm	0.3	m	85					
31	균열	0.2	mm	0.4	m	86					
32	균열	0.3	mm	0.3	m	87					
33	균열	0.3	mm	0.3	m	88					
34	균열	0.2	mm	0.4	m	89					
35	균열	0.2	mm	0.4	m	90					
36	균열	0.3	mm	0.3	m	91					
37	균열	0.2	mm	0.4	m	92					
38	균열	0.2	mm	0.4	m	93					
39	균열	0.3	mm	0.4	m	94					
40	균열	0.2	mm	0.4	m	95					
41	균열	0.3	mm	0.3	m	96					
42	균열	0.2	mm	0.4	m	97					
43	균열	0.2	mm	0.3	m	98					
44	균열	0.2	mm	0.4	m	99					
45	균열	0.3	mm	0.3	m	100					
46	균열	0.3	mm	0.3	m	101					
47	균열	0.2	mm	0.4	m	102					
48	균열	0.2	mm	0.3	m	103					
49	균열	0.2	mm	0.55	m	104					
50	균열	0.2	mm	0.4	m	105					
51	균열	0.2	mm	0.6	m	106					
52	균열	0.2	mm	0.6	m	107					
53	균열	1.0	mm	2.0	m	108					
54	균열	1.0	mm	0.5	m	109					
55	균열	0.3	mm	0.9	m	110					