


호남고속선 영곡터널_245(25.370~25.382km, S245)

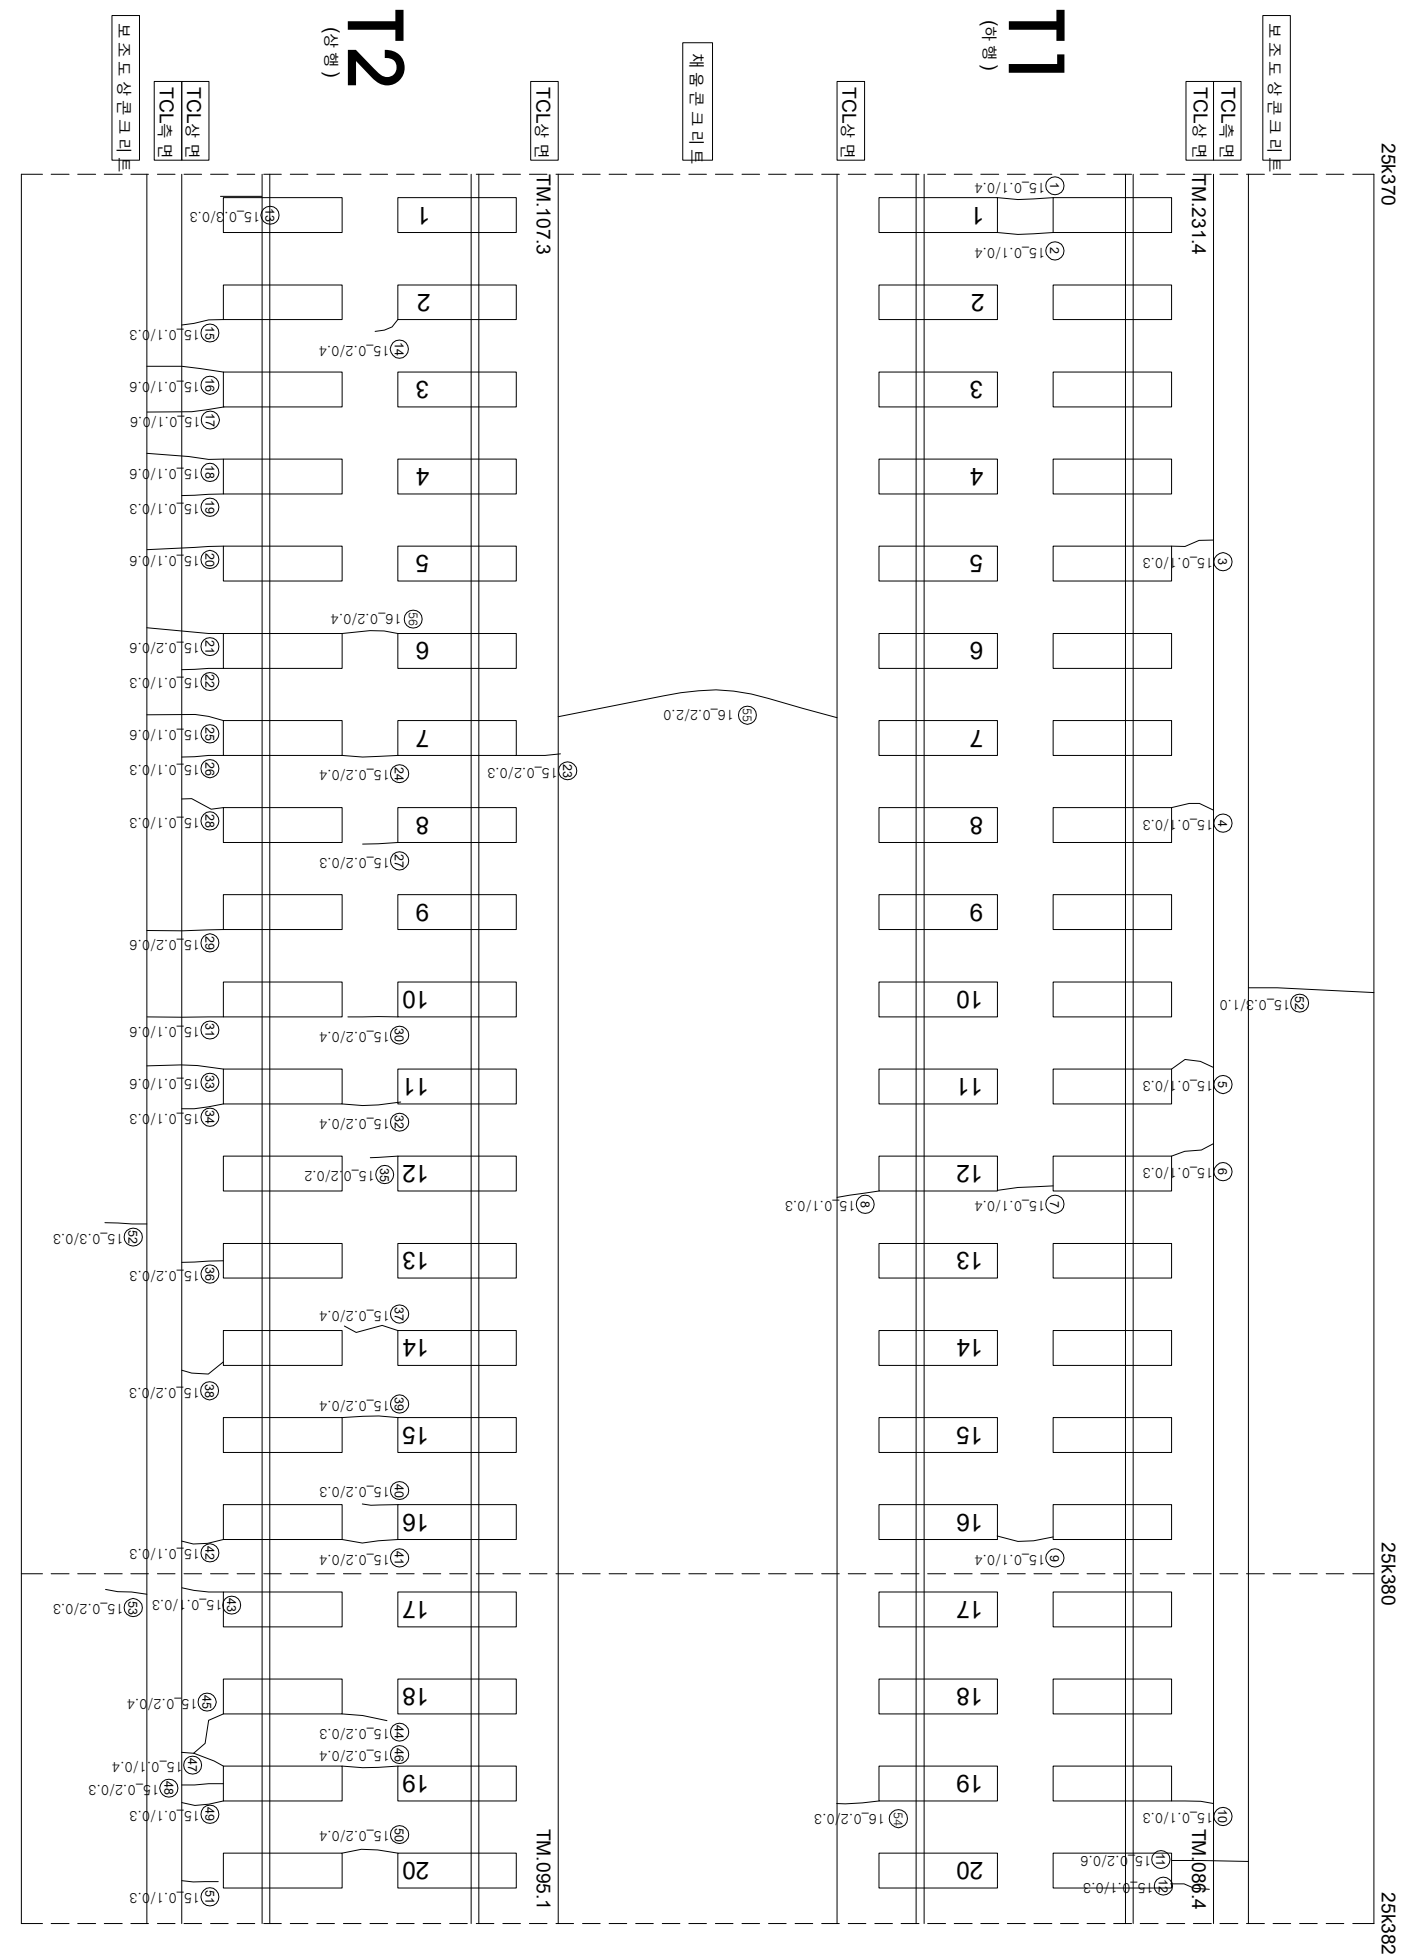

연번	순차	폭	연장	비고	연번	순차	폭	연장	비고
1	균열	0.1 mm	0.4 m		57	균열	0.2 mm		
2	균열	0.1 mm	0.4 m		58				
3	균열	0.1 mm	0.3 m		59				
4	균열	0.1 mm	0.3 m		60				
5	균열	0.1 mm	0.3 m		61				
6	균열	0.1 mm	0.3 m		62				
7	균열	0.1 mm	0.4 m		63				
8	균열	0.1 mm	0.3 m		64				
9	균열	0.1 mm	0.4 m		65				
10	균열	0.1 mm	0.3 m		66				
11	균열	0.2 mm	0.6 m		67				
12	균열	0.1 mm	0.3 m		68				
13	균열	0.3 mm	0.3 m		69				
14	균열	0.2 mm	0.4 m		70				
15	균열	0.1 mm	0.3 m		71				
16	균열	0.1 mm	0.6 m		72				
17	균열	0.1 mm	0.6 m		73				
18	균열	0.1 mm	0.6 m		74				
19	균열	0.1 mm	0.6 m		75				
20	균열	0.1 mm	0.6 m		76				
21	균열	0.2 mm	0.6 m		77				
22	균열	0.1 mm	0.3 m		78				
23	균열	0.2 mm	0.3 m		79				
24	균열	0.2 mm	0.4 m		80				
25	균열	0.1 mm	0.6 m		81				
26	균열	0.1 mm	0.3 m		82				
27	균열	0.2 mm	0.3 m		83				
28	균열	0.1 mm	0.3 m		84				
29	균열	0.2 mm	0.6 m		85				
30	균열	0.2 mm	0.4 m		86				
31	균열	0.1 mm	0.6 m		87				
32	균열	0.2 mm	0.4 m		88				
33	균열	0.1 mm	0.6 m		89				
34	균열	0.1 mm	0.3 m		90				
35	균열	0.2 mm	0.2 m		91				
36	균열	0.2 mm	0.3 m		92				
37	균열	0.2 mm	0.4 m		93				
38	균열	0.2 mm	0.3 m		94				
39	균열	0.2 mm	0.4 m		95				
40	균열	0.2 mm	0.3 m		96				
41	균열	0.2 mm	0.4 m		97				
42	균열	0.1 mm	0.3 m		98				
43	균열	0.1 mm	0.3 m		99				
44	균열	0.2 mm	0.3 m		100				
45	균열	0.2 mm	0.4 m		101				
46	균열	0.2 mm	0.4 m		102				
47	균열	0.1 mm	0.4 m		103				
48	균열	0.2 mm	0.3 m		104				
49	균열	0.1 mm	0.3 m		105				
50	균열	0.2 mm	0.4 m		106				
51	균열	0.1 mm	0.3 m		107				
52	균열	0.3 mm	1.0 m	칼리줄기	108				
53	균열	0.2 mm	0.3 m		109				
54	균열	0.2 mm	0.3 m		110				
55	균열	0.2 mm	2.0 m						

[illegible]