


호남고속선 영곡터널_249(25.420~25.432km, S249)

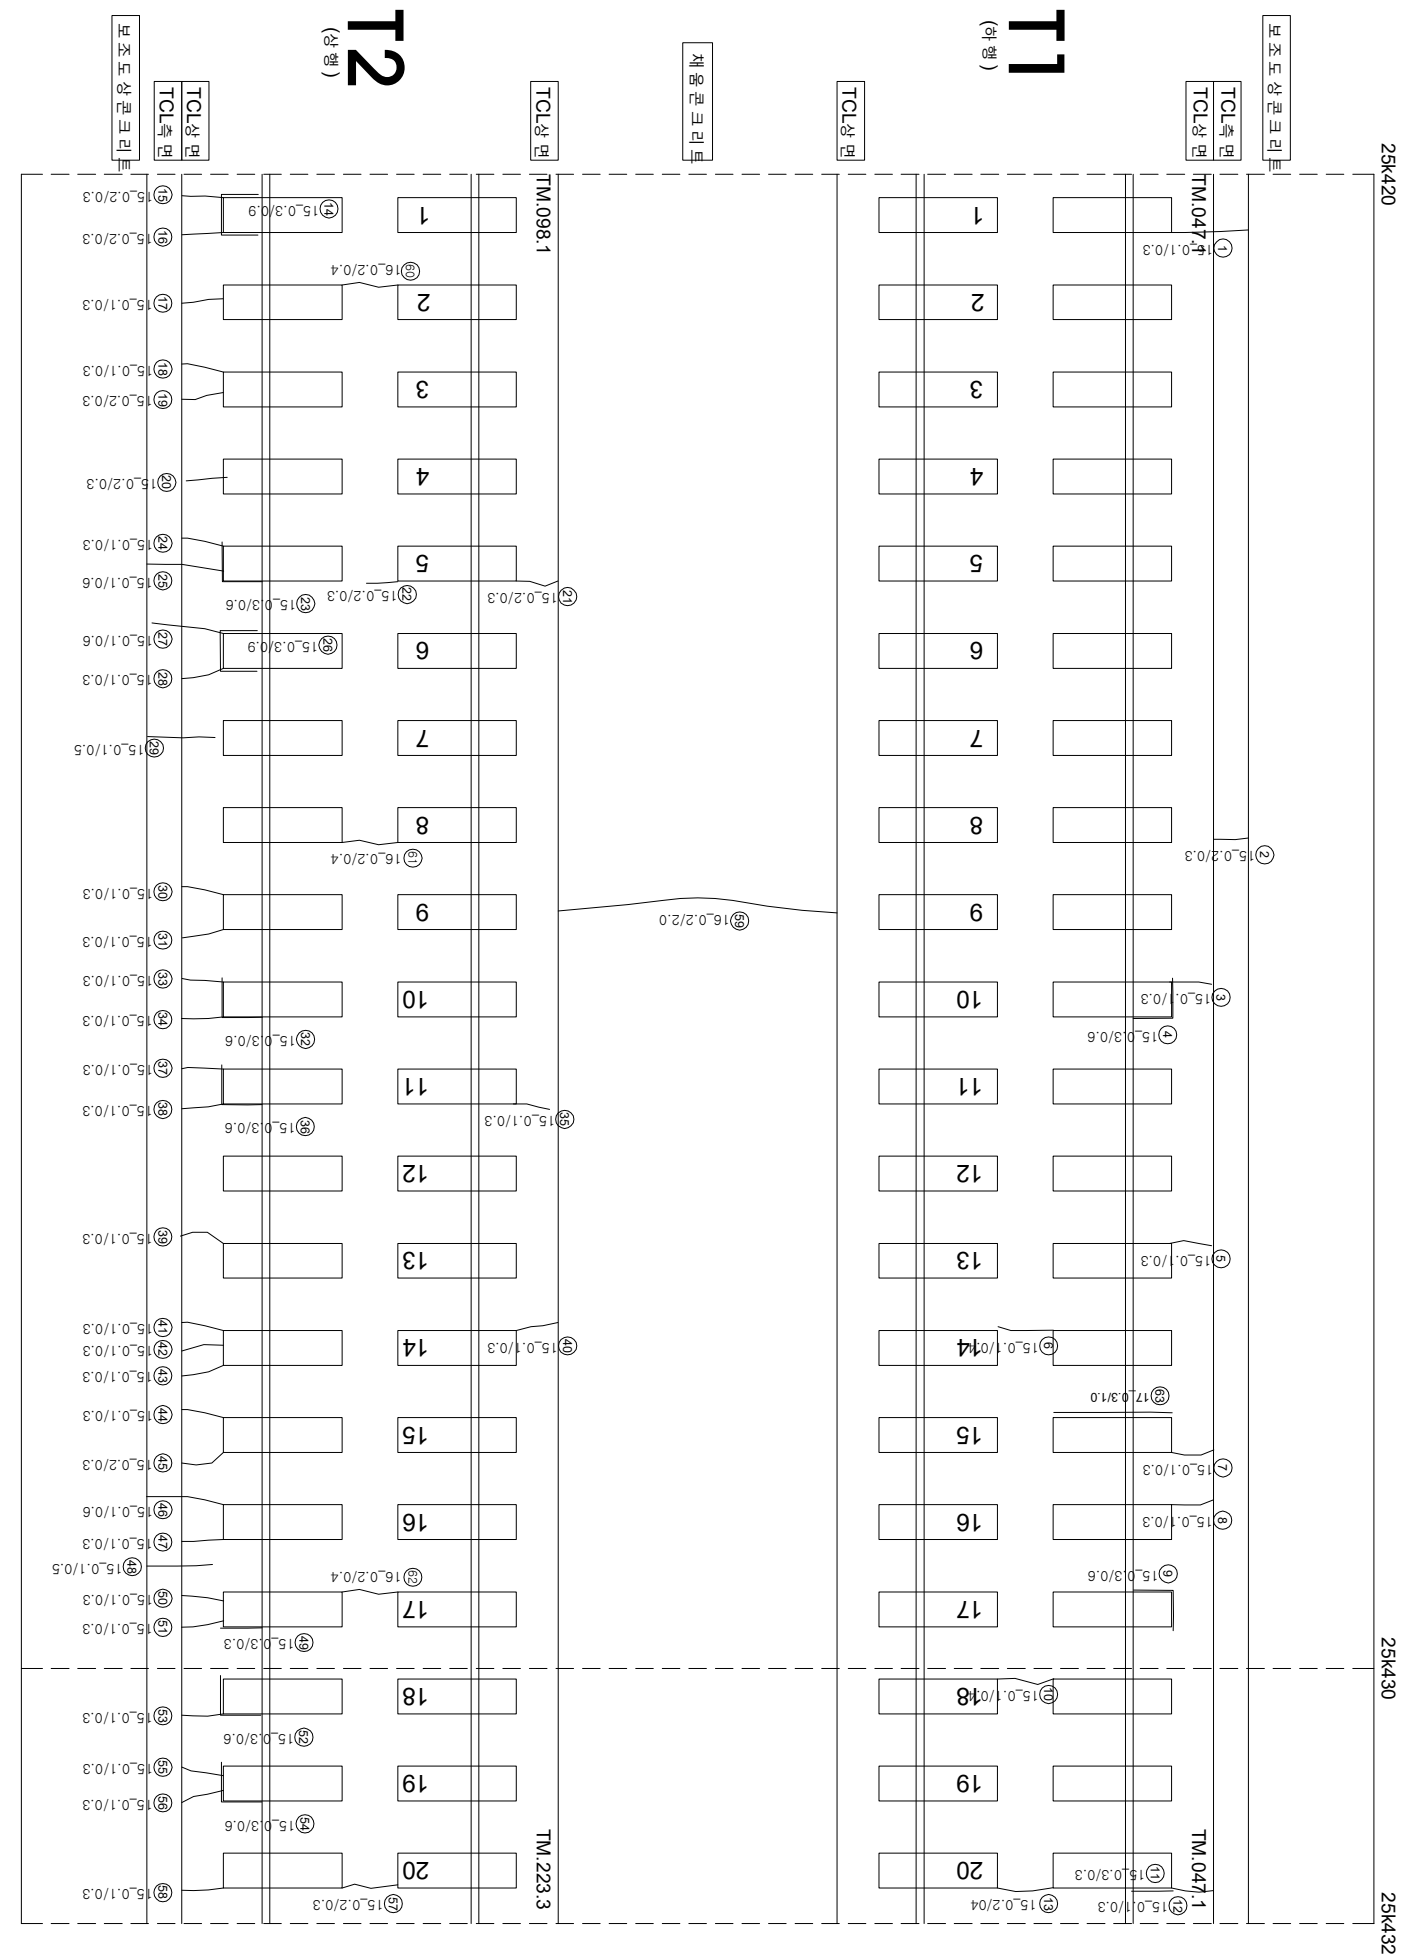

연번	순차	특	연장	비고	연번	순차	특	연장	비고
1	균열	0.1 mm	0.3 m		56	균열	0.1 mm	0.3 m	
2	균열	0.2 mm	0.3 m		57	균열	0.2 mm	0.3 m	
3	강재부 균열	0.1 mm	0.3 m		58	균열	0.2 mm	2.0 m	
4	강재부 균열	0.3 mm	0.6 m		59	균열	0.2 mm	2.0 m	
5	균열	0.1 mm	0.3 m		60	균열	0.2 mm	0.4 m	
6	균열	0.1 mm	0.4 m		61	균열	0.2 mm	0.4 m	
7	균열	0.1 mm	0.3 m		62	균열	0.2 mm	0.4 m	
8	균열	0.1 mm	0.3 m		63	강재부 균열	0.3 mm	1.0 m	신구
9	균열	0.3 mm	0.6 m		64				
10	균열	0.1 mm	0.4 m		65				
11	균열	0.3 mm	0.3 m		66				
12	균열	0.1 mm	0.3 m		67				
13	균열	0.2 mm	0.4 m		68				
14	강재부 균열	0.3 mm	0.9 m		69				
15	균열	0.2 mm	0.3 m		70				
16	균열	0.2 mm	0.3 m		71				
17	균열	0.1 mm	0.3 m		72				
18	균열	0.1 mm	0.3 m		73				
19	균열	0.2 mm	0.3 m		74				
20	균열	0.2 mm	0.3 m		75				
21	균열	0.2 mm	0.3 m		76				
22	균열	0.2 mm	0.3 m		77				
23	강재부 균열	0.3 mm	0.6 m		78				
24	균열	0.1 mm	0.3 m		79				
25	균열	0.1 mm	0.6 m		80				
26	강재부 균열	0.3 mm	0.9 m		81				
27	균열	0.1 mm	0.6 m		82				
28	균열	0.1 mm	0.3 m		83				
29	균열	0.1 mm	0.5 m		84				
30	균열	0.1 mm	0.3 m		85				
31	균열	0.1 mm	0.3 m		86				
32	강재부 균열	0.3 mm	0.6 m		87				
33	균열	0.1 mm	0.3 m		88				
34	균열	0.1 mm	0.3 m		89				
35	균열	0.1 mm	0.3 m		90				
36	강재부 균열	0.3 mm	0.6 m		91				
37	균열	0.1 mm	0.3 m		92				
38	균열	0.1 mm	0.3 m		93				
39	균열	0.1 mm	0.3 m		94				
40	균열	0.1 mm	0.3 m		95				
41	균열	0.1 mm	0.3 m		96				
42	균열	0.1 mm	0.3 m		97				
43	균열	0.1 mm	0.3 m		98				
44	균열	0.1 mm	0.3 m		99				
45	균열	0.2 mm	0.3 m		100				
46	균열	0.1 mm	0.6 m		101				
47	균열	0.1 mm	0.3 m		102				
48	균열	0.1 mm	0.5 m		103				
49	강재부 균열	0.3 mm	0.3 m		104				
50	균열	0.1 mm	0.3 m		105				
51	균열	0.1 mm	0.3 m		106				
52	강재부 균열	0.3 mm	0.6 m		107				
53	균열	0.1 mm	0.3 m		108				
54	강재부 균열	0.3 mm	0.6 m		109				
55	균열	0.1 mm	0.3 m		110				

[illegible]