


호남고속선 계룡터널_679(36.377~36.382km, S679)

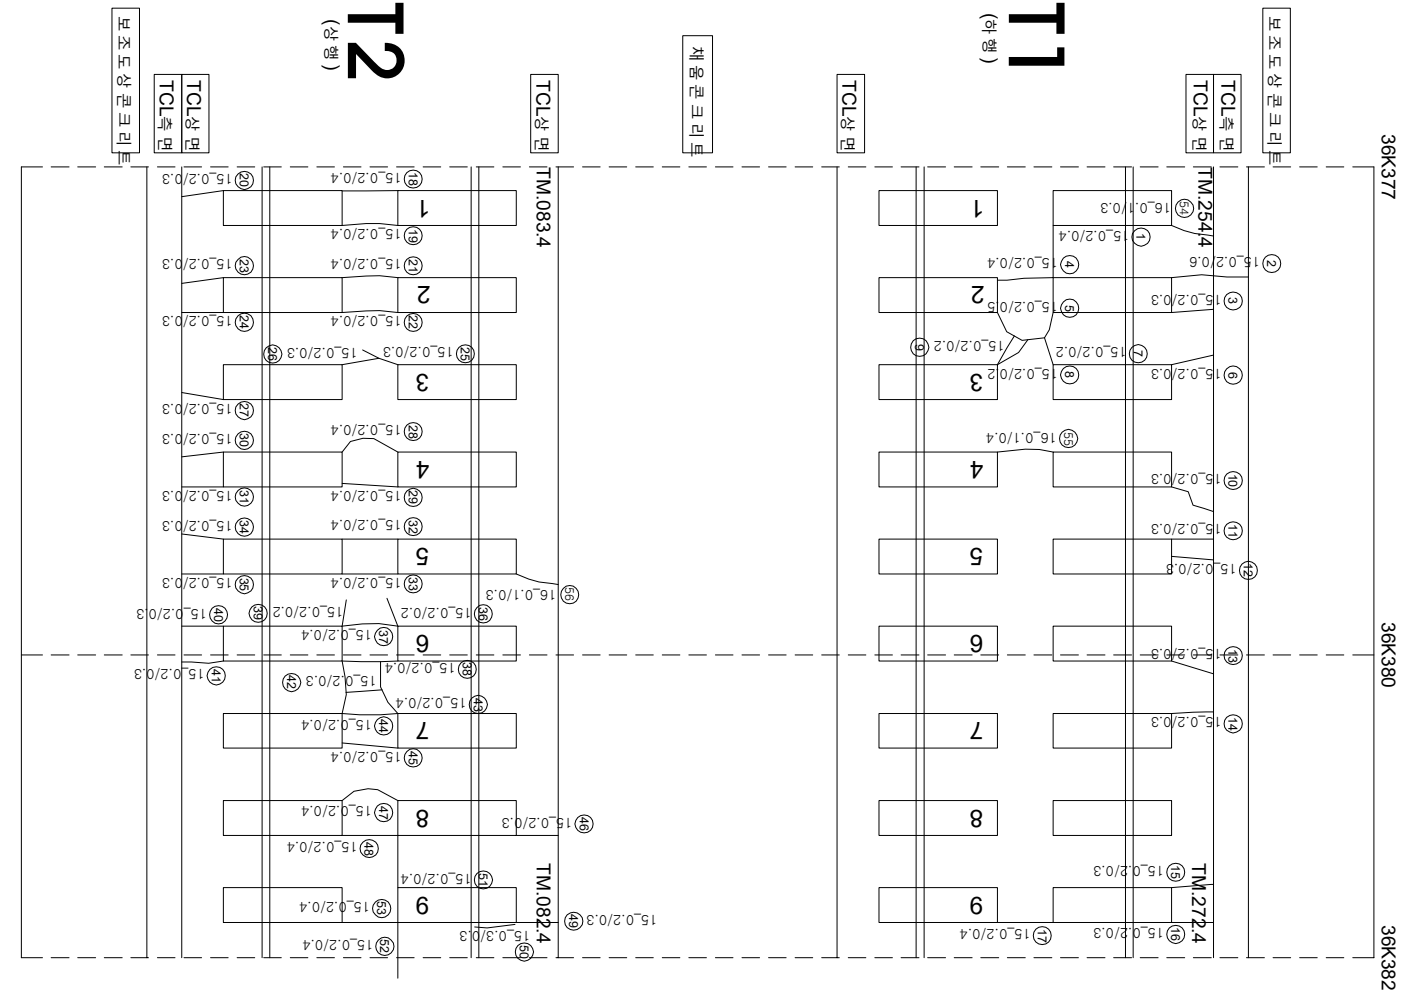

연번	순차	폭		연장	비고	연번	순차	폭		연장	비고
		0.1 mm	0.3 m					0.1 mm	0.3 m		
1	균열	0.2	0.4	m		56	균열				
2	균열	0.2	0.6	m		57					
3	균열	0.2	0.3	m		58					
4	균열	0.2	0.4	m		59					
5	균열	0.2	0.5	m		60					
6	균열	0.2	0.3	m		61					
7	균열	0.2	0.2	m		62					
8	균열	0.2	0.2	m		63					
9	균열	0.2	0.2	m		64					
10	균열	0.2	0.3	m		65					
11	균열	0.2	0.3	m		66					
12	균열	0.2	0.3	m		67					
13	균열	0.2	0.3	m		68					
14	균열	0.2	0.3	m		69					
15	균열	0.2	0.3	m		70					
16	균열	0.2	0.3	m		71					
17	균열	0.2	0.4	m		72					
18	균열	0.2	0.4	m		73					
19	균열	0.2	0.4	m		74					
20	균열	0.2	0.3	m		75					
21	균열	0.2	0.4	m		76					
22	균열	0.2	0.4	m		77					
23	균열	0.2	0.3	m		78					
24	균열	0.2	0.3	m		79					
25	균열	0.2	0.3	m		80					
26	균열	0.2	0.3	m		81					
27	균열	0.2	0.3	m		82					
28	균열	0.2	0.4	m		83					
29	균열	0.2	0.4	m		84					
30	균열	0.2	0.3	m		85					
31	균열	0.2	0.3	m		86					
32	균열	0.2	0.4	m		87					
33	균열	0.2	0.4	m		88					
34	균열	0.2	0.3	m		89					
35	균열	0.2	0.3	m		90					
36	균열	0.2	0.2	m		91					
37	균열	0.2	0.4	m		92					
38	균열	0.2	0.4	m		93					
39	균열	0.2	0.2	m		94					
40	균열	0.2	0.3	m		95					
41	균열	0.2	0.3	m		96					
42	균열	0.2	0.3	m		97					
43	균열	0.2	0.4	m		98					
44	균열	0.2	0.4	m		99					
45	균열	0.2	0.4	m		100					
46	균열	0.2	0.3	m		101					
47	균열	0.2	0.4	m		102					
48	균열	0.2	0.4	m		103					
49	균열	0.2	0.3	m		104					
50	경계부 균열	0.3	0.3	m		105					
51	균열	0.2	0.4	m		106					
52	균열	0.2	0.4	m		107					
53	균열	0.2	0.4	m		108					
54	균열	0.1	0.3	m		109					
55	균열	0.1	0.4	m		110					

시	행 사	영 역	영 역	영 역	사	과		장	아	지	단	
						제	인					본
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검공역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	김 완 강 김 경 기 문 준 기	영 연		0.220	(0.3mm이하 : 흑색)	참목도상판리		재료판리
								0.420	(0.3mm초과 0.5mm이하 : 황색)	망상		철판노출
								0.620	(0.5mm초과 1.0mm미만 : 적색)	박리, 박락, 파손		누수, 슬럼프
								1.020	(1.0mm이상 : 분홍색)	백태		시공이음판리, 종판리