


호남고속선 계룡터널_95(30.028~30.038km, S95)

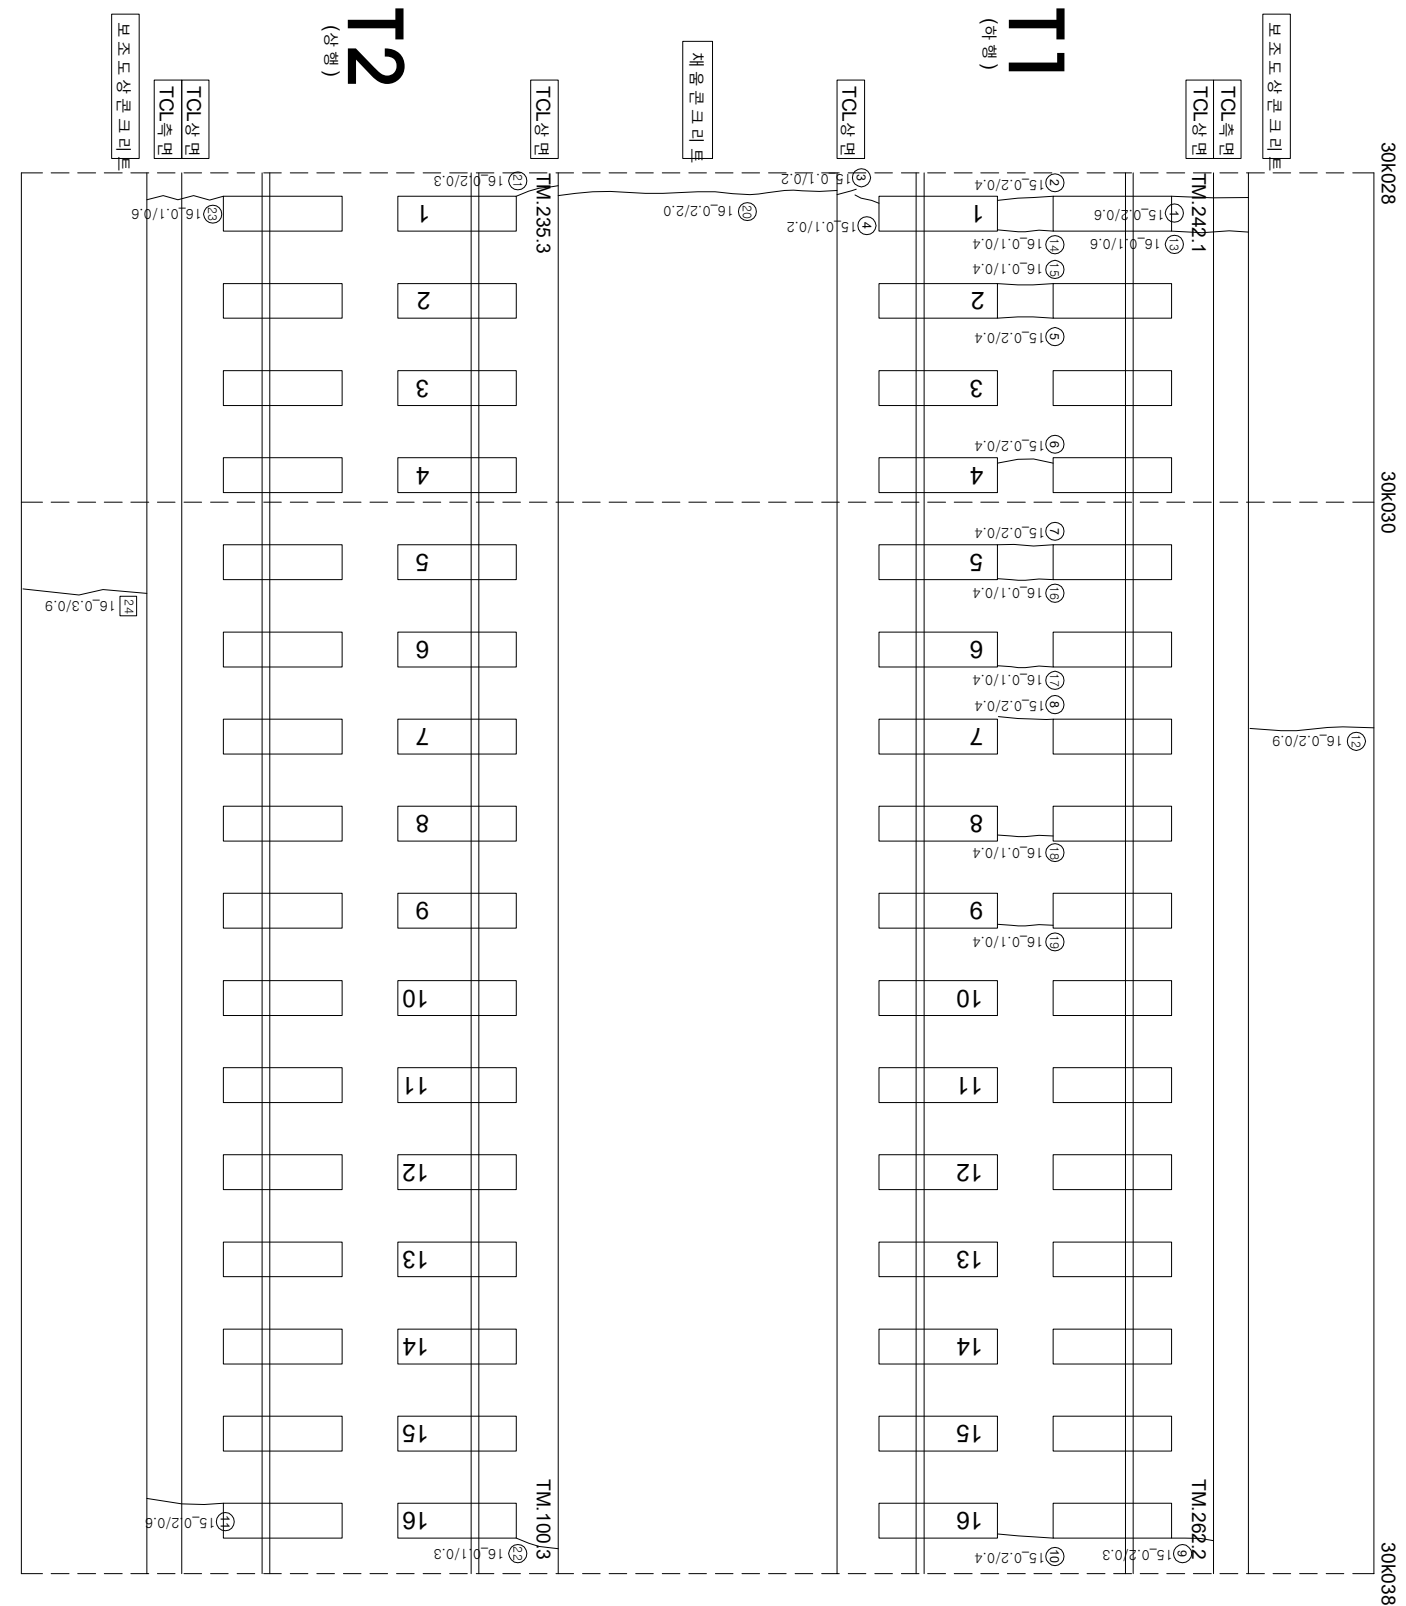

연번	순차	폭	연장	비고	연번	순차	폭	연장	비고
1	균열	0.2 mm	0.6 m		56				
2	균열	0.2 mm	0.4 m		57				
3	균열	0.1 mm	0.2 m		58				
4	균열	0.1 mm	0.2 m		59				
5	균열	0.2 mm	0.4 m		60				
6	균열	0.2 mm	0.4 m		61				
7	균열	0.2 mm	0.4 m		62				
8	균열	0.2 mm	0.4 m		63				
9	균열	0.2 mm	0.3 m		64				
10	균열	0.2 mm	0.4 m		65				
11	균열	0.2 mm	0.6 m		66				
12	균열	0.2 mm	0.9 m		67				
13	균열	0.1 mm	6.0 m		68				
14	균열	0.1 mm	0.4 m		69				
15	균열	0.1 mm	0.4 m		70				
16	균열	0.1 mm	0.4 m		71				
17	균열	0.1 mm	0.4 m		72				
18	균열	0.1 mm	0.4 m		73				
19	균열	0.1 mm	0.4 m		74				
20	균열	0.2 mm	2.0 m		75				
21	균열	0.2 mm	0.3 m		76				
22	균열	0.1 mm	0.3 m		77				
23	균열	0.1 mm	0.6 m		78				
24	균열	0.3 mm	0.9 m	2017년도 보수	79				
25					80				
26					81				
27					82				
28					83				
29					84				
30					85				
31					86				
32					87				
33					88				
34					89				
35					90				
36					91				
37					92				
38					93				
39					94				
40					95				
41					96				
42					97				
43					98				
44					99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				