


호남고속선 양지터널 - 토공 노반 - 38 (40.950~40.960km, L=10m)

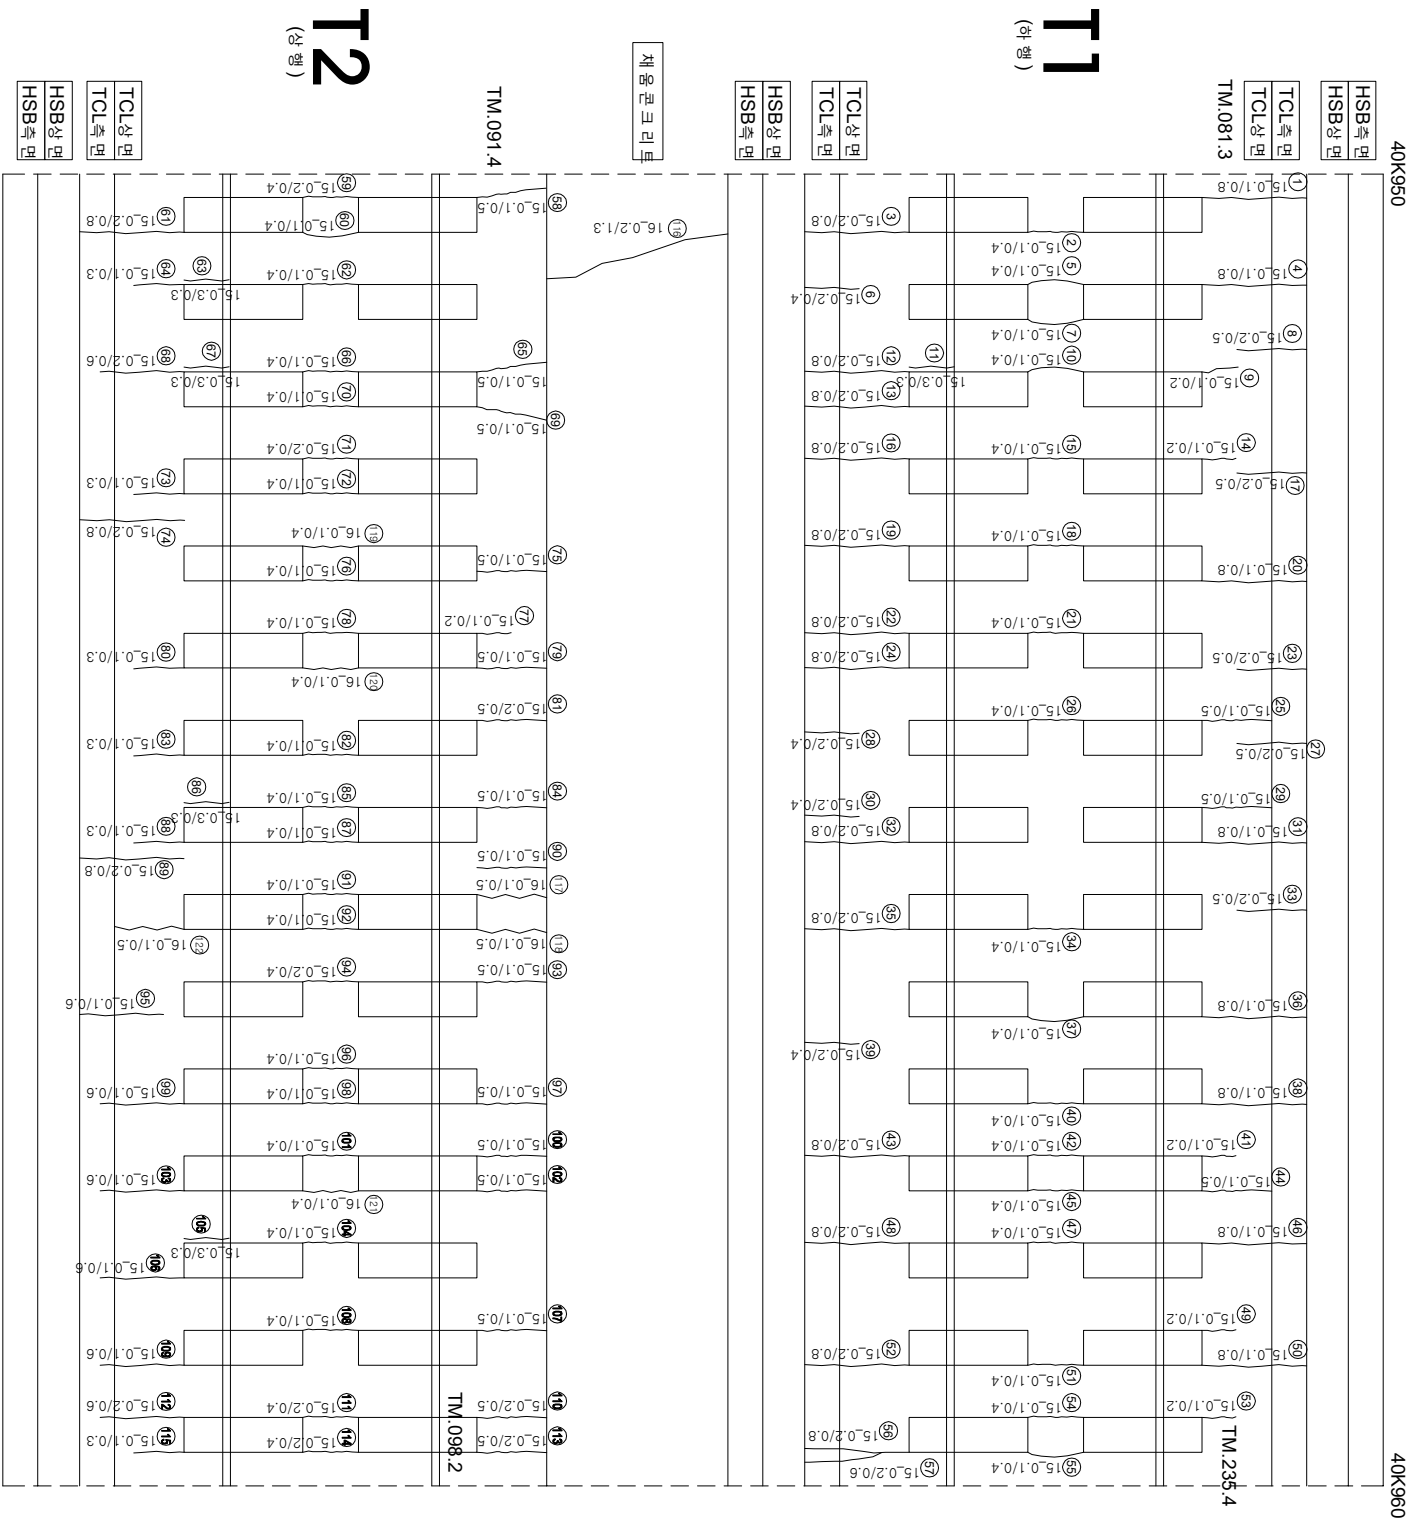

연번	순상	폭	연청	비고	연번	순상	폭	연청	비고	연번	순상	폭	연청	비고
1	균열	0.1 mm	0.8 m		56	균열	0.2 mm	0.8 m		111	균열	0.2 mm	0.4 m	
2	균열	0.1 mm	0.4 m		57	균열	0.2 mm	0.6 m		112	균열	0.2 mm	0.6 m	
3	균열	0.2 mm	0.8 m		58	균열	0.1 mm	0.5 m		113	균열	0.2 mm	0.5 m	
4	균열	0.1 mm	0.8 m		59	균열	0.2 mm	0.4 m		114	균열	0.2 mm	0.4 m	
5	균열	0.1 mm	0.4 m		60	균열	0.1 mm	0.4 m		115	균열	0.1 mm	0.3 m	
6	균열	0.2 mm	0.4 m		61	균열	0.2 mm	0.8 m		116	균열	0.2 mm	1.3 m	
7	균열	0.1 mm	0.4 m		62	균열	0.1 mm	0.4 m		117	균열	0.1 mm	0.5 m	
8	균열	0.2 mm	0.5 m		63	강재부 균열	0.3 mm	0.3 m		118	균열	0.1 mm	0.5 m	
9	균열	0.1 mm	0.2 m		64	균열	0.1 mm	0.3 m		119	균열	0.1 mm	0.4 m	
10	균열	0.1 mm	0.4 m		65	균열	0.1 mm	0.5 m		120	균열	0.1 mm	0.4 m	
11	강재부 균열	0.3 mm	0.3 m		66	균열	0.1 mm	0.4 m		121	균열	0.1 mm	0.4 m	
12	균열	0.2 mm	0.8 m		67	강재부 균열	0.3 mm	0.3 m		122	균열	0.1 mm	0.5 m	
13	균열	0.2 mm	0.8 m		68	균열	0.2 mm	0.6 m		123				
14	균열	0.1 mm	0.2 m		69	균열	0.1 mm	0.5 m		124				
15	균열	0.1 mm	0.4 m		70	균열	0.1 mm	0.4 m		125				
16	균열	0.2 mm	0.8 m		71	균열	0.2 mm	0.4 m		126				
17	균열	0.2 mm	0.5 m		72	균열	0.1 mm	0.4 m		127				
18	균열	0.1 mm	0.4 m		73	균열	0.1 mm	0.3 m		128				
19	균열	0.2 mm	0.8 m		74	균열	0.2 mm	0.8 m		129				
20	균열	0.1 mm	0.8 m		75	균열	0.1 mm	0.5 m		130				
21	균열	0.1 mm	0.4 m		76	균열	0.1 mm	0.4 m		131				
22	균열	0.2 mm	0.8 m		77	균열	0.1 mm	0.2 m		132				
23	균열	0.2 mm	0.5 m		78	균열	0.1 mm	0.4 m		133				
24	균열	0.2 mm	0.8 m		79	균열	0.1 mm	0.5 m		134				
25	균열	0.1 mm	0.4 m		80	균열	0.1 mm	0.3 m		135				
26	균열	0.1 mm	0.4 m		81	균열	0.2 mm	0.5 m		136				
27	균열	0.2 mm	0.5 m		82	균열	0.1 mm	0.4 m		137				
28	균열	0.2 mm	0.4 m		83	균열	0.1 mm	0.3 m		138				
29	균열	0.1 mm	0.5 m		84	균열	0.1 mm	0.5 m		139				
30	균열	0.2 mm	0.4 m		85	균열	0.1 mm	0.4 m		140				
31	균열	0.1 mm	0.8 m		86	강재부 균열	0.3 mm	0.3 m		141				
32	균열	0.2 mm	0.8 m		87	균열	0.1 mm	0.4 m		142				
33	균열	0.2 mm	0.5 m		88	균열	0.1 mm	0.3 m		143				
34	균열	0.1 mm	0.4 m		89	균열	0.2 mm	0.8 m		144				
35	균열	0.2 mm	0.8 m		90	균열	0.1 mm	0.5 m		145				
36	균열	0.1 mm	0.8 m		91	균열	0.1 mm	0.4 m		146				
37	균열	0.1 mm	0.4 m		92	균열	0.1 mm	0.4 m		147				
38	균열	0.2 mm	0.4 m		93	균열	0.1 mm	0.5 m		148				
39	균열	0.1 mm	0.8 m		94	균열	0.2 mm	0.4 m		149				
40	균열	0.1 mm	0.4 m		95	균열	0.1 mm	0.6 m		150				
41	균열	0.1 mm	0.2 m		96	균열	0.1 mm	0.4 m		151				
42	균열	0.1 mm	0.4 m		97	균열	0.1 mm	0.5 m		152				
43	균열	0.2 mm	0.8 m		98	균열	0.1 mm	0.4 m		153				
44	균열	0.1 mm	0.5 m		99	균열	0.1 mm	0.6 m		154				
45	균열	0.1 mm	0.4 m		100	균열	0.1 mm	0.5 m		155				
46	균열	0.1 mm	0.8 m		101	균열	0.1 mm	0.4 m		156				
47	균열	0.1 mm	0.4 m		102	균열	0.1 mm	0.5 m		157				
48	균열	0.2 mm	0.8 m		103	균열	0.1 mm	0.6 m		158				
49	균열	0.1 mm	0.2 m		104	균열	0.1 mm	0.4 m		159				
50	균열	0.1 mm	0.8 m		105	강재부 균열	0.3 mm	0.3 m		160				
51	균열	0.1 mm	0.4 m		106	균열	0.1 mm	0.6 m		161				
52	균열	0.2 mm	0.8 m		107	균열	0.1 mm	0.5 m		162				
53	균열	0.1 mm	0.2 m		108	균열	0.1 mm	0.4 m		163				
54	균열	0.1 mm	0.4 m		109	균열	0.1 mm	0.6 m		164				
55	균열	0.1 mm	0.4 m		110	균열	0.2 mm	0.5 m		165				

시행사	영역명	용역사	이력영	구간	 0.2220 (0.300이하 : 흑색)  0.4820 (0.300초과 0.500이하 : 청색)  0.6620 (0.500초과 1.000이하 : 적색)  1.0020 (1.000이상 : 분홍색)  한목도상분리  망상  바리·바락, 파손  편대  재료분리  철근노출  누수·수문부  시공이음분리, 흙분리