


한반도 서해안 2(41.160~41.170km, L=10m)

41K160

41K170

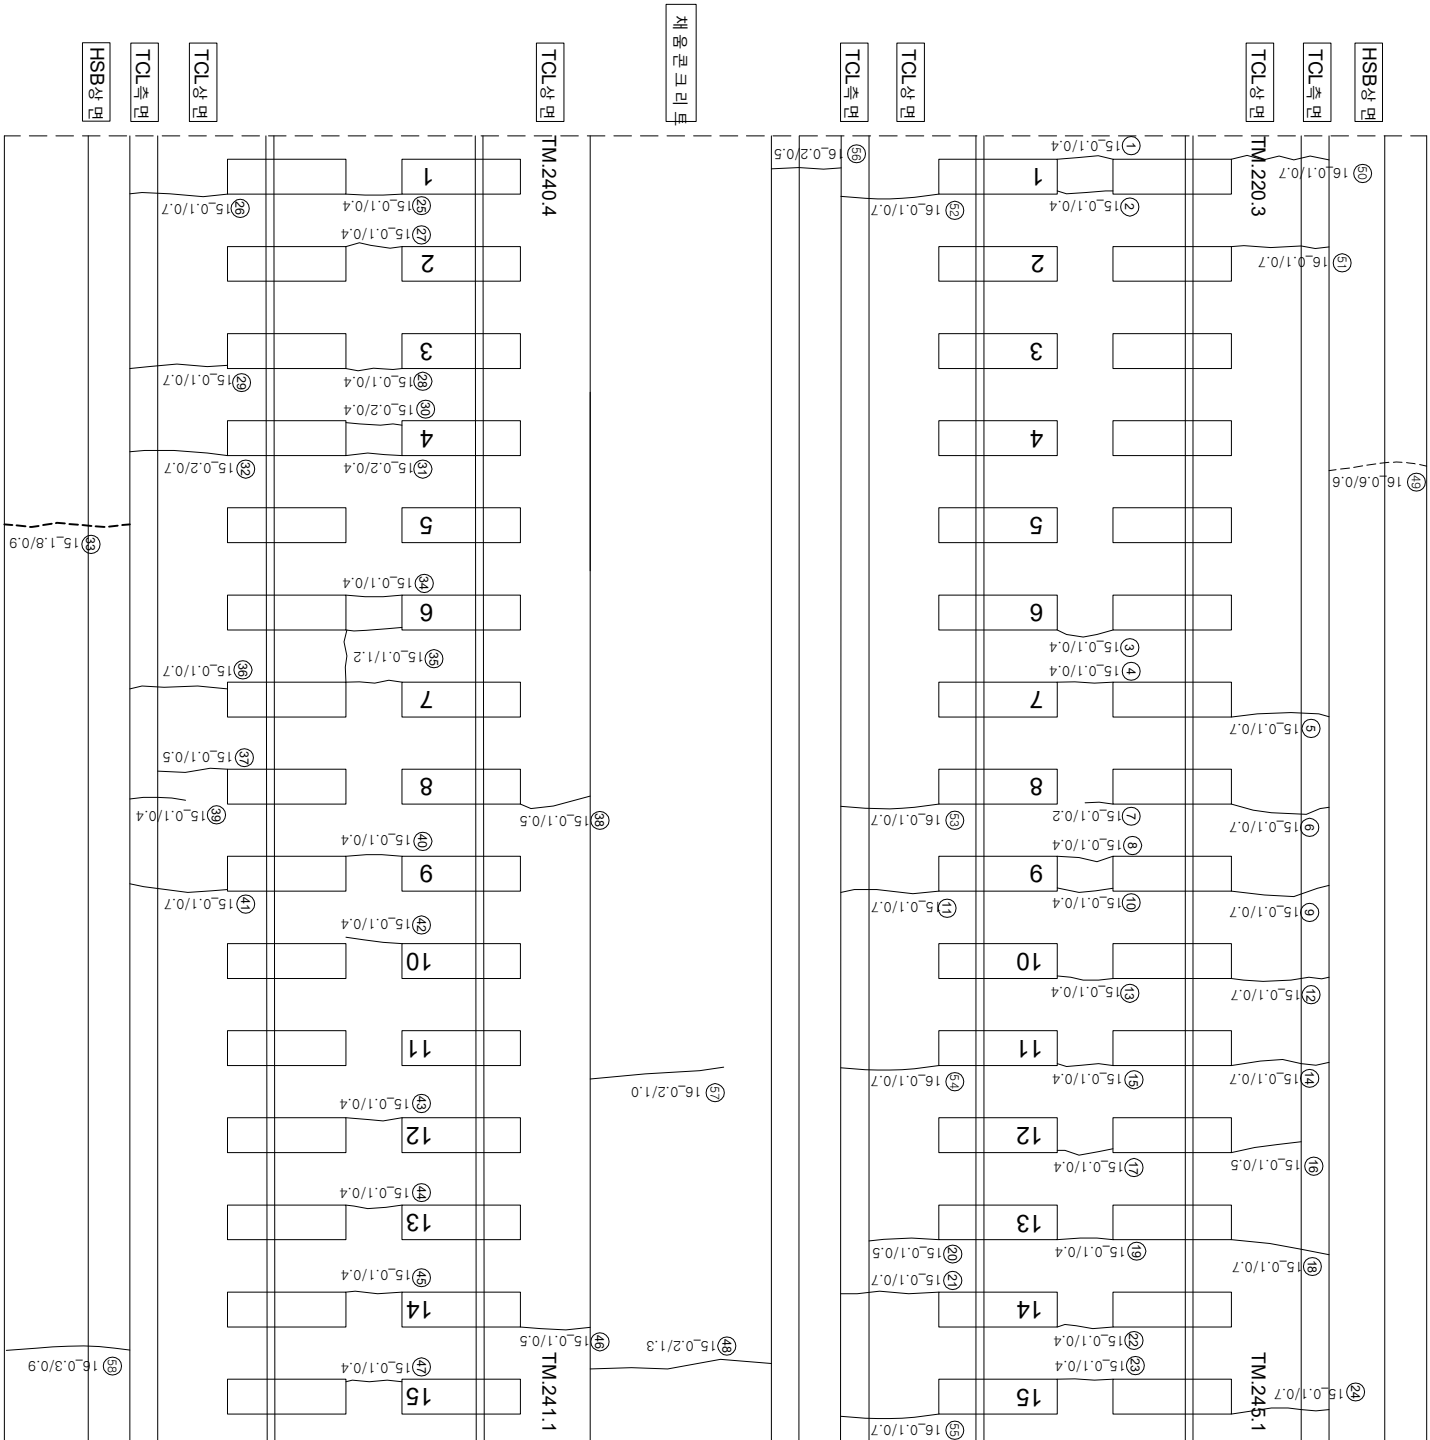

(아
0호)

(하안포)

12 (0708)

(약 10월)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		56	균열	0.2 mm	0.5 m	
2	균열	0.1 mm	0.4 m		57	균열	0.2 mm	1.0 m	
3	균열	0.1 mm	0.4 m		58	균열	0.3 mm	0.9 m	
4	균열	0.1 mm	0.4 m		59				
5	균열	0.1 mm	0.7 m		60				
6	균열	0.1 mm	0.7 m		61				
7	균열	0.1 mm	0.2 m		62				
8	균열	0.1 mm	0.4 m		63				
9	균열	0.1 mm	0.7 m		64				
10	균열	0.1 mm	0.4 m		65				
11	균열	0.1 mm	0.7 m		66				
12	균열	0.1 mm	0.7 m		67				
13	균열	0.1 mm	0.4 m		68				
14	균열	0.1 mm	0.7 m		69				
15	균열	0.1 mm	0.4 m		70				
16	균열	0.1 mm	0.4 m		71				
17	균열	0.1 mm	0.4 m		72				
18	균열	0.1 mm	0.7 m		73				
19	균열	0.1 mm	0.4 m		74				
20	균열	0.1 mm	0.5 m		75				
21	균열	0.1 mm	0.7 m		76				
22	균열	0.1 mm	0.4 m		77				
23	균열	0.1 mm	0.4 m		78				
24	균열	0.1 mm	0.7 m		79				
25	균열	0.1 mm	0.4 m		80				
26	균열	0.1 mm	0.7 m		81				
27	균열	0.1 mm	0.4 m		82				
28	균열	0.1 mm	0.4 m		83				
29	균열	0.1 mm	0.7 m		84				
30	균열	0.2 mm	0.4 m		85				
31	균열	0.2 mm	0.4 m		86				
32	균열	0.2 mm	0.7 m		87				
33	균열(발정)	1.8 mm	0.9 m		88				
34	균열	0.1 mm	0.4 m		89				
35	균열	0.1 mm	1.2 m		90				
36	균열	0.1 mm	0.7 m		91				
37	균열	0.1 mm	0.5 m		92				
38	균열	0.1 mm	0.5 m		93				
39	균열	0.1 mm	0.4 m		94				
40	균열	0.1 mm	0.4 m		95				
41	균열	0.1 mm	0.7 m		96				
42	균열	0.1 mm	0.4 m		97				
43	균열	0.1 mm	0.4 m		98				
44	균열	0.1 mm	0.4 m		99				
45	균열	0.1 mm	0.4 m		100				
46	균열	0.1 mm	0.5 m		101				
47	균열	0.1 mm	0.4 m		102				
48	균열	0.2 mm	1.3 m		103				
49	균열	0.6 mm	0.6 m		104				
50	균열	0.1 mm	0.7 m		105				
51	균열	0.1 mm	0.7 m		106				
52	균열	0.1 mm	0.7 m		107				
53	균열	0.1 mm	0.7 m		108				
54	균열	0.1 mm	0.7 m		109				
55	균열	0.1 mm	0.7 m		110				

 KORAIL KOREA RAILROAD 한국철도공사	시행사	용역명	용역사	계입장	창의자	의자	단		
			(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (제) 한국건설품질연구원	이 박 영	김 경 기	윤 석 기			
				0.220 (0.3m이하 : 흑색)	원목도상본리			재료본리	
				0.420 (0.3m초과 0.5m이하 : 청색)	양산			철근노출	
			0.620 (0.5m초과 1.0m미만 : 적색)	바리, 바리 파손		누수습윤부			
			1.020 (1.0m이상 : 분홍색)	백태		시공이음본리, 종본리			