


한남고속선향저교-토공노반-29(41.430~41.440km, L=10m)

41K430


41K440

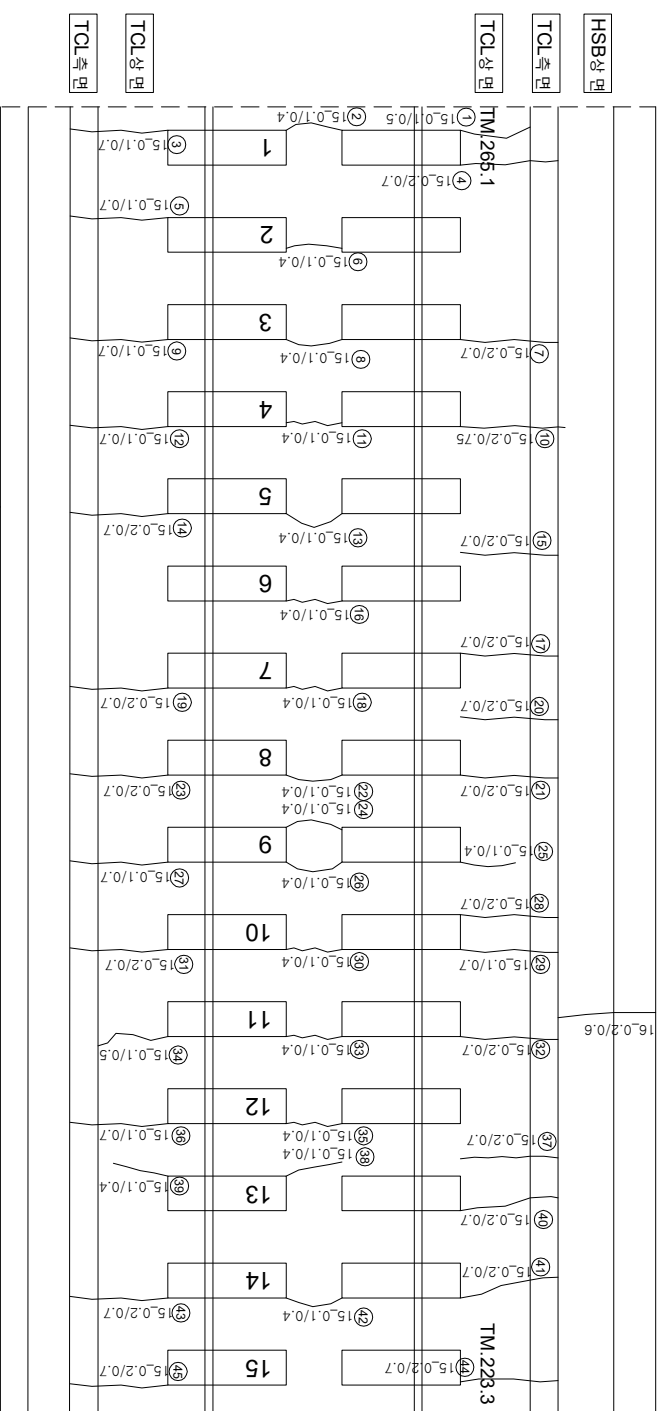

(아
0호)

(아
안)

채움콘크리트

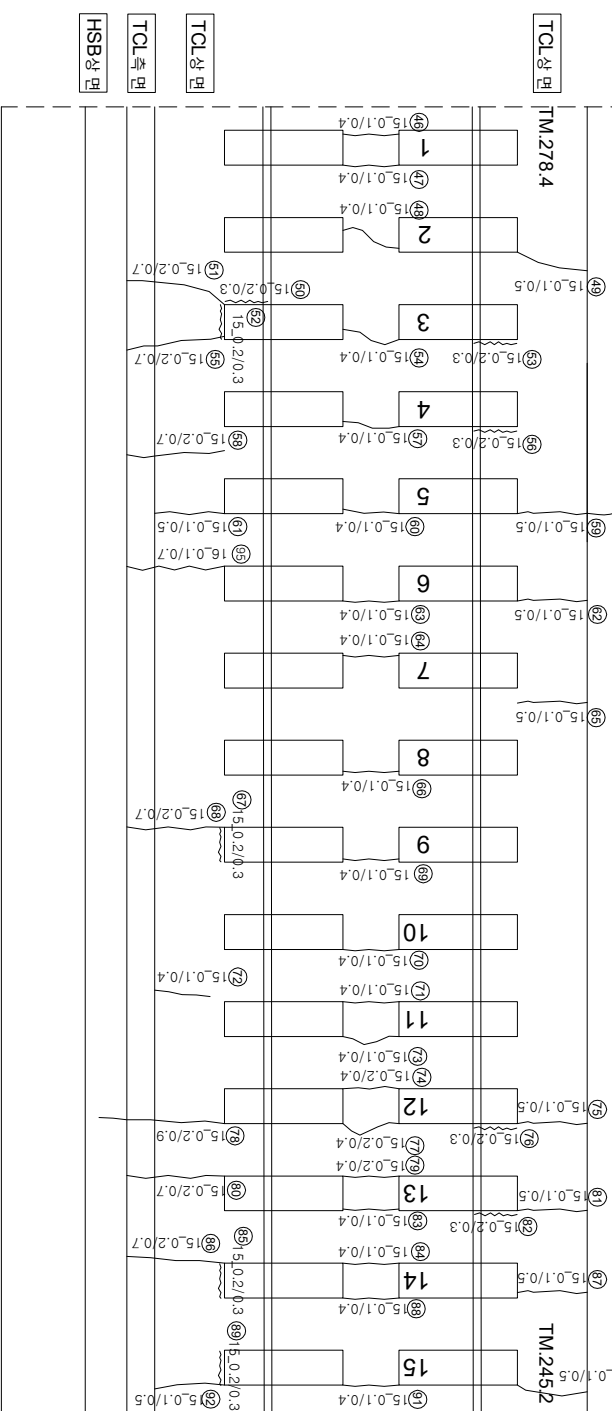

12 (후 0주)

(아주 앞)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.5 m		56	강제부 균열	0.2 mm	0.3 m	
2	균열	0.1 mm	0.4 m		57	균열	0.1 mm	0.4 m	
3	균열	0.1 mm	0.7 m		58	균열	0.2 mm	0.7 m	
4	균열	0.2 mm	0.7 m		59	균열	0.1 mm	0.5 m	
5	균열	0.1 mm	0.7 m		60	균열	0.1 mm	0.4 m	
6	균열	0.1 mm	0.4 m		61	균열	0.1 mm	0.5 m	
7	균열	0.2 mm	0.7 m		62	균열	0.1 mm	0.5 m	
8	균열	0.1 mm	0.4 m		63	균열	0.1 mm	0.4 m	
9	균열	0.1 mm	0.7 m		64	균열	0.1 mm	0.4 m	
10	균열	0.2 mm	0.8 m		65	균열	0.1 mm	0.5 m	
11	균열	0.1 mm	0.4 m		66	균열	0.1 mm	0.4 m	
12	균열	0.1 mm	0.7 m		67	균열	0.2 mm	0.3 m	
13	균열	0.1 mm	0.4 m		68	균열	0.2 mm	0.7 m	
14	균열	0.2 mm	0.7 m		69	균열	0.1 mm	0.4 m	
15	균열	0.2 mm	0.7 m		70	균열	0.1 mm	0.4 m	
16	균열	0.1 mm	0.4 m		71	균열	0.1 mm	0.4 m	
17	균열	0.2 mm	0.7 m		72	균열	0.1 mm	0.4 m	
18	균열	0.1 mm	0.4 m		73	균열	0.1 mm	0.4 m	
19	균열	0.2 mm	0.7 m		74	균열	0.2 mm	0.4 m	
20	균열	0.2 mm	0.7 m		75	균열	0.1 mm	0.5 m	
21	균열	0.2 mm	0.7 m		76	강제부 균열	0.2 mm	0.3 m	
22	균열	0.1 mm	0.4 m		77	균열	0.2 mm	0.4 m	
23	균열	0.2 mm	0.7 m		78	균열	0.2 mm	0.9 m	
24	균열	0.1 mm	0.4 m		79	균열	0.2 mm	0.4 m	
25	균열	0.1 mm	0.4 m		80	균열	0.2 mm	0.7 m	
26	균열	0.1 mm	0.4 m		81	균열	0.1 mm	0.5 m	
27	균열	0.1 mm	0.7 m		82	강제부 균열	0.2 mm	0.3 m	
28	균열	0.2 mm	0.7 m		83	균열	0.1 mm	0.4 m	
29	균열	0.1 mm	0.7 m		84	균열	0.1 mm	0.4 m	
30	균열	0.1 mm	0.4 m		85	강제부 균열	0.2 mm	0.3 m	
31	균열	0.2 mm	0.7 m		86	균열	0.2 mm	0.7 m	
32	균열	0.2 mm	0.7 m		87	균열	0.1 mm	0.5 m	
33	균열	0.1 mm	0.4 m		88	균열	0.1 mm	0.4 m	
34	균열	0.1 mm	0.5 m		89	강제부 균열	0.2 mm	0.3 m	
35	균열	0.1 mm	0.4 m		90	균열	0.1 mm	0.5 m	
36	균열	0.1 mm	0.7 m		91	균열	0.1 mm	0.4 m	
37	균열(배치)				92	균열	0.1 mm	0.5 m	
38	균열	0.1 mm	0.4 m		93	균열	0.2 mm	0.6 m	
39	균열	0.1 mm	0.4 m		94	균열	0.2 mm	1.3 m	
40	균열	0.2 mm	0.7 m		95	균열	0.1 mm	0.7 m	
41	균열	0.2 mm	0.7 m		96				
42	균열	0.1 mm	0.4 m		97				
43	균열	0.2 mm	0.7 m		98				
44	균열	0.2 mm	0.7 m		99				
45	균열	0.2 mm	0.7 m		100				
46	균열	0.1 mm	0.4 m		101				
47	균열	0.1 mm	0.4 m		102				
48	균열	0.1 mm	0.4 m		103				
49	균열	0.1 mm	0.5 m		104				
50	강제부 균열	0.2 mm	0.3 m		105				
51	균열	0.2 mm	0.7 m		106				
52	강제부 균열	0.2 mm	0.3 m		107				
53	강제부 균열	0.2 mm	0.3 m		108				
54	균열	0.1 mm	0.4 m		109				
55	균열	0.2 mm	0.7 m		110				</

 한국철도공사 KOREA RAILROAD	시	행 사		용 역 명	용 역 사	계 입 장	창 의 자	의 자	
					(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (제) 한국건설품질연구원	이 박 영	김 경 기	윤 석 기	
						권			
						0.220 (0.3m이하 : 흑색)	점등대상보리		재료보리
						0.420 (0.3m초과 0.5m이하 : 황색)	일상		철근노출
						0.620 (0.5m초과 1.0m미만 : 적색)	바리, 바리 파손		누수습윤부
						1.020 (1.0m이상 : 분홍색)	백태		시공이음보리, 횡보리
								양영	
									