


호남고속선 공주고가_토공노반_32(44.190~44.200km, L=10m)

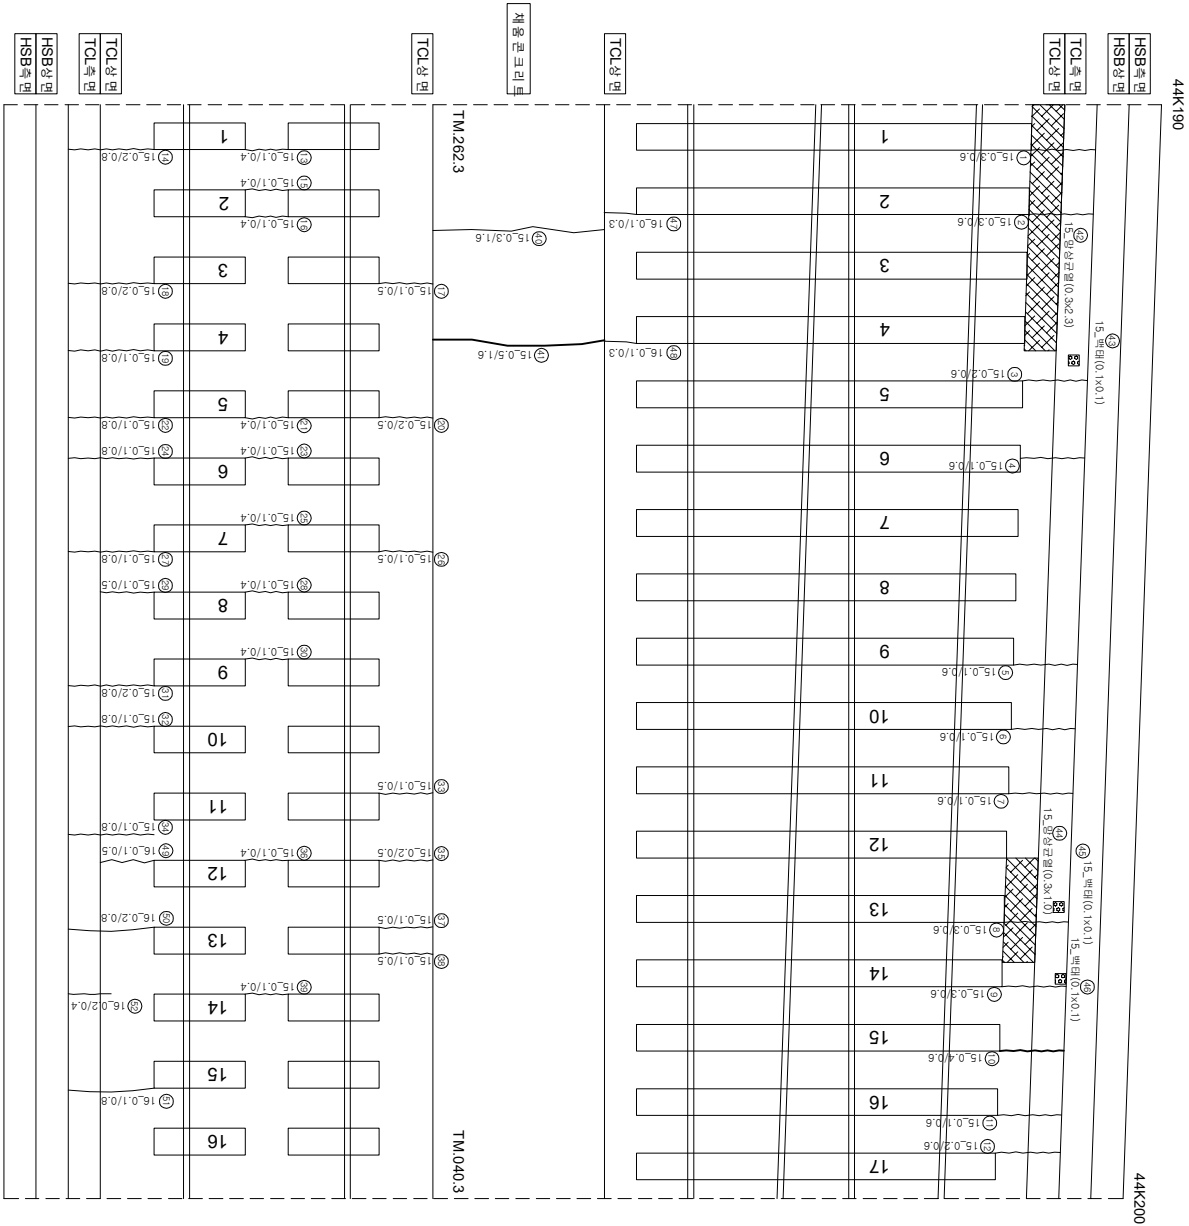

T1
(하행)

T2
(상행)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.3	mm	0.6	m	56			
2	균열	0.3	mm	0.6	m	57			
3	균열	0.2	mm	0.6	m	58			
4	균열	0.1	mm	0.6	m	59			
5	균열	0.1	mm	0.6	m	60			
6	균열	0.1	mm	0.6	m	61			
7	균열	0.1	mm	0.6	m	62			
8	균열	0.3	mm	0.6	m	63			
9	균열	0.3	mm	0.6	m	64			
10	균열	0.4	mm	0.6	m	65			
11	균열	0.1	mm	0.6	m	66			
12	균열	0.2	mm	0.6	m	67			
13	균열	0.1	mm	0.4	m	68			
14	균열	0.2	mm	0.8	m	69			
15	균열	0.1	mm	0.4	m	70			
16	균열	0.1	mm	0.4	m	71			
17	균열	0.1	mm	0.5	m	72			
18	균열	0.2	mm	0.8	m	73			
19	균열	0.1	mm	0.8	m	74			
20	균열	0.2	mm	0.5	m	75			
21	균열	0.1	mm	0.4	m	76			
22	균열	0.1	mm	0.8	m	77			
23	균열	0.1	mm	0.4	m	78			
24	균열	0.1	mm	0.8	m	79			
25	균열	0.1	mm	0.4	m	80			
26	균열	0.1	mm	0.5	m	81			
27	균열	0.1	mm	0.8	m	82			
28	균열	0.1	mm	0.4	m	83			
29	균열	0.1	mm	0.5	m	84			
30	균열	0.1	mm	0.4	m	85			
31	균열	0.2	mm	0.8	m	86			
32	균열	0.1	mm	0.8	m	87			
33	균열	0.1	mm	0.5	m	88			
34	균열	0.1	mm	0.8	m	89			
35	균열	0.2	mm	0.5	m	90			
36	균열	0.1	mm	0.4	m	91			
37	균열	0.1	mm	0.5	m	92			
38	균열	0.1	mm	0.5	m	93			
39	균열	0.1	mm	0.4	m	94			
40	균열	0.3	mm	1.6	m	95			
41	균열	0.5	mm	1.6	m	96			
42	양상균열	0.3	m	2.3	m	97			
43	벽태	0.1	m	0.1	m	98			
44	양상균열	0.3	m	1.0	m	99			
45	벽태	0.1	m	0.1	m	100			
46	벽태	0.1	m	0.1	m	101			
47	균열	0.1	mm	0.3	m	102			
48	균열	0.1	mm	0.3	m	103			
49	균열	0.1	mm	0.5	m	104			
50	균열	0.1	mm	0.5	m	105			
51	균열	0.1	mm	0.5	m	106			
52	균열	0.2	mm	0.4	m	107			
53					108				
54					109				
55					110				

시	행	사	공	역	영	공	역	사	간		현				
									과 내 역 일 자	장 본 아 간 일 자					
한국철도공사									이북영		월				
2017년도 호남고속선 오송-광주승경간 콘크리트케도 점검용역 (주)한국구조물안전연구원 (주)한국도로안전연구원 (재)한국건설품질연구원									김경기 윤석기		월				
										0220 (0.3m이하 : 폭박)		저로분리			
										0420 (0.3m초과 0.5m이하 : 광박)		망상		철근노출	
										0620 (0.5m초과 1.0m미만 : 폭박)		바리, 바락, 파손		누수, 슬로부	
										1420 (1.0m이상 : 분출해)		변위		시공이음분리, 총분리	