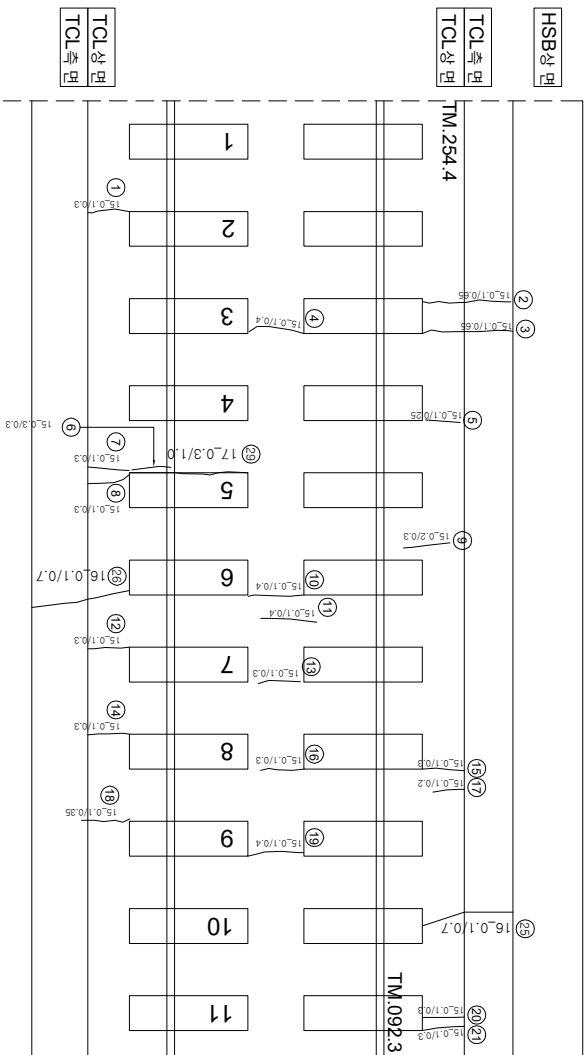


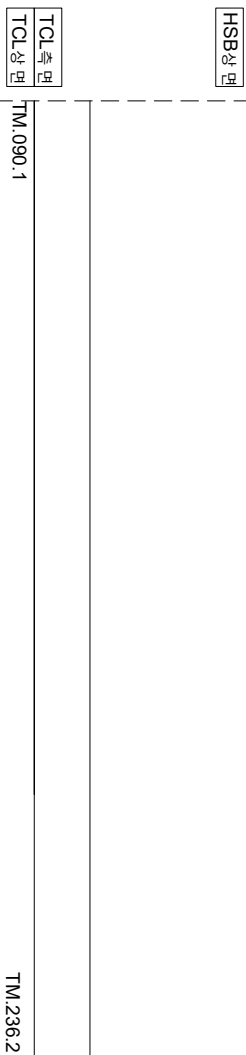
호남고속선 호암교_79(46.865~46.872km, S16-3)

46K865

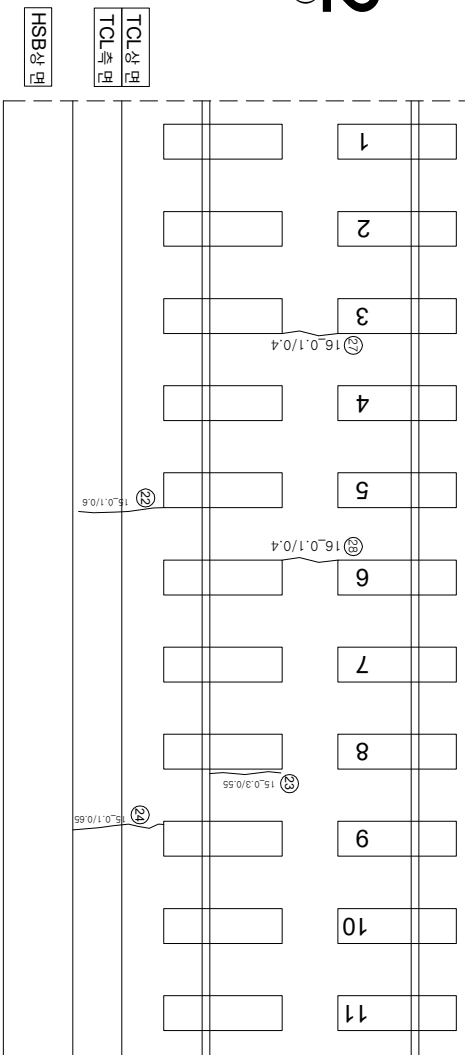
46K872
16 SPAN - 3



(아
앞
0)

(아
오)

T2
(07/08)

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$


연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.3 m		56				
2	균열	0.1 mm	0.65 m		57				
3	균열	0.1 mm	0.65 m		58				
4	균열	0.1 mm	0.4 m		59				
5	균열	0.1 mm	0.25 m		60				
6	경계부 균열	0.3 mm	0.3 m		61				
7	균열	0.1 mm	0.3 m		62				
8	균열	0.1 mm	0.3 m		63				
9	균열	0.2 mm	0.3 m		64				
10	균열	0.1 mm	0.4 m		65				
11	균열	0.1 mm	0.4 m		66				
12	균열	0.1 mm	0.3 m		67				
13	균열	0.1 mm	0.3 m		68				
14	균열	0.1 mm	0.3 m		69				
15	균열	0.1 mm	0.3 m		70				
16	균열	0.1 mm	0.3 m		71				
17	균열	0.1 mm	0.2 m		72				
18	균열	0.1 mm	0.35 m		73				
19	균열	0.1 mm	0.4 m		74				
20	균열	0.1 mm	0.3 m		75				
21	균열	0.1 mm	0.3 m		76				
22	균열	0.1 mm	0.6 m		77				
23	경계부 균열	0.3 mm	0.55 m		78				
24	균열	0.1 mm	0.65 m		79				
25	균열	0.1 mm	0.7 m		80				
26	균열	0.1 mm	0.7 m		81				
27	균열	0.1 mm	0.4 m		82				
28	균열	0.1 mm	0.4 m		83				
29	균열	0.3 mm	1.0 m	신규	84				
30					85				
31					86				
32					87				
33					88				
34					89				
35					90				
36					91				
37					92				
38					93				
39					94				
40					95				
41					96				
42					97				
43					98				
44					99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

[illegible]