


하남고속선 하남교 - 토랑노반 34(47.810~47.820km, L=10.0m)

47K810

47K820

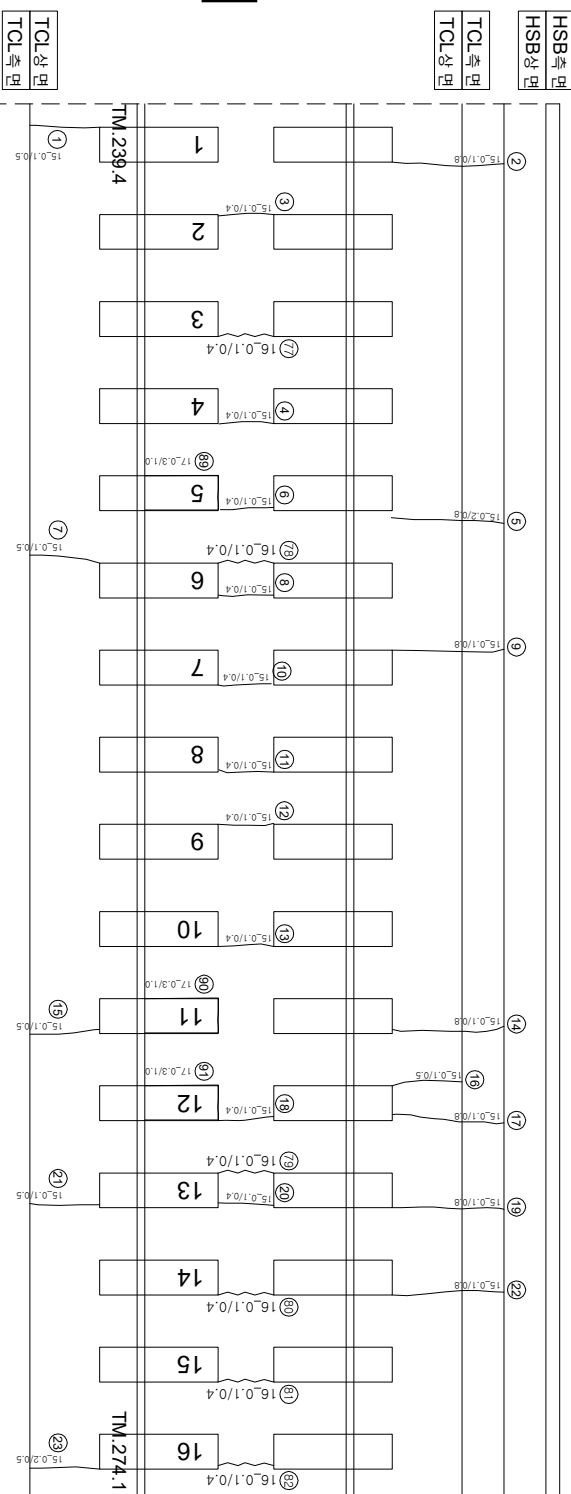


아
오

(아호)

TCL상면
TCL측면

TCL상면
TCL측면

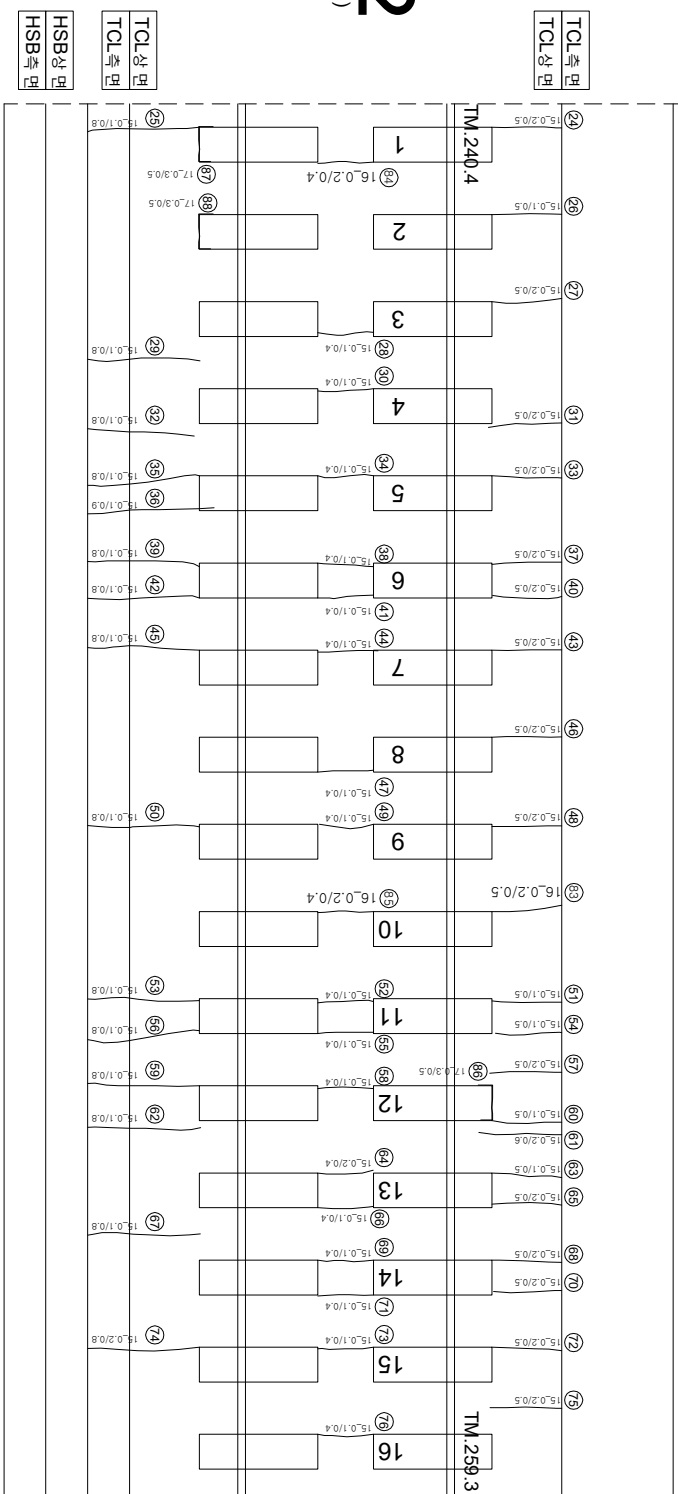

12 (04/05)

(0.5점)

HSB	HSB
K	K

HSB	HSB
HSB	HSB

연번	순상	폭	연청	비고	연번	순상	폭	연청	비고
1	균열	0.1 mm	0.5 m		56	균열	0.1 mm	0.8 m	
2	균열	0.1 mm	0.8 m		57	균열	0.2 mm	0.5 m	
3	균열	0.1 mm	0.4 m		58	균열	0.1 mm	0.4 m	
4	균열	0.1 mm	0.4 m		59	균열	0.1 mm	0.8 m	
5	균열	0.2 mm	0.8 m		60	균열	0.1 mm	0.5 m	
6	균열	0.1 mm	0.4 m		61	균열	0.2 mm	0.6 m	
7	균열	0.1 mm	0.5 m		62	균열	0.1 mm	0.8 m	
8	균열	0.1 mm	0.4 m		63	균열	0.1 mm	0.5 m	
9	균열	0.1 mm	0.8 m		64	균열	0.2 mm	0.4 m	
10	균열	0.1 mm	0.4 m		65	균열	0.2 mm	0.5 m	
11	균열	0.1 mm	0.4 m		66	균열	0.1 mm	0.4 m	
12	균열	0.1 mm	0.4 m		67	균열	0.1 mm	0.8 m	
13	균열	0.1 mm	0.4 m		68	균열	0.2 mm	0.5 m	
14	균열	0.1 mm	0.8 m		69	균열	0.1 mm	0.4 m	
15	균열	0.1 mm	0.5 m		70	균열	0.2 mm	0.5 m	
16	균열	0.1 mm	0.5 m		71	균열	0.1 mm	0.4 m	
17	균열	0.1 mm	0.8 m		72	균열	0.2 mm	0.5 m	
18	균열	0.1 mm	0.4 m		73	균열	0.1 mm	0.4 m	
19	균열	0.1 mm	0.8 m		74	균열	0.2 mm	0.8 m	
20	균열	0.1 mm	0.4 m		75	균열	0.2 mm	0.5 m	
21	균열	0.1 mm	0.5 m		76	균열	0.1 mm	0.4 m	
22	균열	0.1 mm	0.8 m		77	균열	0.1 mm	0.4 m	
23	균열	0.2 mm	0.5 m		78	균열	0.1 mm	0.4 m	
24	균열	0.2 mm	0.5 m		79	균열	0.1 mm	0.4 m	
25	균열	0.1 mm	0.8 m		80	균열	0.1 mm	0.4 m	
26	균열	0.1 mm	0.5 m		81	균열	0.1 mm	0.4 m	
27	균열	0.2 mm	0.5 m		82	균열	0.1 mm	0.4 m	
28	균열	0.1 mm	0.4 m		83	균열	0.2 mm	0.5 m	
29	균열	0.1 mm	0.8 m		84	균열	0.2 mm	0.4 m	
30	균열	0.1 mm	0.4 m		85	균열	0.2 mm	0.4 m	
31	균열	0.2 mm	0.5 m		86	균열	0.3 mm	0.5 m	신규
32	균열	0.1 mm	0.8 m		87	균열	0.3 mm	0.5 m	신규
33	균열	0.2 mm	0.5 m		88	균열	0.3 mm	0.5 m	신규
34	균열	0.1 mm	0.4 m		89	균열	0.3 mm	1.0 m	신규
35	균열	0.1 mm	0.8 m		90	균열	0.3 mm	1.0 m	신규
36	균열	0.1 mm	0.9 m		91	균열	0.3 mm	1.0 m	신규
37	균열	0.2 mm	0.5 m		92				
38	균열	0.1 mm	0.4 m		93				
39	균열	0.1 mm	0.8 m		94				
40	균열	0.2 mm	0.5 m		95				
41	균열	0.1 mm	0.4 m		96				
42	균열	0.1 mm	0.8 m		97				
43	균열	0.2 mm	0.5 m		98				
44	균열	0.1 mm	0.4 m		99				
45	균열	0.1 mm	0.8 m		100				
46	균열	0.2 mm	0.5 m		101				
47	균열	0.1 mm	0.4 m		102				
48	균열	0.2 mm	0.5 m		103				
49	균열	0.1 mm	0.4 m		104				
50	균열	0.1 mm	0.8 m		105				
51	균열	0.1 mm	0.5 m		106				
52	균열	0.1 mm	0.4 m		107				
53	균열	0.1 mm	0.8 m		108				
54	균열	0.1 mm	0.5 m		109				
55	균열	0.1 mm	0.4 m		110				

시	행	사	영	여	명	용	여	사	간					
									과 업 별 영 지	종 업 별 영 지				
 KORAIL KOREA RAILROAD		한국철도공사	2017년도	호남고속선	오송-광주순정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	강 경 기 문 원 석 기	연	영				
									간	지				
										0.2220 (0.300)이하 : 황색)		한빛도양관리		재료관리
										0.4290 (0.300초과 0.500)이하 : 청색)		망산		철근노출
										0.6820 (0.500초과 1.000)미만 : 적색)		바리, 바락, 파손		누수 수온 부
										1.0020 (1.000)이상 : 분홍색)		변대		시공이음관리, 흙관리