


호남고속선장구교_3(48.509~48.516km, S1-2)

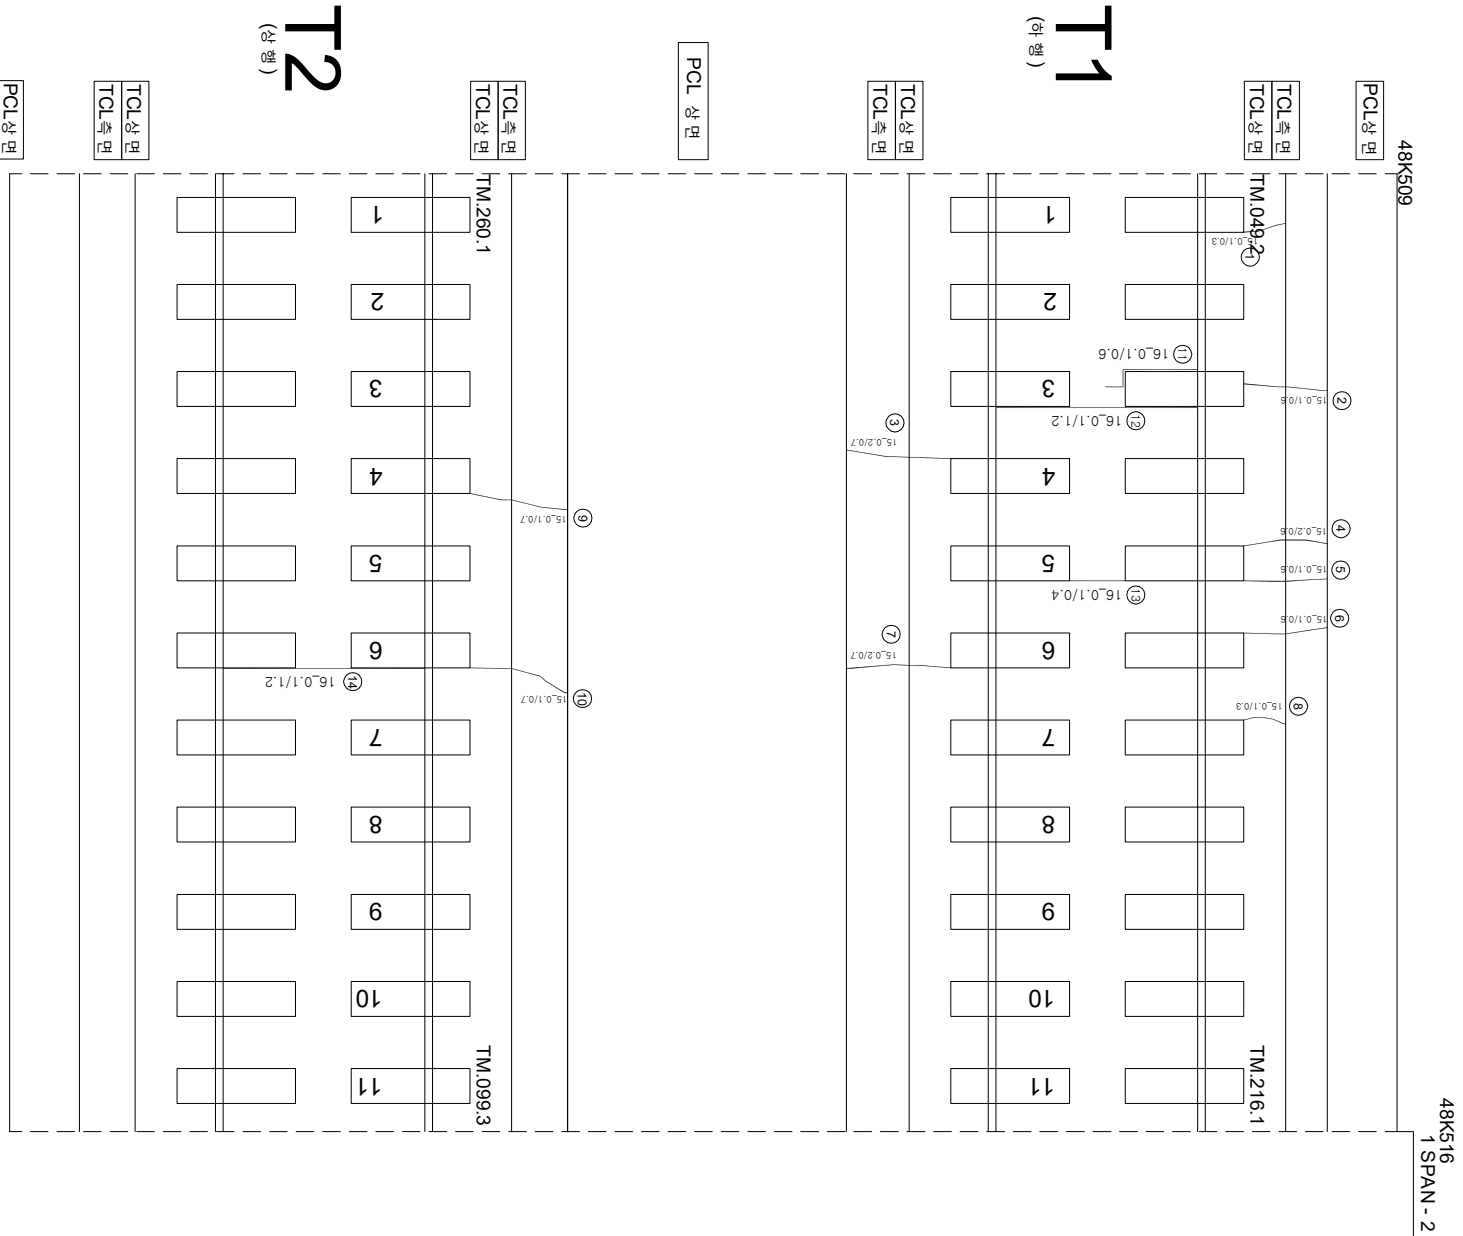

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.3 m		55				
2	균열	0.1 mm	0.6 m		56				
3	균열	0.2 mm	0.7 m		57				
4	균열	0.2 mm	0.6 m		58				
5	균열	0.1 mm	0.6 m		59				
6	균열	0.1 mm	0.6 m		60				
7	균열	0.2 mm	0.7 m		61				
8	균열	0.1 mm	0.3 m		62				
9	균열	0.1 mm	0.7 m		63				
10	균열	0.1 mm	0.7 m		64				
11	균열부 균열	0.1 mm	0.6 m		65				
12	균열부 균열	0.1 mm	1.2 m		66				
13	균열	0.1 mm	0.4 m		67				
14	균열부 균열	0.1 mm	1.2 m		68				
15					69				
16					70				
17					71				
18					72				
19					73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시행사	공역명	공역사	이목영		구간	 (0.3m이하 : 폭벽)  (0.3m초과 0.5m이하 : 경벽)  0.620 (0.3m초과 1.0m이하 : 폭벽)  1.620 (1.0m이상 : 분방)	 차도분리  월간노출  누수수원부  시공이음판리, 총판리
			(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	광운강 경정기 윤석기			
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역					