


호남고속선 장구교_33(48.719~48.726km, S7-2)

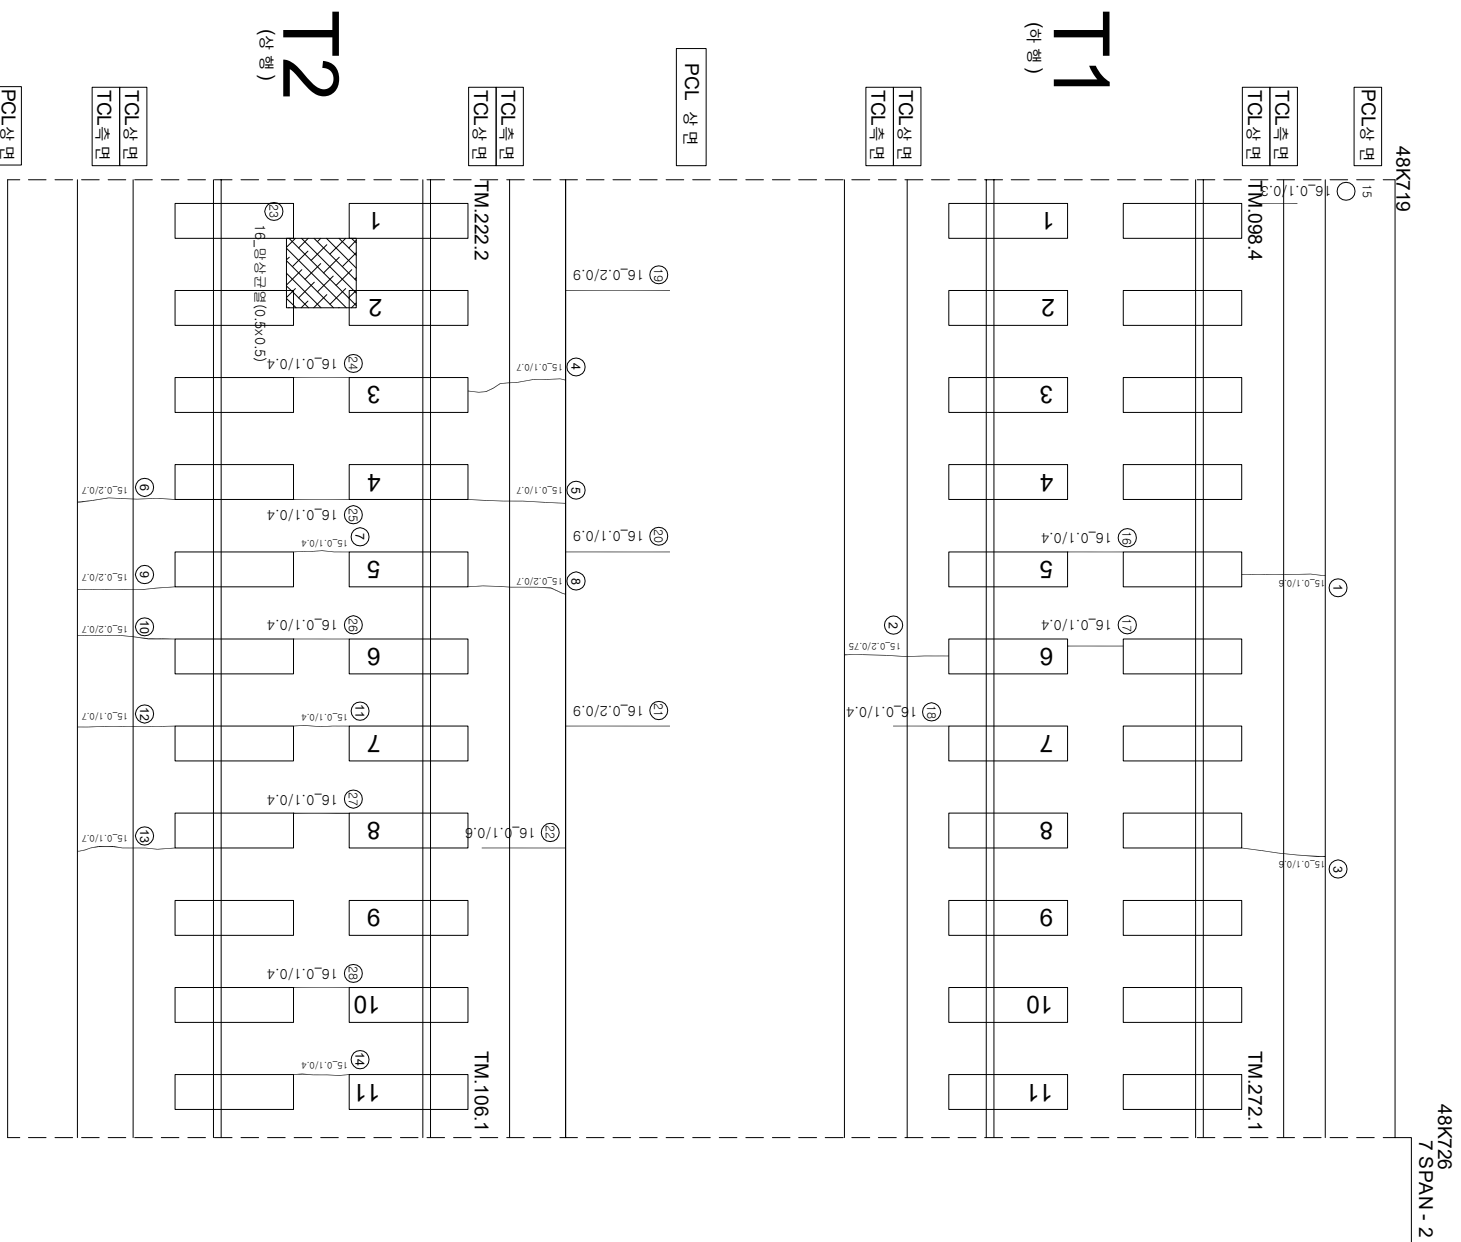

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.6 m		55				
2	균열	0.2 mm	0.75 m		56				
3	균열	0.1 mm	0.6 m		57				
4	균열	0.1 mm	0.7 m		58				
5	균열	0.1 mm	0.7 m		59				
6	균열	0.2 mm	0.7 m		60				
7	균열	0.1 mm	0.4 m		61				
8	균열	0.2 mm	0.7 m		62				
9	균열	0.2 mm	0.7 m		63				
10	균열	0.2 mm	0.7 m		64				
11	균열	0.1 mm	0.4 m		65				
12	균열	0.1 mm	0.7 m		66				
13	균열	0.1 mm	0.7 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열	0.1 mm	0.3 m		69				
16	균열	0.1 mm	0.4 m		70				
17	균열	0.1 mm	0.4 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열	0.2 mm	0.9 m		73				
20	균열	0.1 mm	0.9 m		74				
21	균열	0.2 mm	0.9 m		75				
22	균열	0.1 mm	0.6 m		76				
23	망상 균열	0.5 m	0.5 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.1 mm	0.4 m		79				
26	균열	0.1 mm	0.4 m		80				
27	균열	0.1 mm	0.4 m		81				
28	균열	0.1 mm	0.4 m		82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

한국철도공사 KOREA RAILCOO	시행사	공역명	공역사	이복영		경로		
				교량좌임지	철도차량좌임지			
				간				
			(주) 한국구조물안전연구원 (주) 한국토목안전연구원 (제) 한국건설품질관리연구원	이복영	리안강 김정기 윤석기	 0.220 (0.3m이하 : 철책)	원곡도상분기	
						 0.420 (0.3m초과 0.5m이하 : 횡책)	양성	
						 0.820 (0.5m초과 1.0m이하 : 직책)	박리, 박리, 파산	
						 1.020 (1.0m이상 : 편책)	변터	
						요양	시공이음관리종분기	