


호남고속전장구표-68(48.964~48.971km, S14-2)

48K964

48K971
14 SPAN - 2

14 SPAN - 2

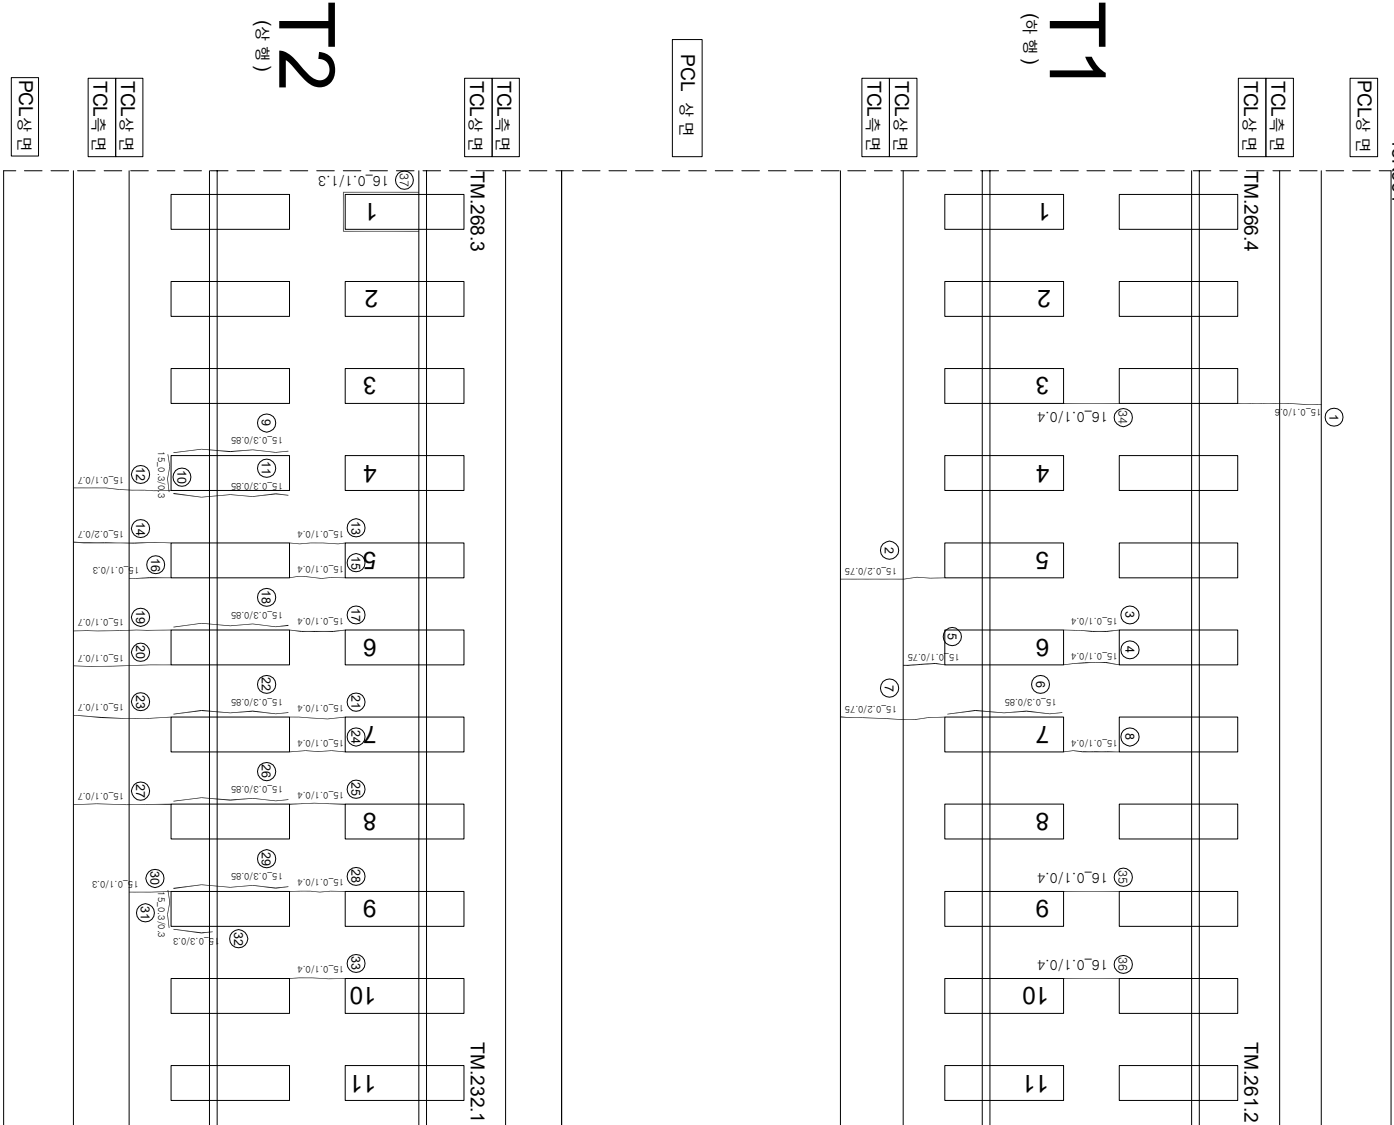

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1	mm	0.6	m	55			
2	균열	0.2	mm	0.75	m	56			
3	균열	0.1	mm	0.4	m	57			
4	균열	0.1	mm	0.4	m	58			
5	균열	0.1	mm	0.75	m	59			
6	균열부 균열	0.3	mm	0.85	m	60			
7	균열	0.2	mm	0.75	m	61			
8	균열	0.1	mm	0.4	m	62			
9	균열부 균열	0.3	mm	0.85	m	63			
10	균열부 균열	0.3	mm	0.3	m	64			
11	균열부 균열	0.3	mm	0.85	m	65			
12	균열	0.1	mm	0.7	m	66			
13	균열	0.1	mm	0.4	m	67			
14	균열	0.2	mm	0.7	m	68			
15	균열	0.1	mm	0.4	m	69			
16	균열	0.1	mm	0.3	m	70			
17	균열	0.1	mm	0.4	m	71			
18	균열부 균열	0.3	mm	0.85	m	72			
19	균열	0.1	mm	0.7	m	73			
20	균열	0.1	mm	0.7	m	74			
21	균열	0.1	mm	0.4	m	75			
22	균열부 균열	0.3	mm	0.85	m	76			
23	균열	0.1	mm	0.7	m	77			
24	균열	0.1	mm	0.4	m	78			
25	균열	0.1	mm	0.4	m	79			
26	균열부 균열	0.3	mm	0.85	m	80			
27	균열	0.1	mm	0.7	m	81			
28	균열	0.1	mm	0.4	m	82			
29	균열부 균열	0.3	mm	0.85	m	83			
30	균열	0.1	mm	0.3	m	84			
31	균열부 균열	0.3	mm	0.3	m	85			
32	균열부 균열	0.3	mm	0.3	m	86			
33	균열	0.1	mm	0.4	m	87			
34	균열	0.1	mm	0.4	m	88			
35	균열	0.1	mm	0.4	m	89			
36	균열	0.1	mm	0.4	m	90			
37	균열부 균열	0.1	mm	1.3	m	91			
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시행사	공사명	공사장소	공사내용	이북영	간경기 원석기	단	단		
							과업책임지	판아발책임지	단
한국철도공사 KORAIL KOREA RAILROAD	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이북영	간경기 원석기	단	 0220 (0.3m이하 : 폭박)		재료판리	
						 0420 (0.3m초과 0.5m이하 : 광박)		철근노출	
						 0620 (0.5m초과 1.0m이하 : 폭박)		부수수업부	
						 1420 (1.0m이상 : 통상)		시공이음판리, 통상리	