


화남고수전장구표-89(49.111~49.118km, S18-3)

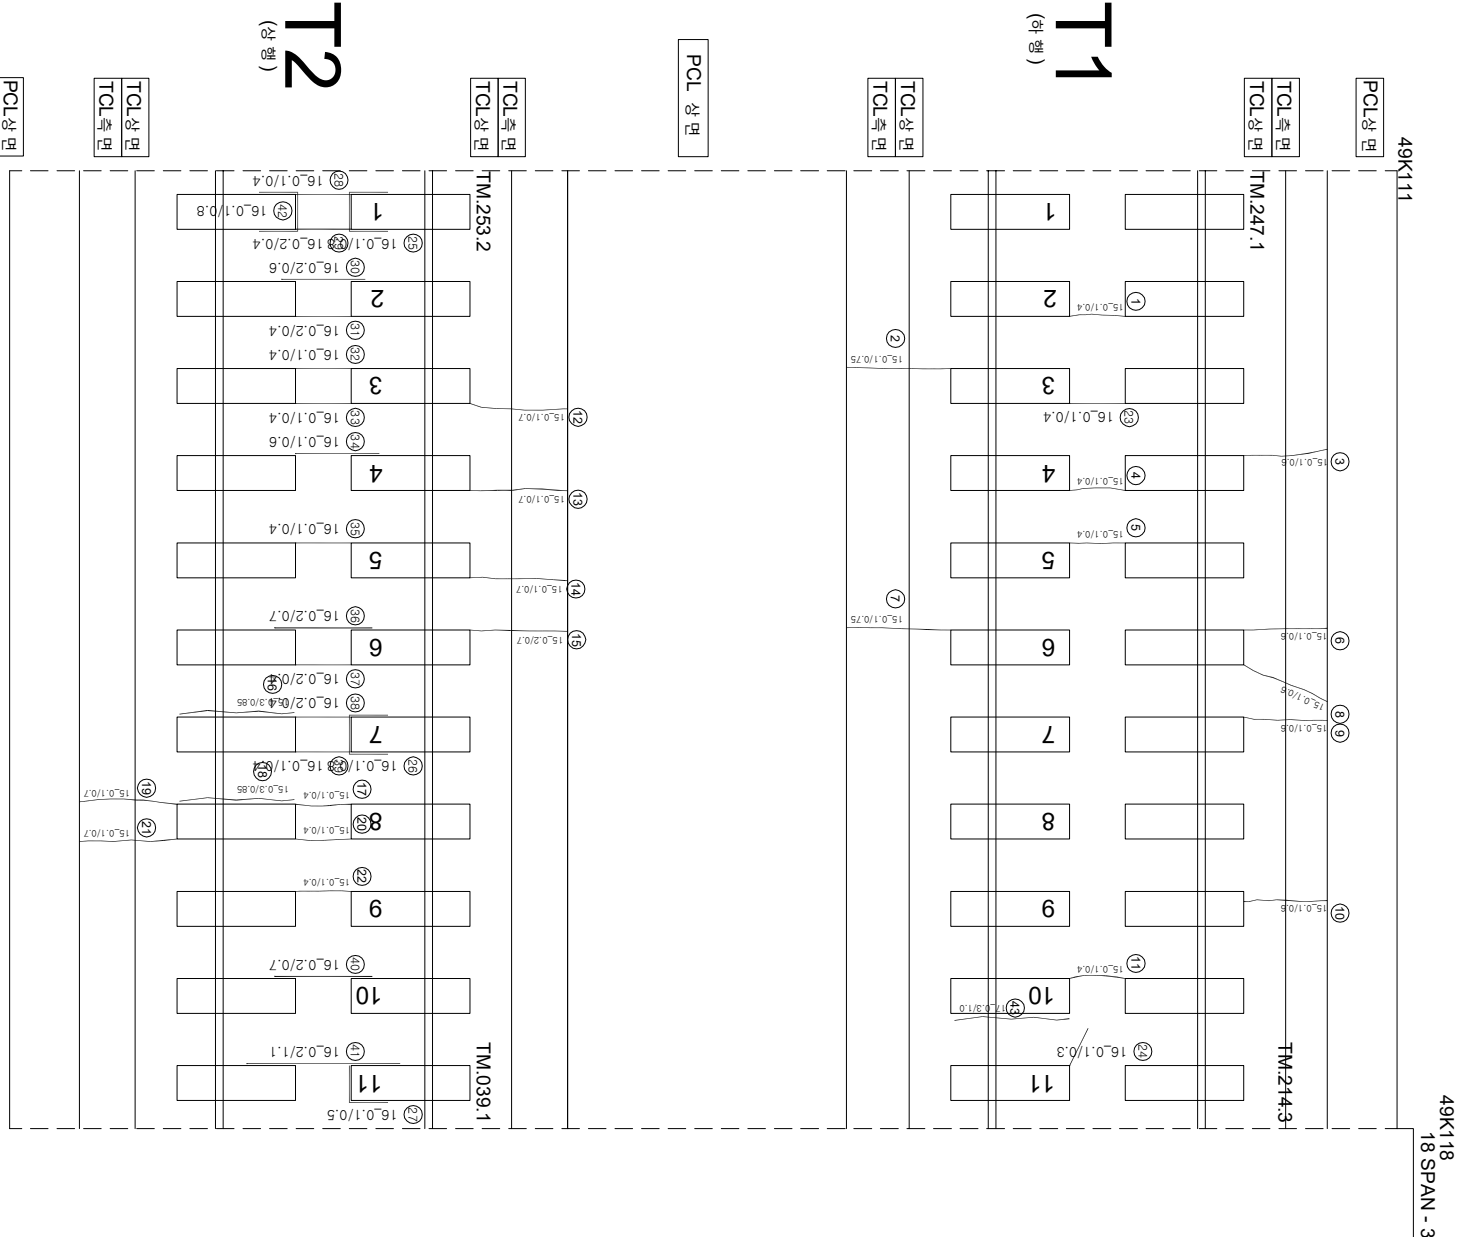

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1	mm	0.4	m	55			
2	균열	0.1	mm	0.75	m	56			
3	균열	0.1	mm	0.6	m	57			
4	균열	0.1	mm	0.4	m	58			
5	균열	0.1	mm	0.4	m	59			
6	균열	0.1	mm	0.6	m	60			
7	균열	0.1	mm	0.75	m	61			
8	균열	0.1	mm	0.6	m	62			
9	균열	0.1	mm	0.6	m	63			
10	균열	0.1	mm	0.6	m	64			
11	균열	0.1	mm	0.4	m	65			
12	균열	0.1	mm	0.7	m	66			
13	균열	0.1	mm	0.7	m	67			
14	균열	0.1	mm	0.7	m	68			
15	균열	0.2	mm	0.7	m	69			
16	관개부 균열	0.3	mm	0.85	m	70			
17	균열	0.1	mm	0.4	m	71			
18	관개부 균열	0.3	mm	0.85	m	72			
19	균열	0.1	mm	0.7	m	73			
20	균열	0.1	mm	0.4	m	74			
21	균열	0.1	mm	0.7	m	75			
22	균열	0.1	mm	0.4	m	76			
23	균열	0.1	mm	0.4	m	77			
24	균열	0.1	mm	0.3	m	78			
25	관개부 균열	0.1	mm	0.8	m	79			
26	관개부 균열	0.1	mm	0.8	m	80			
27	관개부 균열	0.1	mm	0.5	m	81			
28	균열	0.1	mm	0.4	m	82			
29	균열	0.2	mm	0.4	m	83			
30	관개부 균열	0.2	mm	0.6	m	84			
31	균열	0.2	mm	0.4	m	85			
32	균열	0.1	mm	0.4	m	86			
33	균열	0.1	mm	0.4	m	87			
34	관개부 균열	0.1	mm	0.6	m	88			
35	균열	0.1	mm	0.4	m	89			
36	관개부 균열	0.2	mm	0.7	m	90			
37	균열	0.2	mm	0.4	m	91			
38	균열	0.2	mm	0.4	m	92			
39	균열	0.1	mm	0.4	m	93			
40	관개부 균열	0.2	mm	0.7	m	94			
41	관개부 균열	0.2	mm	1.1	m	95			
42	관개부 균열	0.1	mm	0.8	m	96			
43	관개부 균열	0.3	mm	1.0	m	97			
44					신규	98			
45						99			
46						100			
47						101			
48						102			
49						103			
50						104			
51						105			
52						106			
53						107			
54						108			

시 행	사	명	영	명	사	구 간						
						개 관 제 임 지	장 본 아 별 제 임 지					
 한국철도공사 KOREA RAILROAD		2017년도 호남고속선 오송-광주순정간 콘크리트케도 점검용역	(주) 원국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 박 영	김 윤 강 김 경 기 문 은 석 기	점	원					
							0.22% (0.3mm이하 : 폭박)		점검도상판리			
							0.42% (0.3mm초과 0.5mm이하 : 광박)		망상		철근노출	
							0.62% (0.5mm초과 1.0mm이하 : 폭박)		바리, 바라, 파손		누수 슬로부	
							1.02% (1.0mm이상 : 통상)		변대		시공이음판리, 종판리	