


호남고속선 장구교-151(49.545~49.552km, S30-5)

49K545

P30
49K552

30 SPAN - 5

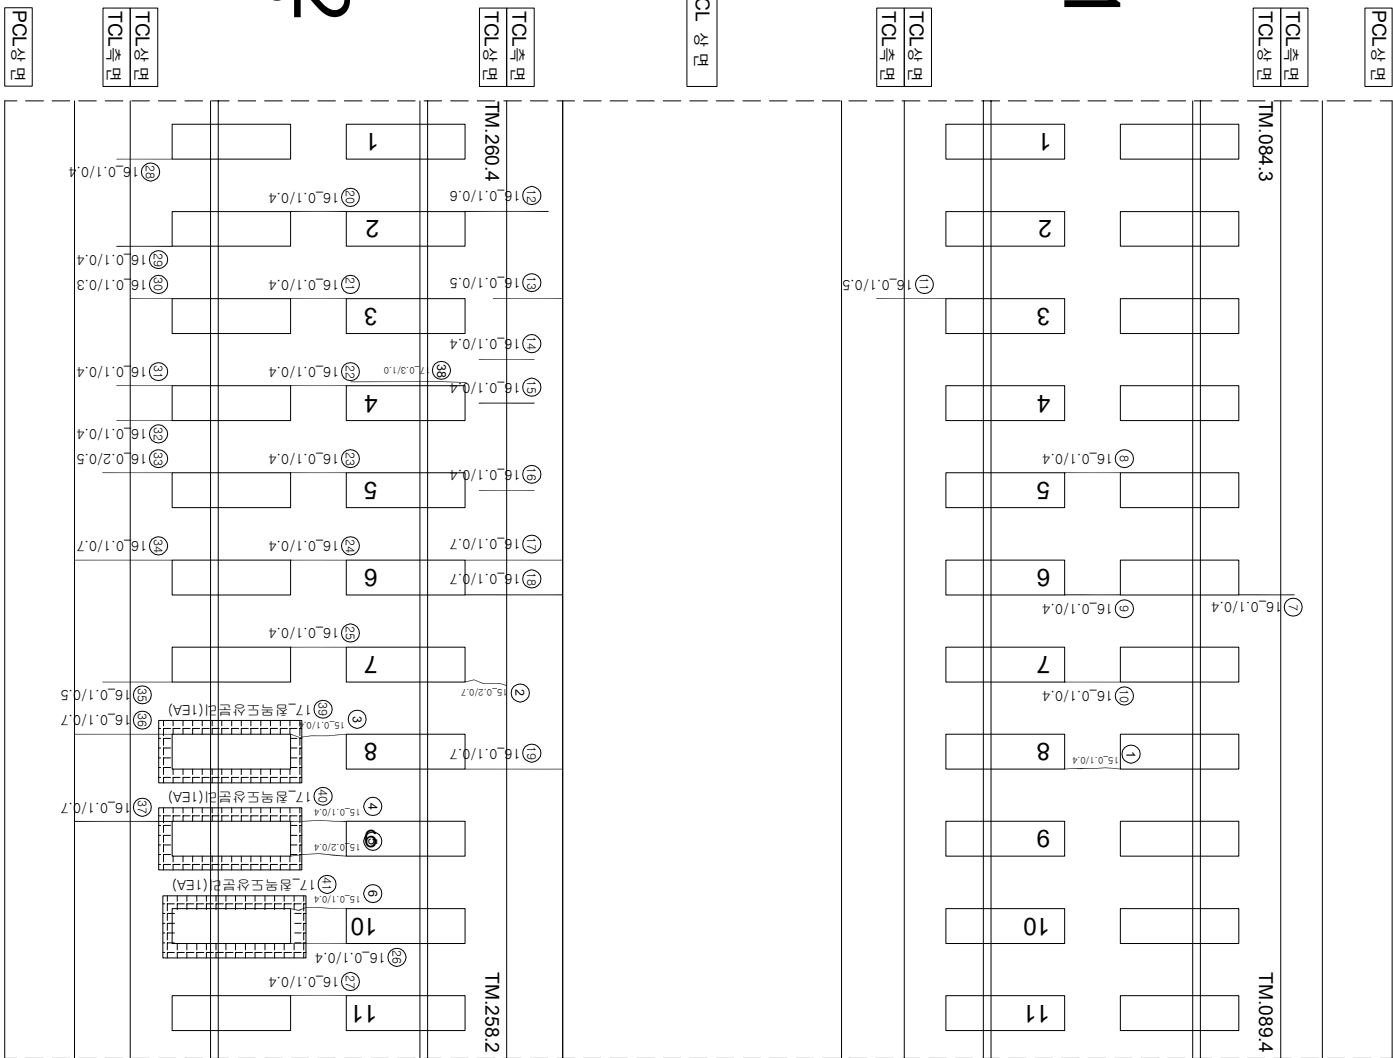

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m	m	55				
2	균열	0.2 mm	0.7 m	m	56				
3	균열	0.1 mm	0.4 m	m	57				
4	균열	0.1 mm	0.4 m	m	58				
5	균열	0.2 mm	0.4 m	m	59				
6	균열	0.1 mm	0.4 m	m	60				
7	균열	0.1 mm	0.4 m	m	61				
8	균열	0.1 mm	0.4 m	m	62				
9	균열	0.1 mm	0.4 m	m	63				
10	균열	0.1 mm	0.4 m	m	64				
11	균열	0.1 mm	0.5 m	m	65				
12	균열	0.1 mm	0.6 m	m	66				
13	균열	0.1 mm	0.5 m	m	67				
14	균열	0.1 mm	0.4 m	m	68				
15	균열	0.1 mm	0.4 m	m	69				
16	균열	0.1 mm	0.4 m	m	70				
17	균열	0.1 mm	0.7 m	m	71				
18	균열	0.1 mm	0.7 m	m	72				
19	균열	0.1 mm	0.7 m	m	73				
20	균열	0.1 mm	0.4 m	m	74				
21	균열	0.1 mm	0.4 m	m	75				
22	균열	0.1 mm	0.4 m	m	76				
23	균열	0.1 mm	0.4 m	m	77				
24	균열	0.1 mm	0.4 m	m	78				
25	균열	0.1 mm	0.4 m	m	79				
26	균열	0.1 mm	0.4 m	m	80				
27	균열	0.1 mm	0.4 m	m	81				
28	균열	0.1 mm	0.4 m	m	82				
29	균열	0.1 mm	0.4 m	m	83				
30	균열	0.1 mm	0.4 m	m	84				
31	균열	0.1 mm	0.3 m	m	85				
32	균열	0.1 mm	0.4 m	m	86				
33	균열	0.2 mm	0.5 m	m	87				
34	균열	0.1 mm	0.7 m	m	88				
35	균열	0.1 mm	0.5 m	m	89				
36	균열	0.1 mm	0.7 m	m	90				
37	균열	0.1 mm	0.7 m	m	91				
38	균열부 균열	0.3 mm	1.0 m	신규	92				
39	점액도상분리		1.0 EA	신규	93				
40	점액도상분리		1.0 EA	신규	94				
41	점액도상분리		1.0 EA	신규	95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	영 역	영 역	영 역	사	이 부 영		구 분			
						과 일 전 입 지	정 보 이 별 책 입 지				
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승경간 콘크리트캐드 점검공역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 부 영	김 윤 강 김 경 기 문 석 기	영원		0220 (0.3m이하 : 흑색)		재료분리	
								0420 (0.3m초과 0.5m이하 : 청색)		망상	
								0620 (0.5m초과 1.0m미만 : 적색)		박리, 박락, 파손	
								1020 (1.0m이상 : 분홍색)		번데	
										노상	
										누수, 침윤부	