


호남고속선 장구교_157(49.587~49.594km, S32-1)

P31
49K587

32 SPAN - 1

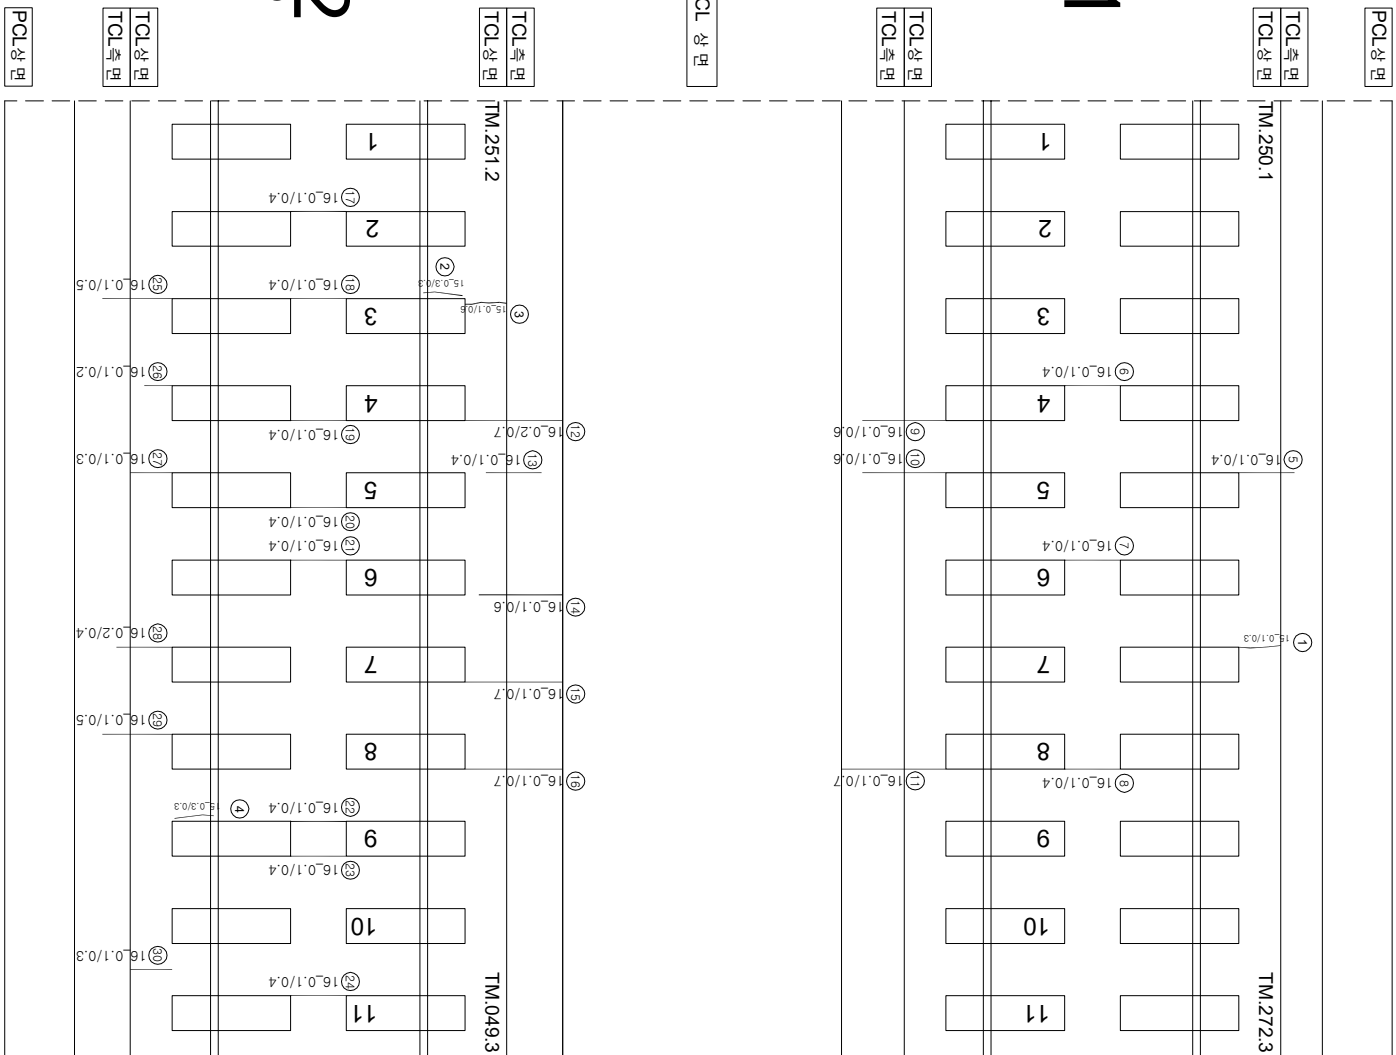

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.3 m		55				
2	경계부 균열	0.3 mm	0.3 m		56				
3	균열	0.1 mm	0.6 m		57				
4	경계부 균열	0.3 mm	0.3 m		58				
5	균열	0.1 mm	0.4 m		59				
6	균열	0.1 mm	0.4 m		60				
7	균열	0.1 mm	0.4 m		61				
8	균열	0.1 mm	0.4 m		62				
9	균열	0.1 mm	0.6 m		63				
10	균열	0.1 mm	0.6 m		64				
11	균열	0.1 mm	0.7 m		65				
12	균열	0.2 mm	0.7 m		66				
13	균열	0.1 mm	0.4 m		67				
14	균열	0.1 mm	0.6 m		68				
15	균열	0.1 mm	0.7 m		69				
16	균열	0.1 mm	0.7 m		70				
17	균열	0.1 mm	0.4 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열	0.1 mm	0.4 m		73				
20	균열	0.1 mm	0.4 m		74				
21	균열	0.1 mm	0.4 m		75				
22	균열	0.1 mm	0.4 m		76				
23	균열	0.1 mm	0.4 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.1 mm	0.5 m		79				
26	균열	0.1 mm	0.2 m		80				
27	균열	0.1 mm	0.3 m		81				
28	균열	0.2 mm	0.4 m		82				
29	균열	0.1 mm	0.5 m		83				
30	균열	0.1 mm	0.3 m		84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	영 역	영 역	영 역	사	이 부 영		구 분	
						과 일 전 입 지	정 보 이 별 책 일 지		
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트캐드 점검공역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 부 영	김 윤 강 김 경 기 문 석 기	구 분	 0220 (0.3m이하 : 철석)	점목도상판리	
							 0420 (0.3m초과 0.5m이하 : 형석)	망상	
							 0620 (0.5m초과 1.0m미만 : 적석)	반리, 반리, 표준	
							 1020 (1.0m이상 : 불용석)	백태	
							 0220 (0.3m이하 : 철석)	재료판리	
							 0420 (0.3m초과 0.5m이하 : 형석)	철근노출	
							 0620 (0.5m초과 1.0m미만 : 적석)	부수, 슬래브	
							 1020 (1.0m이상 : 불용석)	시공이음판리, 종판리	