


호남고속선 오강교_토공노반_14(51.890~51.900km, L=10m)

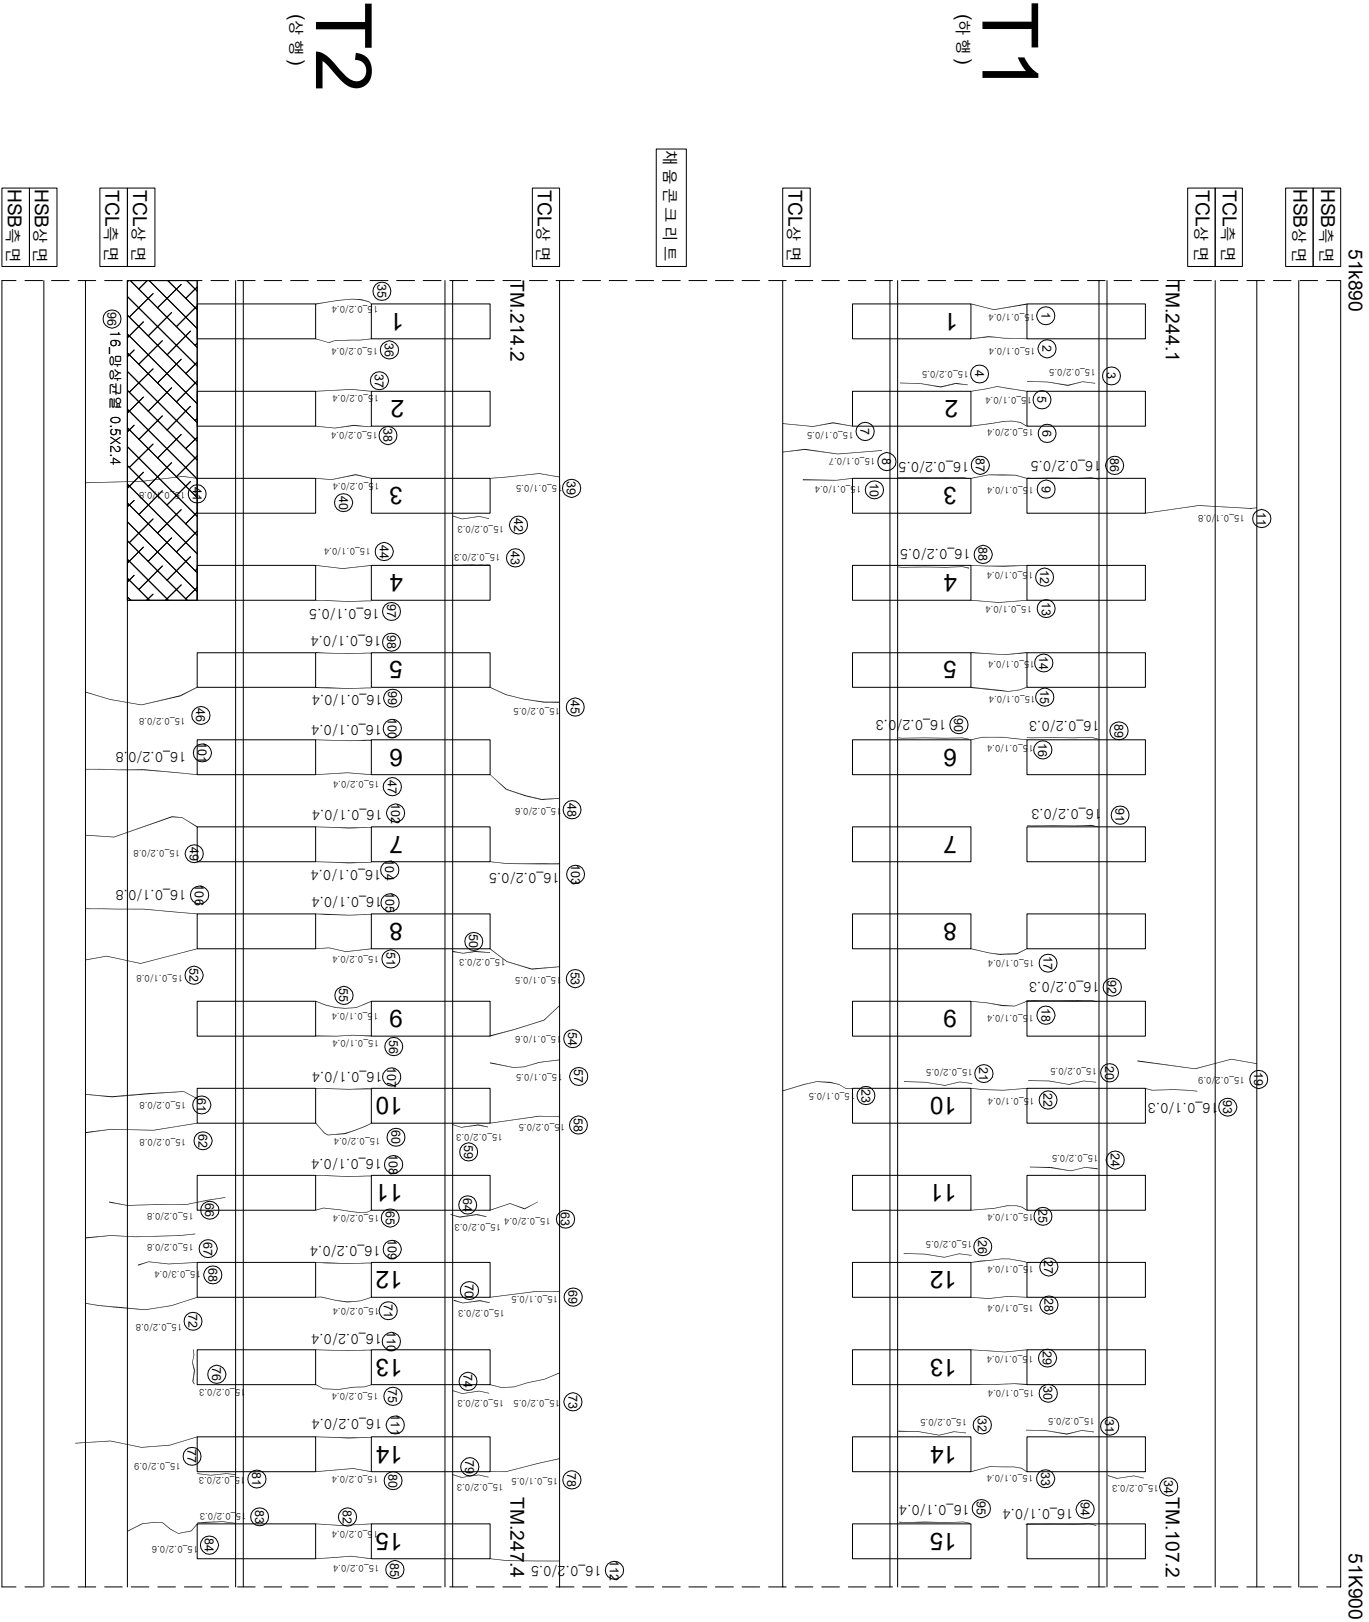

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		63	균열	0.2 mm	0.4 m	
2	균열	0.1 mm	0.4 m		64	강제부 균열	0.2 mm	0.3 m	
3	강제부 균열	0.2 mm	0.5 m		65	균열	0.2 mm	0.4 m	
4	강제부 균열	0.2 mm	0.5 m		66	균열	0.2 mm	0.8 m	
5	균열	0.1 mm	0.4 m		67	균열	0.2 mm	0.8 m	
6	균열	0.2 mm	0.4 m		68	균열	0.3 mm	0.4 m	
7	균열	0.1 mm	0.5 m		69	균열	0.1 mm	0.5 m	
8	균열	0.1 mm	0.7 m		70	강제부 균열	0.2 mm	0.3 m	
9	균열	0.1 mm	0.4 m		71	균열	0.2 mm	0.4 m	
10	균열	0.1 mm	0.4 m		72	균열	0.2 mm	0.8 m	
11	균열	0.1 mm	0.8 m		73	균열	0.2 mm	0.5 m	
12	균열	0.1 mm	0.4 m		74	강제부 균열	0.2 mm	0.3 m	
13	균열	0.1 mm	0.4 m		75	균열	0.2 mm	0.4 m	
14	균열	0.1 mm	0.4 m		76	강제부 균열	0.2 mm	0.3 m	
15	균열	0.1 mm	0.4 m		77	균열	0.1 mm	0.5 m	
16	균열	0.1 mm	0.4 m		78	균열	0.2 mm	0.3 m	
17	균열	0.1 mm	0.4 m		79	강제부 균열	0.2 mm	0.4 m	
18	균열	0.1 mm	0.4 m		80	균열	0.2 mm	0.4 m	
19	균열	0.2 mm	0.9 m		81	강제부 균열	0.2 mm	0.3 m	
20	강제부 균열	0.2 mm	0.5 m		82	균열	0.2 mm	0.4 m	
21	강제부 균열	0.2 mm	0.5 m		83	강제부 균열	0.2 mm	0.6 m	
22	균열	0.1 mm	0.4 m		84	균열	0.2 mm	0.3 m	
23	균열	0.1 mm	0.5 m		85	균열	0.2 mm	0.4 m	
24	강제부 균열	0.2 mm	0.5 m		86	강제부 균열	0.2 mm	0.5 m	
25	균열	0.2 mm	0.4 m		87	강제부 균열	0.2 mm	0.5 m	
26	강제부 균열	0.2 mm	0.5 m		88	강제부 균열	0.2 mm	0.5 m	
27	균열	0.1 mm	0.4 m		89	강제부 균열	0.2 mm	0.3 m	
28	균열	0.1 mm	0.4 m		90	강제부 균열	0.2 mm	0.3 m	
29	균열	0.1 mm	0.4 m		91	강제부 균열	0.2 mm	0.3 m	
30	균열	0.1 mm	0.4 m		92	강제부 균열	0.2 mm	0.3 m	
31	강제부 균열	0.2 mm	0.5 m		93	균열	0.1 mm	0.3 m	
32	강제부 균열	0.2 mm	0.5 m		94	강제부 균열	0.1 mm	0.4 m	
33	균열	0.1 mm	0.4 m		95	강제부 균열	0.1 mm	0.4 m	
34	강제부 균열	0.2 mm	0.3 m		96	방수 균열	0.5 m	2.4 m	
35	균열	0.2 mm	0.4 m		97	균열	0.1 mm	0.5 m	
36	균열	0.2 mm	0.4 m		98	균열	0.1 mm	0.4 m	
37	균열	0.2 mm	0.4 m		99	균열	0.1 mm	0.4 m	
38	균열	0.2 mm	0.4 m		100	균열	0.1 mm	0.4 m	
39	균열	0.1 mm	0.5 m		101	균열	0.2 mm	0.8 m	
40	균열	0.2 mm	0.4 m		102	균열	0.1 mm	0.4 m	
41	균열	0.1 mm	0.8 m		103	균열	0.2 mm	0.5 m	
42	강제부 균열	0.2 mm	0.3 m		104	균열	0.1 mm	0.4 m	
43	강제부 균열	0.2 mm	0.3 m		105	균열	0.1 mm	0.4 m	
44	균열	0.1 mm	0.4 m		106	균열	0.1 mm	0.8 m	
45	균열	0.2 mm	0.5 m		107	균열	0.1 mm	0.4 m	
46	균열	0.2 mm	0.8 m		108	균열	0.1 mm	0.4 m	
47	균열	0.2 mm	0.6 m		109	균열	0.2 mm	0.4 m	
48	균열	0.2 mm	0.6 m		110	균열	0.2 mm	0.4 m	
49	균열	0.2 mm	0.8 m		111	균열	0.2 mm	0.4 m	
50	강제부 균열	0.2 mm	0.3 m		112	균열	0.2 mm	0.5 m	
51	균열	0.2 mm	0.4 m						
52	균열	0.1 mm	0.8 m						
53	균열	0.1 mm	0.5 m						
54	균열	0.1 mm	0.6 m						
55	균열	0.1 mm	0.4 m						
56	균열	0.1 mm	0.4 m						
57	균열	0.1 mm	0.5 m						
58	균열	0.2 mm	0.5 m						
59	강제부 균열	0.2 mm	0.3 m						
60	균열	0.2 mm	0.4 m						
61	균열	0.2 mm	0.8 m						
62	균열	0.2 mm	0.8 m						

시	행	사	용	역	명	용	역	사	연			간	열			점																																	
									관	제	임		차	분	아		별	적	임	지																													
	한국철도공사	KOREA RAILROAD	2017년도 호남고속선 오송-광주송정간 콘크리트케도 점검용역			(주) 한국구조물안전연구원 (주) 한국토목안전연구원 (재) 한국건설품질연구원			이	복	영	간원강 김정기 윤석기			0.220 (0.3mm이하 : 흑색)		점도도상분리				0.420 (0.3mm초과 0.5mm이하 : 황색)		양상				0.620 (0.5mm초과 1.0mm이하 : 적색)		바리,바리,파손				1.020 (1.0mm이상 : 분홍색)		백태				0.820		시공이음분리,층분리								