


한남고속선 오강교 - 토아노반 - 16(51.910~51.920km, L=10m)

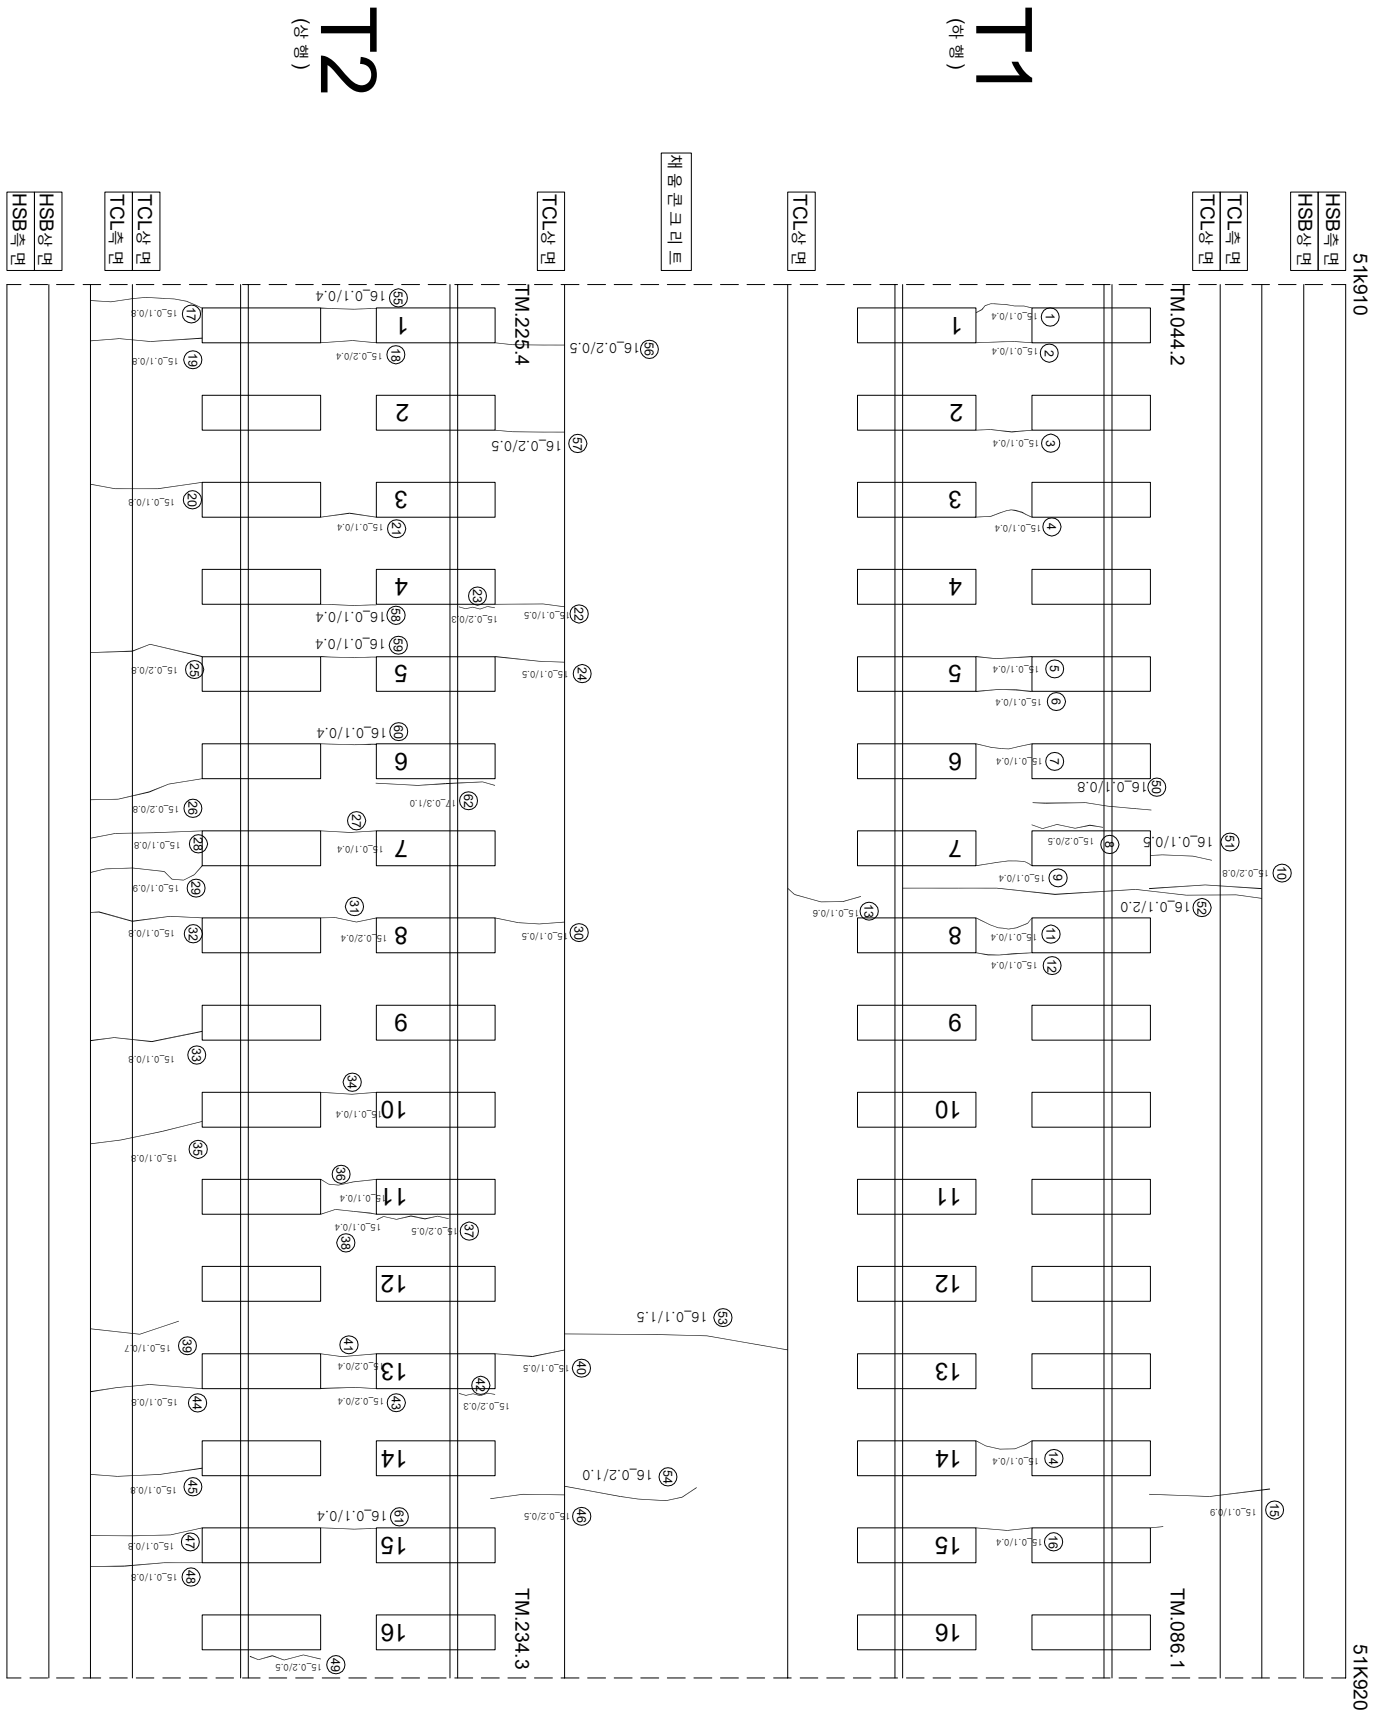

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열 0.1 mm	0.4 m			55	균열 0.1 mm	0.4 m		
2	균열 0.1 mm	0.4 m			56	균열 0.2 mm	0.5 m		
3	균열 0.1 mm	0.4 m			57	균열 0.2 mm	0.5 m		
4	균열 0.1 mm	0.4 m			58	균열 0.1 mm	0.4 m		
5	균열 0.1 mm	0.4 m			59	균열 0.1 mm	0.4 m		
6	균열 0.1 mm	0.4 m			60	균열 0.1 mm	0.4 m		
7	균열 0.1 mm	0.4 m			61	균열 0.1 mm	0.4 m		
8	외측부 균열 0.2 mm	0.5 m			62	외측부 균열 0.3 mm	1.0 m		
9	균열 0.1 mm	0.4 m			63				
10	균열 0.2 mm	0.6 m			64				
11	균열 0.1 mm	0.4 m			65				
12	균열 0.1 mm	0.4 m			66				
13	균열 0.1 mm	0.6 m			67				
14	균열 0.1 mm	0.4 m			68				
15	균열 0.1 mm	0.9 m			69				
16	균열 0.1 mm	0.4 m			70				
17	균열 0.1 mm	0.6 m			71				
18	균열 0.2 mm	0.4 m			72				
19	균열 0.1 mm	0.6 m			73				
20	균열 0.1 mm	0.6 m			74				
21	균열 0.1 mm	0.4 m			75				
22	균열 0.1 mm	0.5 m			76				
23	외측부 균열 0.2 mm	0.3 m			77				
24	균열 0.1 mm	0.5 m			78				
25	균열 0.2 mm	0.6 m			79				
26	균열 0.2 mm	0.8 m			80				
27	균열 0.1 mm	0.4 m			81				
28	균열 0.1 mm	0.6 m			82				
29	균열 0.1 mm	0.9 m			83				
30	균열 0.1 mm	0.5 m			84				
31	균열 0.2 mm	0.4 m			85				
32	균열 0.1 mm	0.6 m			86				
33	균열 0.1 mm	0.6 m			87				
34	균열 0.1 mm	0.4 m			88				
35	균열 0.1 mm	0.6 m			89				
36	균열 0.1 mm	0.4 m			90				
37	외측부 균열 0.2 mm	0.5 m			91				
38	균열 0.1 mm	0.4 m			92				
39	균열 0.1 mm	0.7 m			93				
40	균열 0.1 mm	0.5 m			94				
41	균열 0.2 mm	0.4 m			95				
42	외측부 균열 0.2 mm	0.3 m			96				
43	균열 0.2 mm	0.4 m			97				
44	균열 0.1 mm	0.6 m			98				
45	균열 0.1 mm	0.6 m			99				
46	균열 0.2 mm	0.5 m			100				
47	균열 0.1 mm	0.6 m			101				
48	균열 0.1 mm	0.6 m			102				
49	외측부 균열 0.2 mm	0.5 m			103				
50	균열 0.1 mm	0.6 m			104				
51	균열 0.1 mm	0.5 m			105				
52	균열 0.1 mm	2.0 m			106				
53	균열 0.1 mm	1.5 m			107				
54	균열 0.2 mm	1.0 m			108				

[illegible]