


호남고속선 신당교_152 (53.048~53.055km, S30-5)

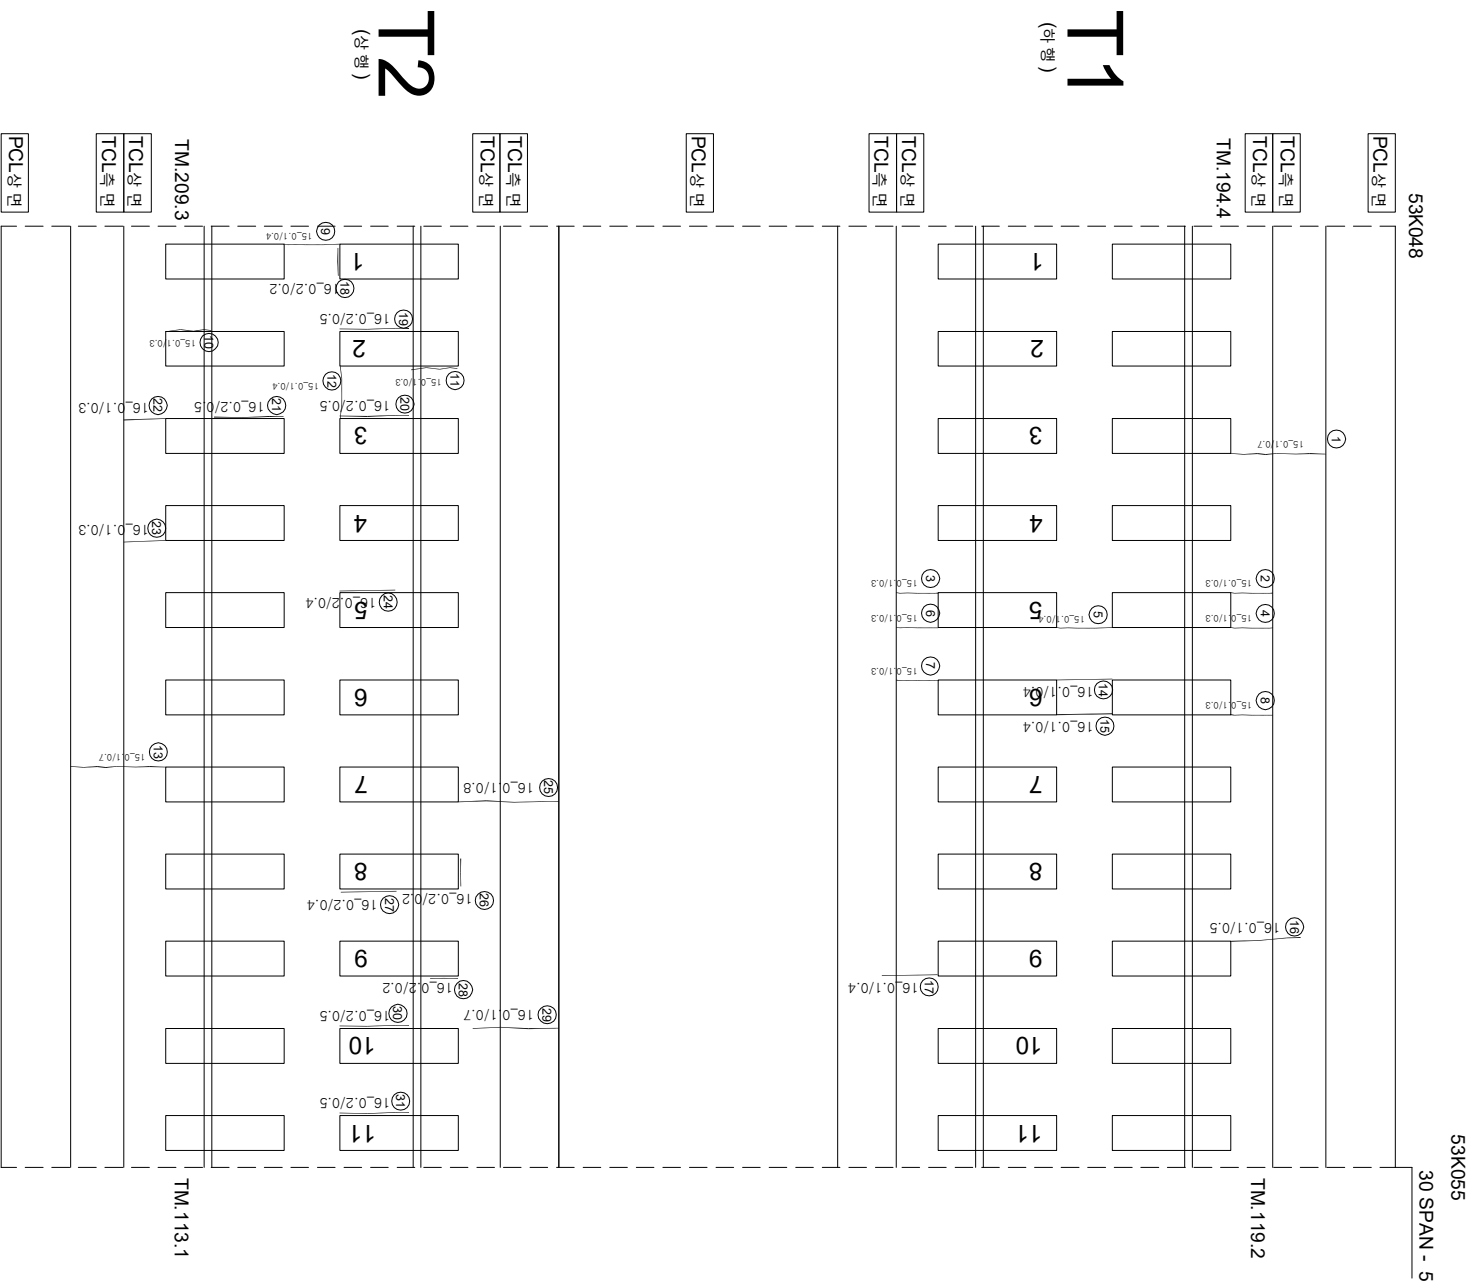

연번	순서	폭	연장	비고	연번	순서	폭	연장	비고
1	균열	0.1 mm	0.7 m		55				
2	균열	0.1 mm	0.3 m		56				
3	균열	0.1 mm	0.3 m		57				
4	균열	0.1 mm	0.3 m		58				
5	균열	0.1 mm	0.4 m		59				
6	균열	0.1 mm	0.3 m		60				
7	균열	0.1 mm	0.3 m		61				
8	균열	0.1 mm	0.3 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.1 mm	0.3 m		64				
11	균열	0.1 mm	0.3 m		65				
12	균열	0.1 mm	0.4 m		66				
13	균열	0.1 mm	0.7 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열	0.1 mm	0.4 m		69				
16	균열	0.1 mm	0.5 m		70				
17	균열	0.1 mm	0.4 m		71				
18	균열	0.3 mm	0.2 m		72				
19	균열	0.2 mm	0.5 m		73				
20	균열	0.2 mm	0.5 m		74				
21	균열	0.2 mm	0.5 m		75				
22	균열	0.1 mm	0.3 m		76				
23	균열	0.1 mm	0.3 m		77				
24	균열	0.2 mm	0.4 m		78				
25	균열	0.1 mm	0.8 m		79				
26	균열	0.2 mm	0.2 m		80				
27	균열	0.2 mm	0.4 m		81				
28	균열	0.2 mm	0.2 m		82				
29	균열	0.1 mm	0.7 m		83				
30	균열	0.2 mm	0.5 m		84				
31	균열	0.2 mm	0.5 m		85				
32	균열	0.2 mm	0.5 m		86				
33	균열	0.1 mm	0.3 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.1 mm	0.8 m		89				
36	균열	0.1 mm	0.4 m		90				
37	균열	0.1 mm	0.4 m		91				
38	균열	0.1 mm	0.4 m		92				
39	균열	0.1 mm	0.4 m		93				
40	균열	0.1 mm	0.4 m		94				
41	균열	0.1 mm	0.4 m		95				
42	균열	0.1 mm	0.4 m		96				
43	균열	0.1 mm	0.4 m		97				
44	균열	0.1 mm	0.4 m		98				
45	균열	0.1 mm	0.4 m		99				
46	균열	0.1 mm	0.4 m		100				
47	균열	0.1 mm	0.4 m		101				
48	균열	0.1 mm	0.4 m		102				
49	균열	0.1 mm	0.4 m		103				
50	균열	0.1 mm	0.4 m		104				
51	균열	0.1 mm	0.4 m		105				
52	균열	0.1 mm	0.4 m		106				
53	균열	0.1 mm	0.4 m		107				
54	균열	0.1 mm	0.4 m		108				

 KORAIL KOREA RAILROAD	시행사	한국철도공사	2017년도 호남고속선 오송-광주승정간 편곡리트케도 정검용역	용역명	용역사	(주)한국구조물안전연구원 (주)한국도로안전연구원 (재)한국건설품질연구원	이부영 김경기 윤석기	간원강 김경기 윤석기	용역	 0220 (0.3m이하 : 폭식)	참목도상분리		재료분리	
										 0420 (0.3m초과 0.5m이하 : 형식)	양상		철근도출	
										 0620 (0.5m초과 1.0m이하 : 적식)	바닥,벽체,파손		부수,슬래브	
										 1020 (1.0m이상 : 분포식)	백태		시공이음분리,종분리	