


화남고속선 15 (53.340~53.350 (L=10m))

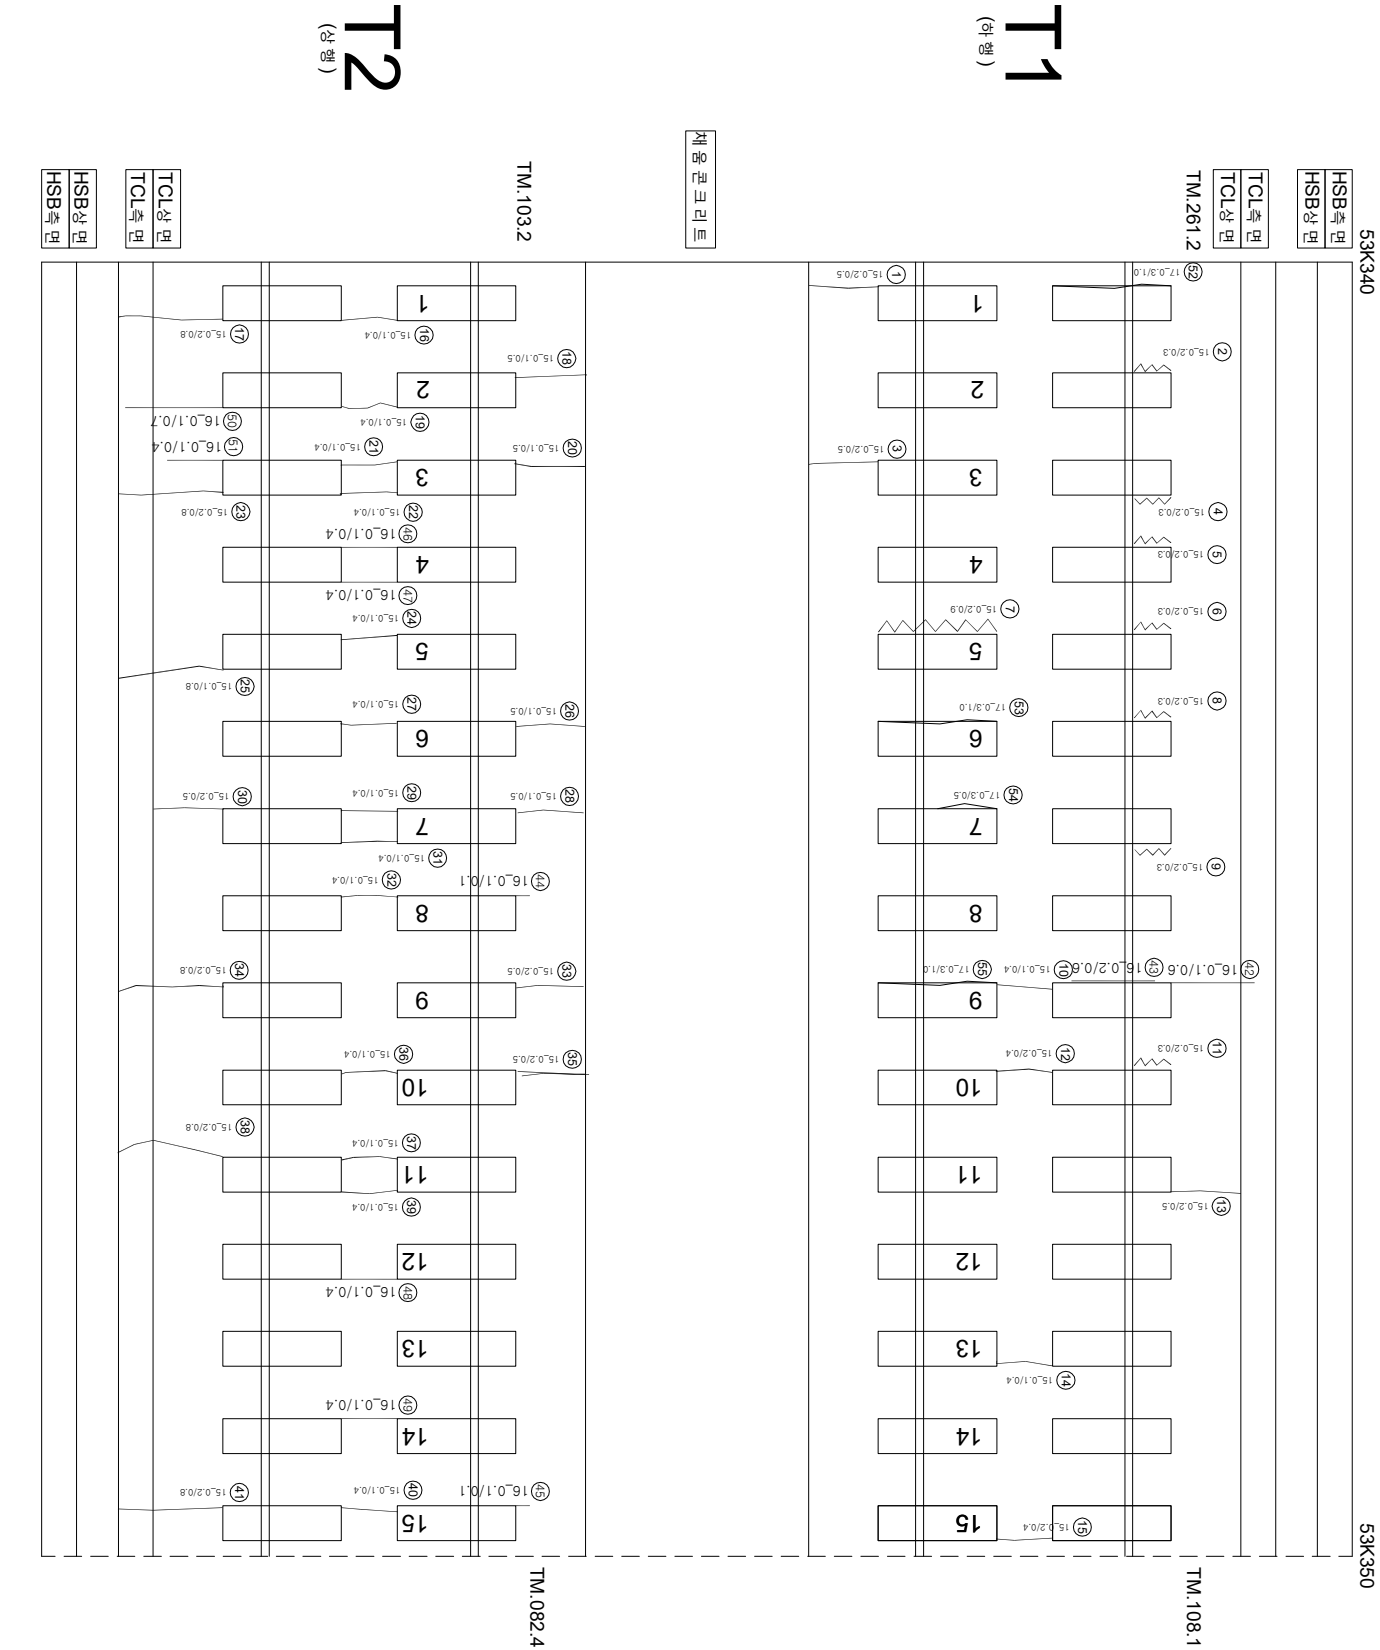

연번	순차	폭	연장	비고	연번	순차	폭	연장	비고
1	균열	0.2 mm	0.5 m	m	55				
2	강재부 균열	0.2 mm	0.3 m	m	56				
3	균열	0.2 mm	0.5 m	m	57				
4	강재부 균열	0.2 mm	0.3 m	m	58				
5	강재부 균열	0.2 mm	0.3 m	m	59				
6	강재부 균열	0.2 mm	0.3 m	m	60				
7	강재부 균열	0.2 mm	0.9 m	m	61				
8	강재부 균열	0.2 mm	0.3 m	m	62				
9	강재부 균열	0.2 mm	0.3 m	m	63				
10	균열	0.1 mm	0.4 m	m	64				
11	강재부 균열	0.2 mm	0.3 m	m	65				
12	균열	0.2 mm	0.4 m	m	66				
13	균열	0.2 mm	0.5 m	m	67				
14	균열	0.1 mm	0.4 m	m	68				
15	균열	0.2 mm	0.4 m	m	69				
16	균열	0.1 mm	0.4 m	m	70				
17	균열	0.2 mm	0.8 m	m	71				
18	균열	0.1 mm	0.5 m	m	72				
19	균열	0.1 mm	0.4 m	m	73				
20	균열	0.1 mm	0.5 m	m	74				
21	균열	0.1 mm	0.4 m	m	75				
22	균열	0.1 mm	0.4 m	m	76				
23	균열	0.2 mm	0.8 m	m	77				
24	균열	0.1 mm	0.4 m	m	78				
25	균열	0.1 mm	0.8 m	m	79				
26	균열	0.1 mm	0.5 m	m	80				
27	균열	0.1 mm	0.4 m	m	81				
28	균열	0.1 mm	0.5 m	m	82				
29	균열	0.1 mm	0.4 m	m	83				
30	균열	0.2 mm	0.5 m	m	84				
31	균열	0.1 mm	0.4 m	m	85				
32	균열	0.1 mm	0.4 m	m	86				
33	균열	0.2 mm	0.5 m	m	87				
34	균열	0.2 mm	0.8 m	m	88				
35	균열	0.2 mm	0.5 m	m	89				
36	균열	0.1 mm	0.4 m	m	90				
37	균열	0.1 mm	0.4 m	m	91				
38	균열	0.2 mm	0.8 m	m	92				
39	균열	0.1 mm	0.4 m	m	93				
40	균열	0.1 mm	0.4 m	m	94				
41	균열	0.2 mm	0.8 m	m	95				
42	균열	0.1 mm	0.6 m	m	96				
43	강재부 균열	0.2 mm	0.6 m	m	97				
44	균열	0.1 mm	0.1 m	m	98				
45	균열	0.1 mm	0.1 m	m	99				
46	균열	0.1 mm	0.4 m	m	100				
47	균열	0.1 mm	0.4 m	m	101				
48	균열	0.1 mm	0.4 m	m	102				
49	균열	0.1 mm	0.4 m	m	103				
50	균열	0.1 mm	0.7 m	m	104				
51	균열	0.1 mm	0.4 m	m	105				
52	균열	0.3 mm	1.0 m	m	106				
53	균열	0.3 mm	1.0 m	m	107				
54	균열	0.3 mm	0.5 m	m	108				

시 행 사	공 영 명	공 역 사	구 단		구 단 명	구 단 상 징
			과 업 배 임 지	장 아 지		
KORAIL 한국철도공사 KOREA RAILROAD	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검영역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설철물연구원	이 복 영		간 음 경 김 경 기 문 은 석 기	 0222 (0.3mm이하 : 불식)  0420 (0.3mm초과 0.5mm이하 : 평식)  0620 (0.5mm초과 1.0mm이하 : 적식)  1024 (1.0mm이상 : 분출식)  1024 (1.0mm이상 : 분출식)
			철도도상본리			
			철근노출			
			누수, 슬관부			
			시공이음본리, 종본리			