


하남고속선 공리터널 - 토양노반 - 163(55.890~55.900km, L=10m)

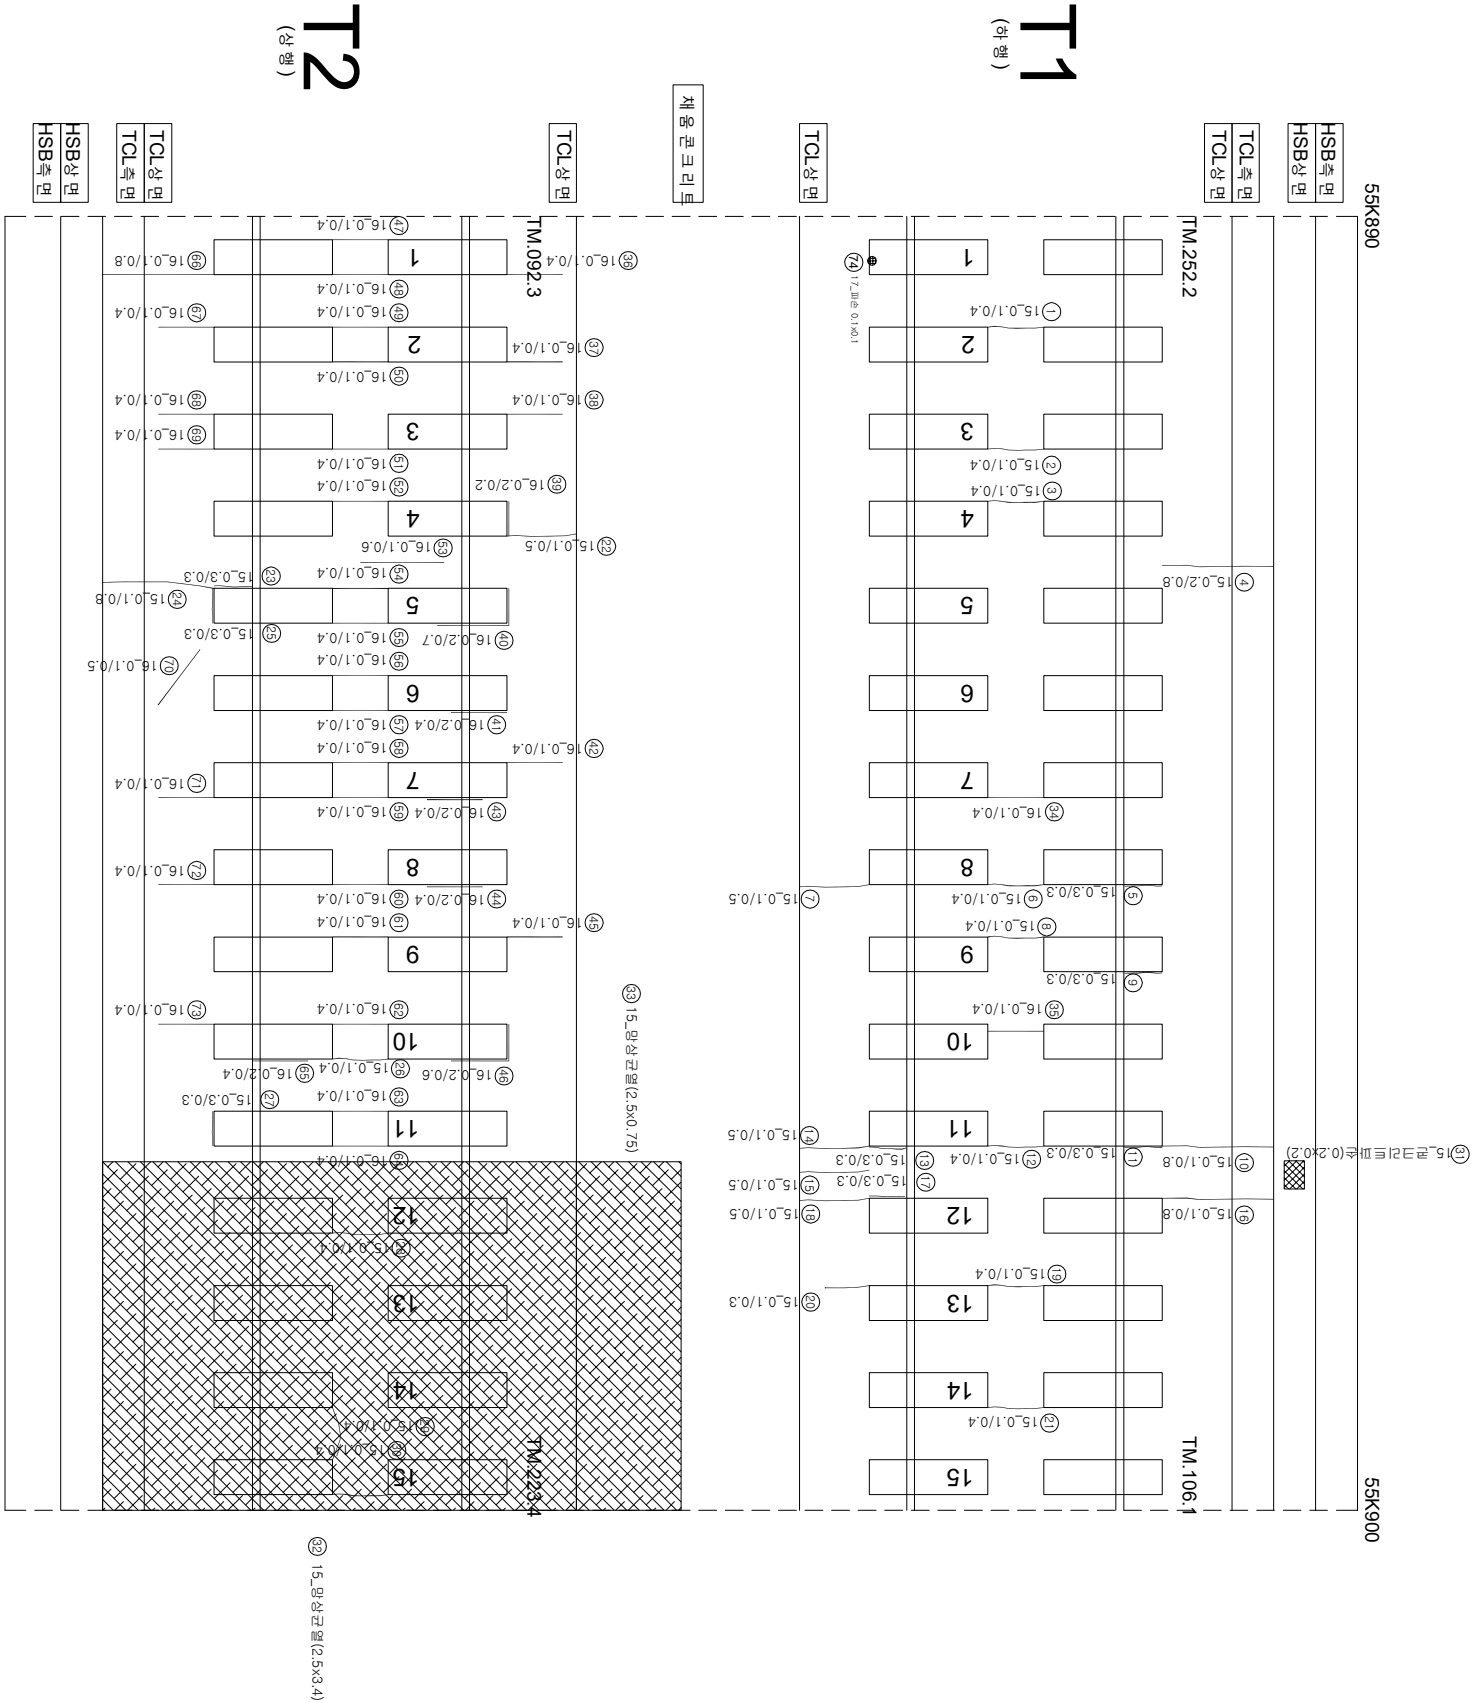

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m	m	55	균열	0.1 mm	0.4 m	
2	균열	0.1 mm	0.4 m	m	56	균열	0.1 mm	0.4 m	
3	균열	0.1 mm	0.4 m	m	57	균열	0.1 mm	0.4 m	
4	균열	0.2 mm	0.8 m	m	58	균열	0.1 mm	0.4 m	
5	균열부 균열	0.3 mm	0.3 m	m	59	균열	0.1 mm	0.4 m	
6	균열	0.1 mm	0.4 m	m	60	균열	0.1 mm	0.4 m	
7	균열	0.1 mm	0.5 m	m	61	균열	0.1 mm	0.4 m	
8	균열	0.1 mm	0.4 m	m	62	균열	0.1 mm	0.4 m	
9	균열부 균열	0.3 mm	0.3 m	m	63	균열	0.1 mm	0.4 m	
10	균열	0.1 mm	0.8 m	m	64	균열	0.1 mm	0.4 m	
11	균열부 균열	0.3 mm	0.3 m	m	65	균열부 균열	0.2 mm	0.4 m	
12	균열	0.1 mm	0.4 m	m	66	균열	0.1 mm	0.8 m	
13	균열부 균열	0.3 mm	0.3 m	m	67	균열	0.1 mm	0.4 m	
14	균열	0.1 mm	0.5 m	m	68	균열	0.1 mm	0.4 m	
15	균열	0.1 mm	0.5 m	m	69	균열	0.1 mm	0.4 m	
16	균열	0.1 mm	0.8 m	m	70	균열	0.1 mm	0.5 m	
17	균열부 균열	0.3 mm	0.3 m	m	71	균열	0.1 mm	0.4 m	
18	균열	0.1 mm	0.5 m	m	72	균열	0.1 mm	0.4 m	
19	균열	0.1 mm	0.4 m	m	73	균열	0.1 mm	0.4 m	
20	균열	0.1 mm	0.3 m	m	74	피손	0.1 mm	0.1 m	신규
21	균열	0.1 mm	0.4 m	m	75				
22	균열	0.1 mm	0.5 m	m	76				
23	균열부 균열	0.3 mm	0.3 m	m	77				
24	균열	0.1 mm	0.8 m	m	78				
25	균열부 균열	0.3 mm	0.3 m	m	79				
26	균열	0.1 mm	0.4 m	m	80				
27	균열부 균열	0.3 mm	0.3 m	m	81				
28	균열	0.1 mm	0.4 m	m	82				
29	균열	0.1 mm	0.4 m	m	83				
30	균열	0.1 mm	0.4 m	m	84				
31	핀크리트 파손	0.2 m	0.2 m	m	85				
32	방수균열	2.5 m	3.4 m	m	86				
33	방수균열	2.5 m	0.75 m	m	87				
34	균열	0.1 mm	0.4 m	m	88				
35	균열	0.1 mm	0.4 m	m	89				
36	균열	0.1 mm	0.4 m	m	90				
37	균열	0.1 mm	0.4 m	m	91				
38	균열	0.1 mm	0.4 m	m	92				
39	균열부 균열	0.2 mm	0.2 m	m	93				
40	균열부 균열	0.2 mm	0.7 m	m	94				
41	균열부 균열	0.2 mm	0.4 m	m	95				
42	균열	0.1 mm	0.4 m	m	96				
43	균열부 균열	0.2 mm	0.4 m	m	97				
44	균열부 균열	0.2 mm	0.4 m	m	98				
45	균열	0.1 mm	0.4 m	m	99				
46	균열부 균열	0.2 mm	0.6 m	m	100				
47	균열	0.1 mm	0.4 m	m	101				
48	균열	0.1 mm	0.4 m	m	102				
49	균열	0.1 mm	0.4 m	m	103				
50	균열	0.1 mm	0.4 m	m	104				
51	균열	0.1 mm	0.4 m	m	105				
52	균열	0.1 mm	0.4 m	m	106				
53	균열	0.1 mm	0.6 m	m	107				
54	균열	0.1 mm	0.4 m	m	108				

[illegible]