


와 남고속선종리터널-토공노반-46(54.720~54.730km, L=10m)

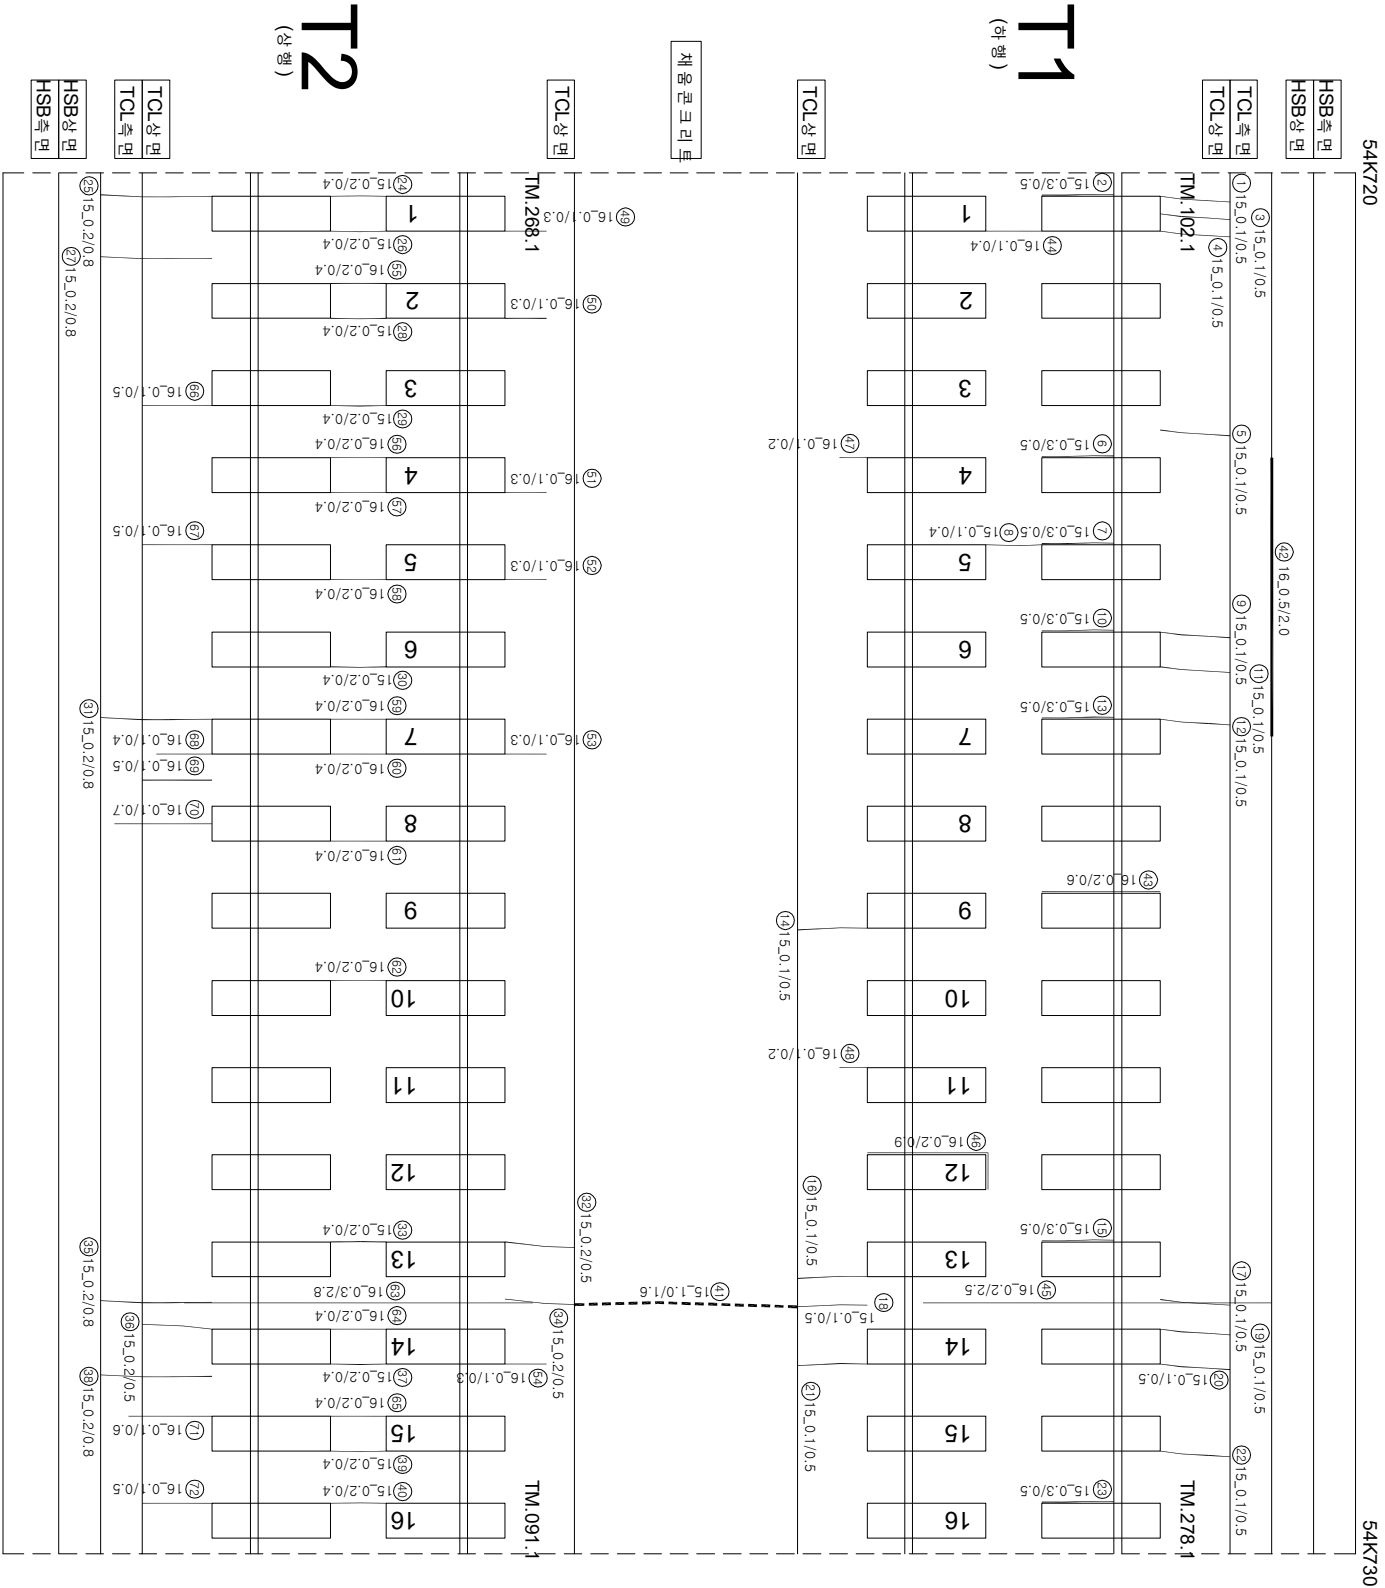

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.5 m	m	55	균열	0.2 mm	0.4 m	m
2	장계부 균열	0.3 mm	0.5 m	m	56	균열	0.2 mm	0.4 m	m
3	균열	0.1 mm	0.5 m	m	57	균열	0.2 mm	0.4 m	m
4	균열	0.1 mm	0.5 m	m	58	균열	0.2 mm	0.4 m	m
5	균열	0.1 mm	0.5 m	m	59	균열	0.2 mm	0.4 m	m
6	장계부 균열	0.3 mm	0.5 m	m	60	균열	0.2 mm	0.4 m	m
7	장계부 균열	0.3 mm	0.5 m	m	61	균열	0.2 mm	0.4 m	m
8	균열	0.1 mm	0.4 m	m	62	균열	0.2 mm	0.4 m	m
9	균열	0.1 mm	0.5 m	m	63	균열	0.3 mm	2.8 m	m
10	장계부 균열	0.3 mm	0.5 m	m	64	균열	0.2 mm	0.4 m	m
11	균열	0.1 mm	0.5 m	m	65	균열	0.2 mm	0.4 m	m
12	균열	0.1 mm	0.5 m	m	66	균열	0.1 mm	0.5 m	m
13	장계부 균열	0.3 mm	0.5 m	m	67	균열	0.1 mm	0.5 m	m
14	균열	0.1 mm	0.5 m	m	68	균열	0.1 mm	0.4 m	m
15	장계부 균열	0.3 mm	0.5 m	m	69	균열	0.1 mm	0.5 m	m
16	균열	0.1 mm	0.5 m	m	70	균열	0.1 mm	0.7 m	m
17	균열	0.1 mm	0.5 m	m	71	균열	0.1 mm	0.6 m	m
18	균열	0.1 mm	0.5 m	m	72	균열	0.1 mm	0.5 m	m
19	균열	0.1 mm	0.5 m	m	73				
20	균열	0.1 mm	0.5 m	m	74				
21	균열	0.1 mm	0.5 m	m	75				
22	균열	0.1 mm	0.5 m	m	76				
23	장계부 균열	0.3 mm	0.5 m	m	77				
24	균열	0.2 mm	0.4 m	m	78				
25	균열	0.2 mm	0.8 m	m	79				
26	균열	0.2 mm	0.4 m	m	80				
27	균열	0.2 mm	0.8 m	m	81				
28	균열	0.2 mm	0.4 m	m	82				
29	균열	0.2 mm	0.4 m	m	83				
30	균열	0.2 mm	0.4 m	m	84				
31	균열	0.2 mm	0.8 m	m	85				
32	균열	0.2 mm	0.5 m	m	86				
33	균열	0.2 mm	0.4 m	m	87				
34	균열	0.2 mm	0.5 m	m	88				
35	균열	0.2 mm	0.8 m	m	89				
36	균열	0.2 mm	0.5 m	m	90				
37	균열	0.2 mm	0.4 m	m	91				
38	균열	0.2 mm	0.8 m	m	92				
39	균열	0.2 mm	0.4 m	m	93				
40	균열	0.2 mm	0.4 m	m	94				
41	균열	1.0 mm	1.6 m	m	95				
42	충반리	0.5 mm	2.0 m	m	96				
43	장계부 균열	0.2 mm	0.6 m	m	97				
44	균열	0.1 mm	0.4 m	m	98				
45	균열	0.2 mm	2.5 m	m	99				
46	장계부 균열	0.2 mm	0.9 m	m	100				
47	균열	0.1 mm	0.2 m	m	101				
48	균열	0.1 mm	0.2 m	m	102				
49	균열	0.1 mm	0.3 m	m	103				
50	균열	0.1 mm	0.3 m	m	104				
51	균열	0.1 mm	0.3 m	m	105				
52	균열	0.1 mm	0.3 m	m	106				
53	균열	0.1 mm	0.3 m	m	107				
54	균열	0.1 mm	0.3 m	m	108				

	시행사	명	여	명	영	여	사	인		장	의	지	구	
								관람	방영					자
	한국철도공사	2017년도 호남고속선 오송-광주승정간 편곡리트케도 정경영여	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 박 영	강 경 기 김 경 기 윤 석 기	원	영		0.3mm이하 : 황색)		천목도상본리			
									0.3mm초과 0.5mm이하 : 청색)		양산			
									0.5mm초과 1.0mm미만 : 적색)		바리,바락,파손			
									1.0mm이상 : 분홍색)		백태			