


하남고속선 중리터널 - 토양노반 - 58(54.840~54.850km, L=10m)

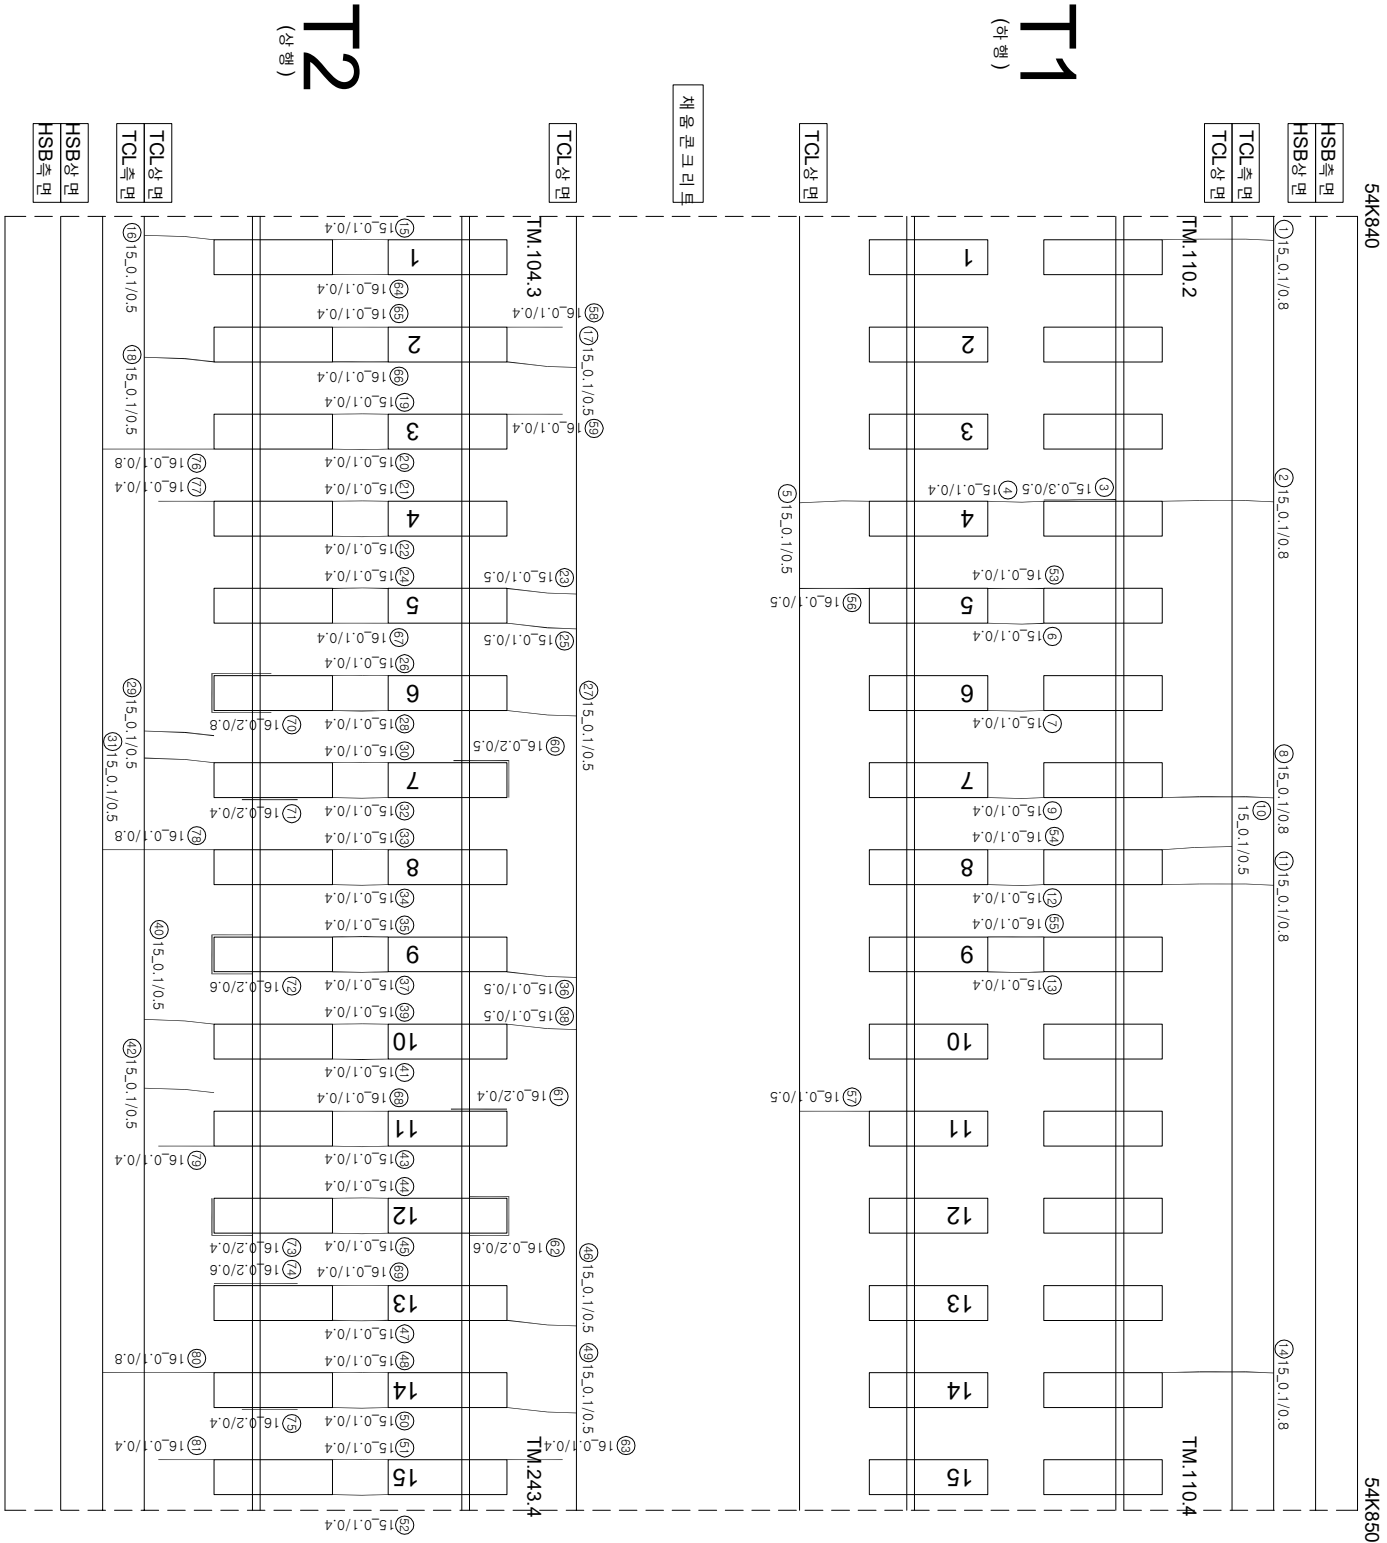

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.8 m		56	균열	0.1 mm	0.4 m	m
2	균열	0.1 mm	0.8 m		55	균열	0.1 mm	0.5 m	m
3	장계부 균열	0.3 mm	0.5 m		57	균열	0.1 mm	0.5 m	m
4	균열	0.1 mm	0.4 m		58	균열	0.1 mm	0.4 m	m
5	균열	0.1 mm	0.5 m		59	균열	0.1 mm	0.4 m	m
6	균열	0.1 mm	0.4 m		60	장계부 균열	0.2 mm	0.5 m	m
7	균열	0.1 mm	0.4 m		61	장계부 균열	0.2 mm	0.4 m	m
8	균열	0.1 mm	0.8 m		62	장계부 균열	0.2 mm	0.6 m	m
9	균열	0.1 mm	0.4 m		63	균열	0.1 mm	0.4 m	m
10	균열	0.1 mm	0.5 m		64	균열	0.1 mm	0.4 m	m
11	균열	0.1 mm	0.8 m		65	균열	0.1 mm	0.4 m	m
12	균열	0.1 mm	0.4 m		66	균열	0.1 mm	0.4 m	m
13	균열	0.1 mm	0.4 m		67	균열	0.1 mm	0.4 m	m
14	균열	0.1 mm	0.8 m		68	균열	0.1 mm	0.4 m	m
15	균열	0.1 mm	0.4 m		69	균열	0.1 mm	0.4 m	m
16	균열	0.1 mm	0.5 m		70	장계부 균열	0.2 mm	0.8 m	m
17	균열	0.1 mm	0.5 m		71	장계부 균열	0.2 mm	0.4 m	m
18	균열	0.1 mm	0.5 m		72	장계부 균열	0.2 mm	0.6 m	m
19	균열	0.1 mm	0.4 m		73	장계부 균열	0.2 mm	0.4 m	m
20	균열	0.1 mm	0.4 m		74	장계부 균열	0.2 mm	0.6 m	m
21	균열	0.1 mm	0.4 m		75	장계부 균열	0.2 mm	0.4 m	m
22	균열	0.1 mm	0.4 m		76	균열	0.1 mm	0.8 m	m
23	균열	0.1 mm	0.5 m		77	균열	0.1 mm	0.4 m	m
24	균열	0.1 mm	0.4 m		78	균열	0.1 mm	0.8 m	m
25	균열	0.1 mm	0.5 m		79	균열	0.1 mm	0.4 m	m
26	균열	0.1 mm	0.4 m		80	균열	0.1 mm	0.8 m	m
27	균열	0.1 mm	0.5 m		81	균열	0.1 mm	0.4 m	m
28	균열	0.1 mm	0.4 m		82				
29	균열	0.1 mm	0.5 m		83				
30	균열	0.1 mm	0.4 m		84				
31	균열	0.1 mm	0.5 m		85				
32	균열	0.1 mm	0.4 m		86				
33	균열	0.1 mm	0.4 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.1 mm	0.4 m		89				
36	균열	0.1 mm	0.5 m		90				
37	균열	0.1 mm	0.4 m		91				
38	균열	0.1 mm	0.5 m		92				
39	균열	0.1 mm	0.4 m		93				
40	균열	0.1 mm	0.5 m		94				
41	균열	0.1 mm	0.4 m		95				
42	균열	0.1 mm	0.5 m		96				
43	균열	0.1 mm	0.4 m		97				
44	균열	0.1 mm	0.4 m		98				
45	균열	0.1 mm	0.4 m		99				
46	균열	0.1 mm	0.5 m		100				
47	균열	0.1 mm	0.4 m		101				
48	균열	0.1 mm	0.4 m		102				
49	균열	0.1 mm	0.5 m		103				
50	균열	0.1 mm	0.4 m		104				
51	균열	0.1 mm	0.4 m		105				
52	균열	0.1 mm	0.4 m		106				
53	균열	0.1 mm	0.4 m		107				
54	균열	0.1 mm	0.4 m		108				

[illegible]