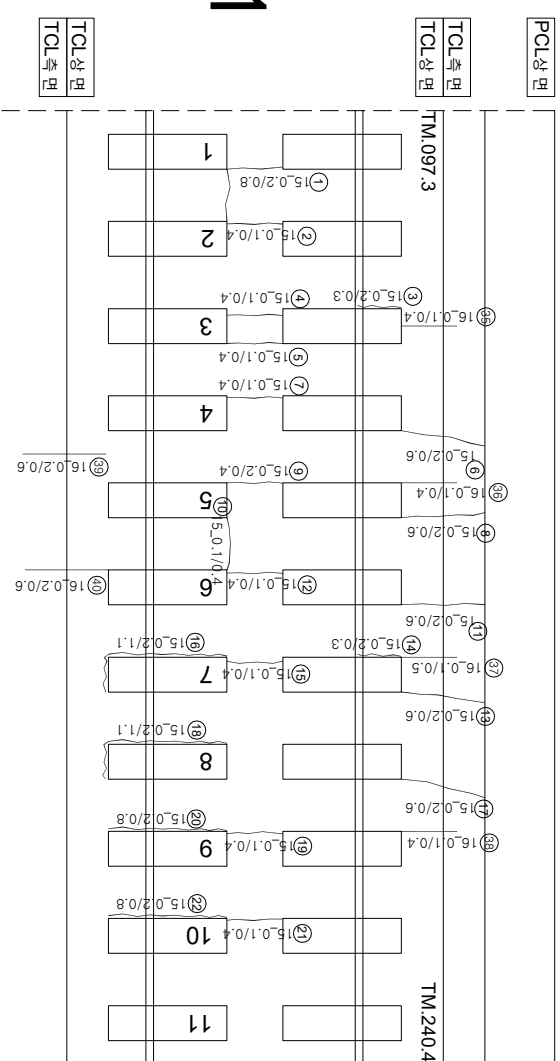


호남고속선 정지고가 344(59.292~59.299km, S65-2)

59K299

59K292


$$\left(\begin{array}{c} \text{아} \\ \text{0호} \end{array} \right)$$


(아
0호)

TCL상면	TCL측면
-------	-------

TCL集团

PCL 상면

PCL 상면

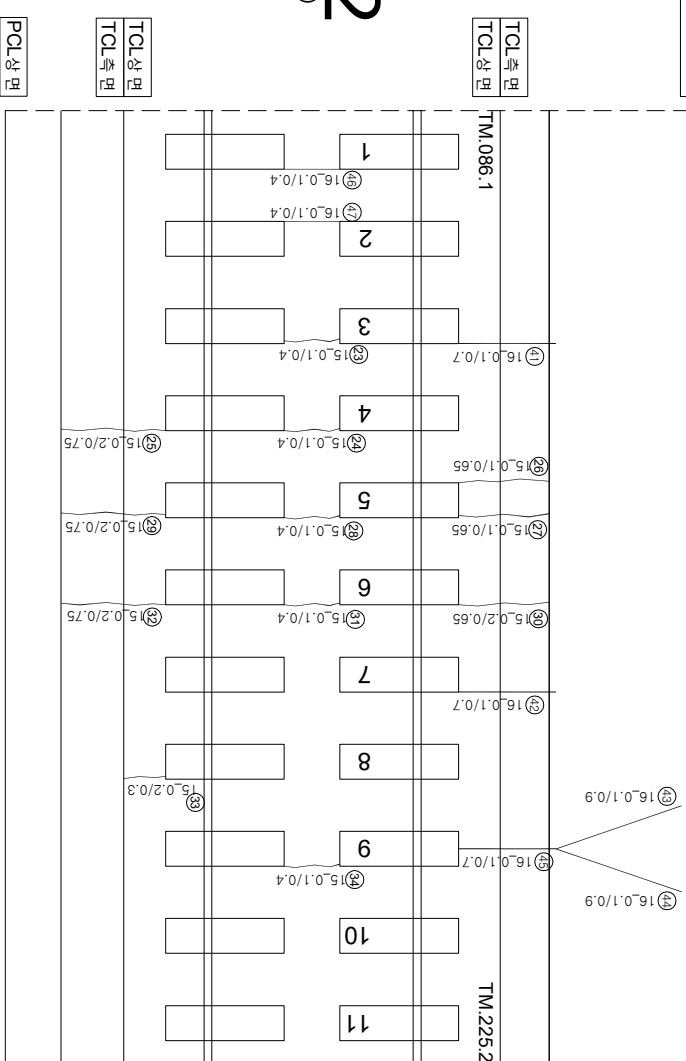

T2
($0\frac{1}{2}$, $0\frac{1}{2}$)

(사
회)

TCL 상면	TCL 측면
--------	--------

TCL 集团

PCL상면

PCL상면

연번	순상	목	연장	비고	연번	순상	목	연장	비고
1	균열	0.2 mm	0.8 m		55				
2	균열	0.1 mm	0.4 m		56				
3	균열부 균열	0.2 mm	0.3 m		57				
4	균열	0.1 mm	0.4 m		58				
5	균열	0.1 mm	0.4 m		59				
6	균열	0.2 mm	0.6 m		60				
7	균열	0.1 mm	0.4 m		61				
8	균열	0.2 mm	0.6 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.1 mm	0.4 m		64				
11	균열	0.2 mm	0.6 m		65				
12	균열	0.1 mm	0.4 m		66				
13	균열	0.2 mm	0.6 m		67				
14	균열부 균열	0.2 mm	0.3 m		68				
15	균열	0.1 mm	0.4 m		69				
16	균열부 균열	0.2 mm	1.1 m		70				
17	균열	0.2 mm	0.6 m		71				
18	균열부 균열	0.2 mm	1.1 m		72				
19	균열	0.1 mm	0.4 m		73				
20	균열부 균열	0.2 mm	0.8 m		74				
21	균열	0.1 mm	0.4 m		75				
22	균열부 균열	0.2 mm	0.8 m		76				
23	균열	0.1 mm	0.4 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.2 mm	0.8 m		79				
26	균열	0.1 mm	0.7 m		80				
27	균열	0.1 mm	0.7 m		81				
28	균열	0.1 mm	0.4 m		82				
29	균열	0.2 mm	0.8 m		83				
30	균열	0.2 mm	0.7 m		84				
31	균열	0.1 mm	0.4 m		85				
32	균열	0.2 mm	0.8 m		86				
33	균열	0.2 mm	0.3 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.1 mm	0.4 m		89				
36	균열	0.1 mm	0.4 m		90				
37	균열	0.1 mm	0.5 m		91				
38	균열	0.1 mm	0.4 m		92				
39	균열	0.2 mm	0.6 m		93				
40	균열	0.2 mm	0.6 m		94				
41	균열	0.1 mm	0.7 m		95				
42	균열	0.1 mm	0.7 m		96				
43	균열	0.1 mm	0.9 m		97				
44	균열	0.1 mm	0.9 m		98				
45	균열	0.1 mm	0.7 m		99				
46	균열	0.1 mm	0.4 m		100				
47	균열	0.1 mm	0.4 m		101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]