


호남고속선 정지 고가_361(59.411~59.418km, S68-4)

59K411

59K418

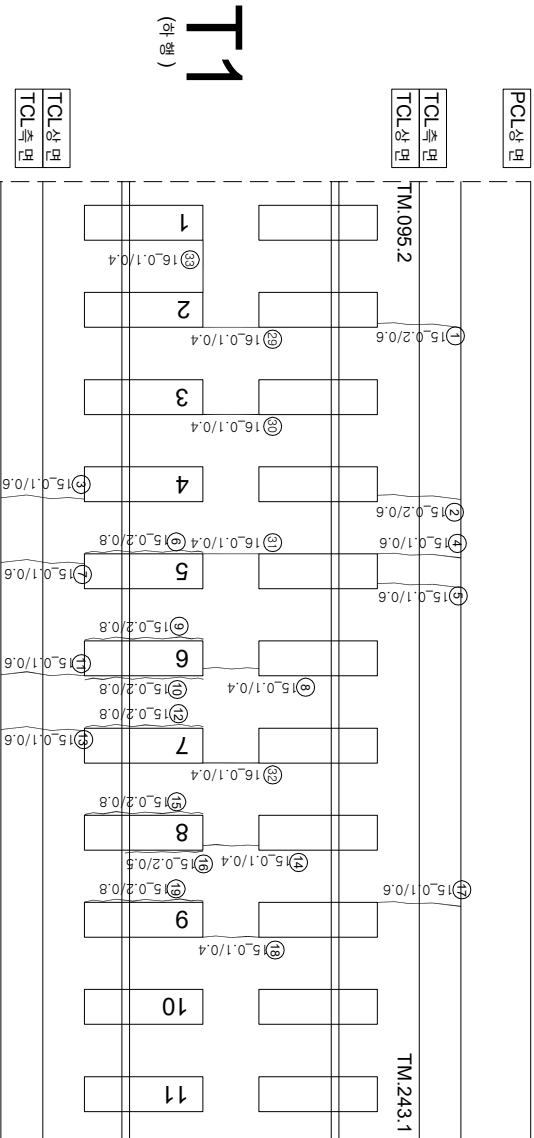


한

(아호)



PCL 상면

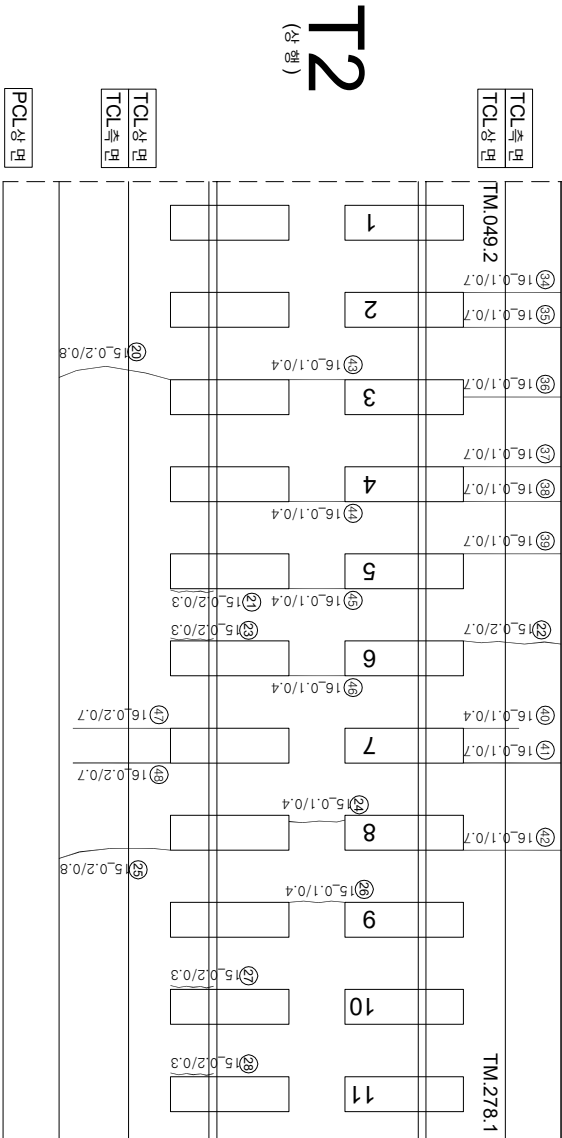

2 (2009)

(가항)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2 mm	0.6 m		55				
2	균열	0.2 mm	0.6 m		56				
3	균열	0.1 mm	0.6 m		57				
4	균열	0.1 mm	0.6 m		58				
5	균열	0.1 mm	0.6 m		59				
6	균열부 균열	0.2 mm	0.8 m		60				
7	균열	0.1 mm	0.6 m		61				
8	균열	0.1 mm	0.4 m		62				
9	균열부 균열	0.2 mm	0.8 m		63				
10	균열부 균열	0.2 mm	0.8 m		64				
11	균열	0.1 mm	0.6 m		65				
12	균열부 균열	0.2 mm	0.8 m		66				
13	균열	0.1 mm	0.6 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열부 균열	0.2 mm	0.8 m		69				
16	균열부 균열	0.2 mm	0.5 m		70				
17	균열	0.1 mm	0.6 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열부 균열	0.2 mm	0.8 m		73				
20	균열	0.2 mm	0.8 m		74				
21	균열부 균열	0.2 mm	0.3 m		75				
22	균열	0.2 mm	0.7 m		76				
23	균열부 균열	0.2 mm	0.3 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.2 mm	0.8 m		79				
26	균열	0.1 mm	0.4 m		80				
27	균열부 균열	0.2 mm	0.3 m		81				
28	균열부 균열	0.2 mm	0.3 m		82				
29	균열	0.1 mm	0.4 m		83				
30	균열	0.1 mm	0.4 m		84				
31	균열	0.1 mm	0.4 m		85				
32	균열	0.1 mm	0.4 m		86				
33	균열	0.1 mm	0.4 m		87				
34	균열	0.1 mm	0.7 m		88				
35	균열	0.1 mm	0.7 m		89				
36	균열	0.1 mm	0.7 m		90				
37	균열	0.1 mm	0.7 m		91				
38	균열	0.1 mm	0.7 m		92				
39	균열	0.1 mm	0.7 m		93				
40	균열	0.1 mm	0.4 m		94				
41	균열	0.1 mm	0.7 m		95				
42	균열	0.1 mm	0.7 m		96				
43	균열	0.1 mm	0.4 m		97				
44	균열	0.1 mm	0.4 m		98				
45	균열	0.1 mm	0.4 m		99				
46	균열	0.2 mm	0.4 m		100				
47	균열	0.2 mm	0.7 m		101				
48	균열	0.2 mm	0.7 m		102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]