


호남고속선 정지 고가_385(59.579~59.586km, S73-3)

59K579

59K586

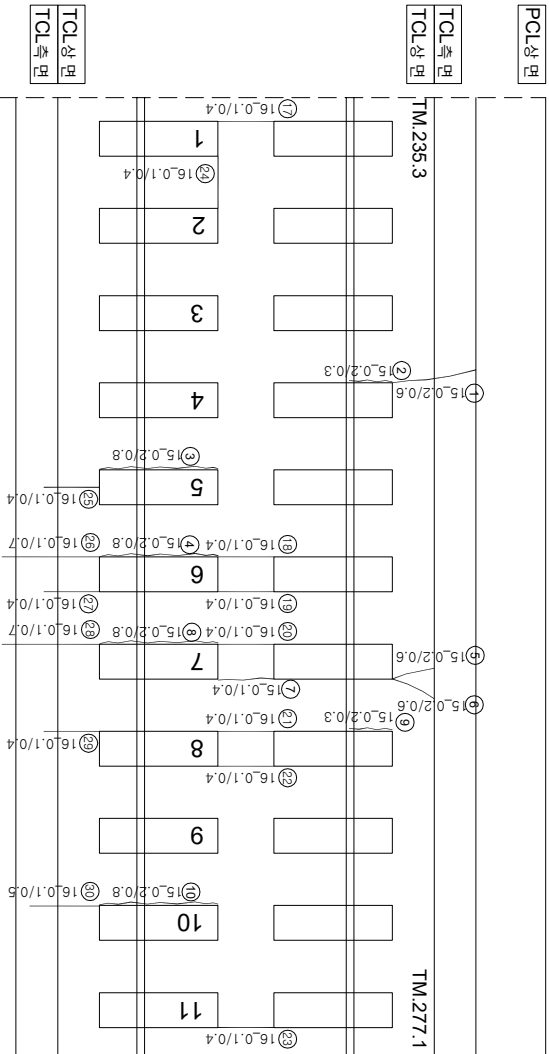


아
호

(아호)



PCL 상용

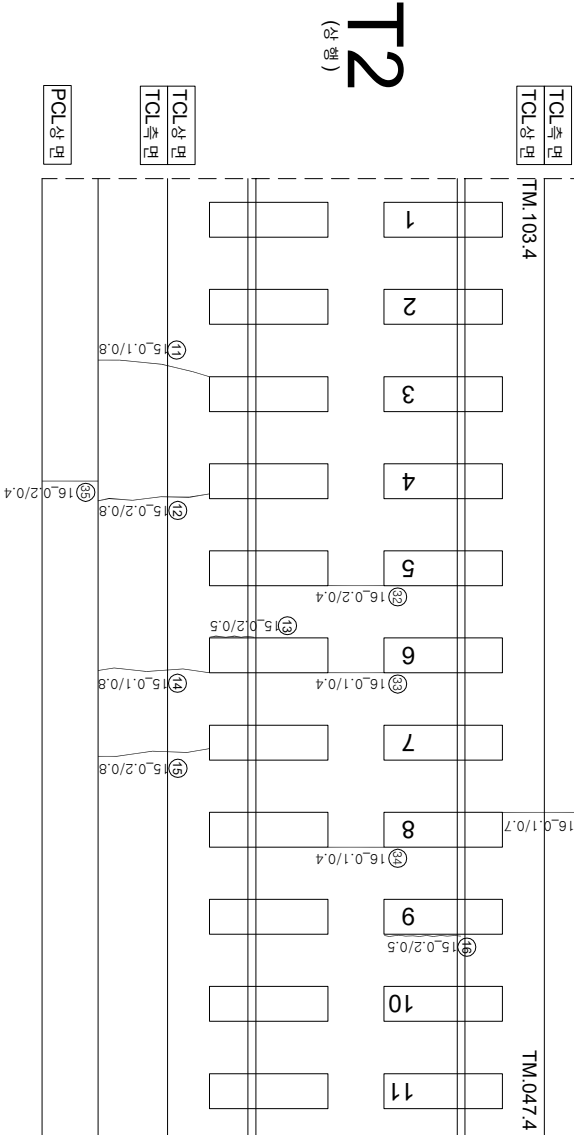

2차 (초, 중, 고)

(가)항

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2 mm	0.6 m		55				
2	관개부 균열	0.2 mm	0.3 m		56				
3	관개부 균열	0.2 mm	0.8 m		57				
4	관개부 균열	0.2 mm	0.8 m		58				
5	균열	0.2 mm	0.6 m		59				
6	균열	0.2 mm	0.6 m		60				
7	관열	0.1 mm	0.4 m		61				
8	관개부 균열	0.2 mm	0.8 m		62				
9	관개부 균열	0.2 mm	0.3 m		63				
10	관개부 균열	0.2 mm	0.8 m		64				
11	균열	0.1 mm	0.8 m		65				
12	균열	0.2 mm	0.8 m		66				
13	관개부 균열	0.2 mm	0.5 m		67				
14	균열	0.1 mm	0.8 m		68				
15	균열	0.2 mm	0.8 m		69				
16	관개부 균열	0.2 mm	0.5 m		70				
17	균열	0.1 mm	0.4 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열	0.1 mm	0.4 m		73				
20	균열	0.1 mm	0.4 m		74				
21	균열	0.1 mm	0.4 m		75				
22	균열	0.1 mm	0.4 m		76				
23	균열	0.1 mm	0.4 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.1 mm	0.4 m		79				
26	균열	0.1 mm	0.7 m		80				
27	균열	0.1 mm	0.4 m		81				
28	균열	0.1 mm	0.7 m		82				
29	균열	0.1 mm	0.4 m		83				
30	균열	0.1 mm	0.5 m		84				
31	균열	0.1 mm	0.7 m		85				
32	균열	0.2 mm	0.4 m		86				
33	균열	0.1 mm	0.4 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.2 mm	0.4 m		89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시행	영역	영역명	영역사	이북영역		경계선			
				관리책임지	장비배치지				
 한국철도공사 KOREA RAILROAD		2017년도 호남고속선 오송-광주순정간 콘크리트케도 점검용역	(주) 한국조물안전연구원 (주) 한도국토안전연구원 (재) 한국건설품질연구원	강원강 김경기 윤석기	단	 0.220 (0.3mm이하 : 흑색)	천목도청문리		재료분리
						 0.420 (0.3mm초과 0.5mm이하 : 청색)	망상		철틈노출
						 0.620 (0.5mm초과 1.0mm미만 : 적색)	바리·벽락, 파손		누수·습윤부
						 1.020 (1.0mm이상 : 분홍색)	변태		시공이음분리, 총분리