



호남고속선 정지 고가_389(59.607~59.614km, S74-2)

59K607

59K614

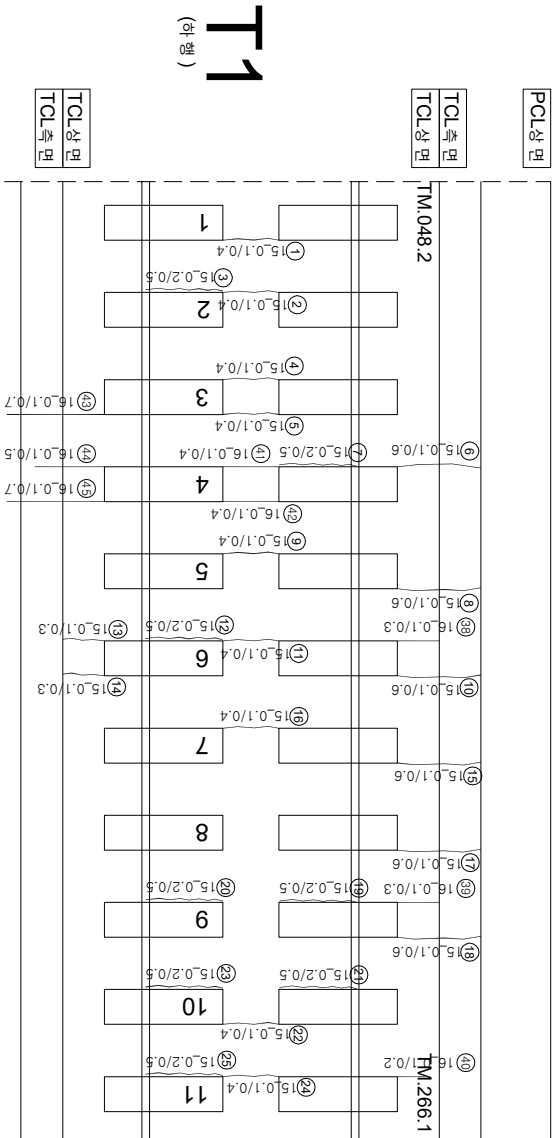


가
(아
0호
)

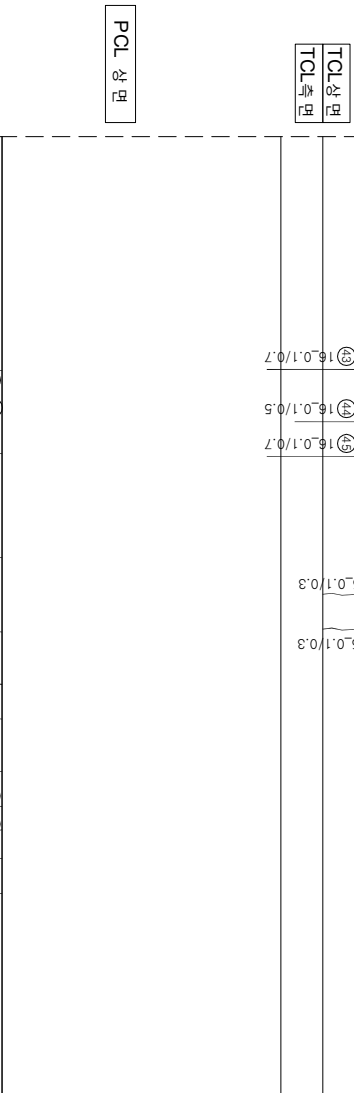(하
0호)
(

PCL 상면

PCL

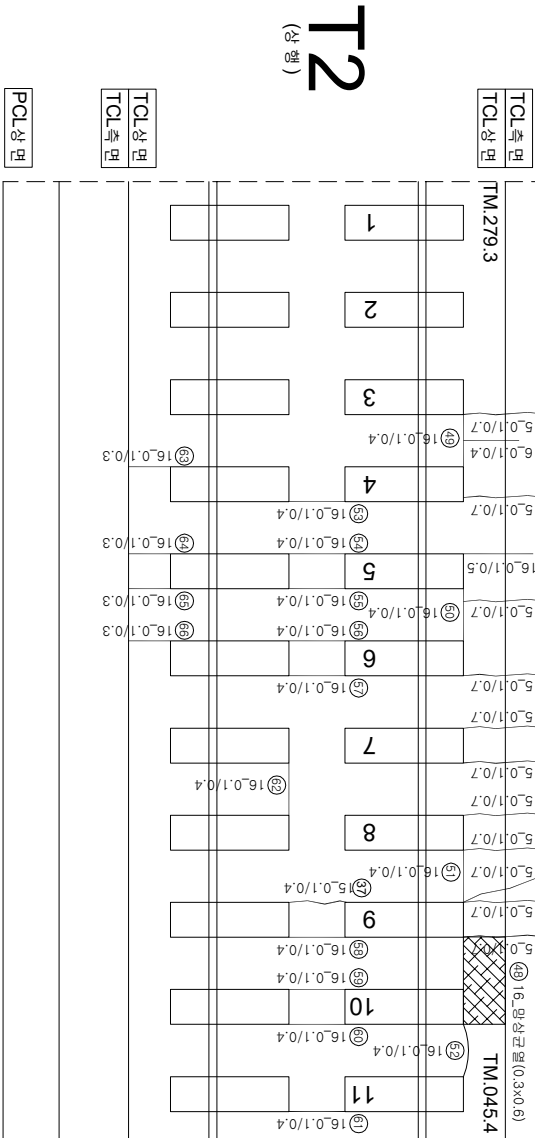

T2 (0.500)

(인재)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		55	균열	0.1 mm	0.4 m	
2	균열	0.1 mm	0.4 m		56	균열	0.1 mm	0.4 m	
3	관개부 균열	0.2 mm	0.5 m		57	균열	0.1 mm	0.4 m	
4	균열	0.1 mm	0.4 m		58	균열	0.1 mm	0.4 m	
5	균열	0.1 mm	0.4 m		59	균열	0.1 mm	0.4 m	
6	균열	0.1 mm	0.6 m		60	균열	0.1 mm	0.4 m	
7	관개부 균열	0.2 mm	0.5 m		61	균열	0.1 mm	0.4 m	
8	균열	0.1 mm	0.6 m		62	균열	0.1 mm	0.4 m	
9	균열	0.1 mm	0.4 m		63	균열	0.1 mm	0.3 m	
10	균열	0.1 mm	0.6 m		64	균열	0.1 mm	0.3 m	
11	균열	0.1 mm	0.4 m		65	균열	0.1 mm	0.3 m	
12	관개부 균열	0.2 mm	0.5 m		66	균열	0.1 mm	0.3 m	
13	균열	0.1 mm	0.3 m		67				
14	균열	0.1 mm	0.3 m		68				
15	균열	0.1 mm	0.6 m		69				
16	균열	0.1 mm	0.4 m		70				
17	균열	0.1 mm	0.6 m		71				
18	균열	0.1 mm	0.6 m		72				
19	관개부 균열	0.2 mm	0.5 m		73				
20	관개부 균열	0.2 mm	0.5 m		74				
21	관개부 균열	0.2 mm	0.5 m		75				
22	균열	0.1 mm	0.4 m		76				
23	관개부 균열	0.2 mm	0.5 m		77				
24	균열	0.1 mm	0.4 m		78				
25	관개부 균열	0.2 mm	0.5 m		79				
26	균열	0.1 mm	0.7 m		80				
27	균열	0.1 mm	0.7 m		81				
28	균열	0.1 mm	0.7 m		82				
29	균열	0.1 mm	0.7 m		83				
30	균열	0.1 mm	0.7 m		84				
31	균열	0.1 mm	0.7 m		85				
32	균열	0.1 mm	0.7 m		86				
33	균열	0.1 mm	0.7 m		87				
34	균열	0.1 mm	0.7 m		88				
35	균열	0.1 mm	0.7 m		89				
36	균열	0.1 mm	0.7 m		90				
37	균열	0.1 mm	0.4 m		91				
38	균열	0.1 mm	0.3 m		92				
39	균열	0.1 mm	0.3 m		93				
40	균열	0.1 mm	0.2 m		94				
41	균열	0.1 mm	0.4 m		95				
42	균열	0.1 mm	0.4 m		96				
43	균열	0.1 mm	0.7 m		97				
44	균열	0.1 mm	0.5 m		98				
45	균열	0.1 mm	0.7 m		99				
46	균열	0.1 mm	0.4 m		100				
47	균열	0.1 mm	0.5 m		101				
48	방식 균열	0.3 mm	0.6 m	0.19 ^m	102				
49	균열	0.1 mm	0.4 m		103				
50	균열	0.1 mm	0.4 m		104				
51	균열	0.1 mm	0.4 m		105				
52	균열	0.1 mm	0.4 m		106				
53	균열	0.1 mm	0.4 m		107				
54	균열	0.1 mm	0.4 m		108				

[illegible]