


호남고속선 정지코가_913(63.264~63.271km, S173-4)

63K264

63K271
173 SPAN - 4

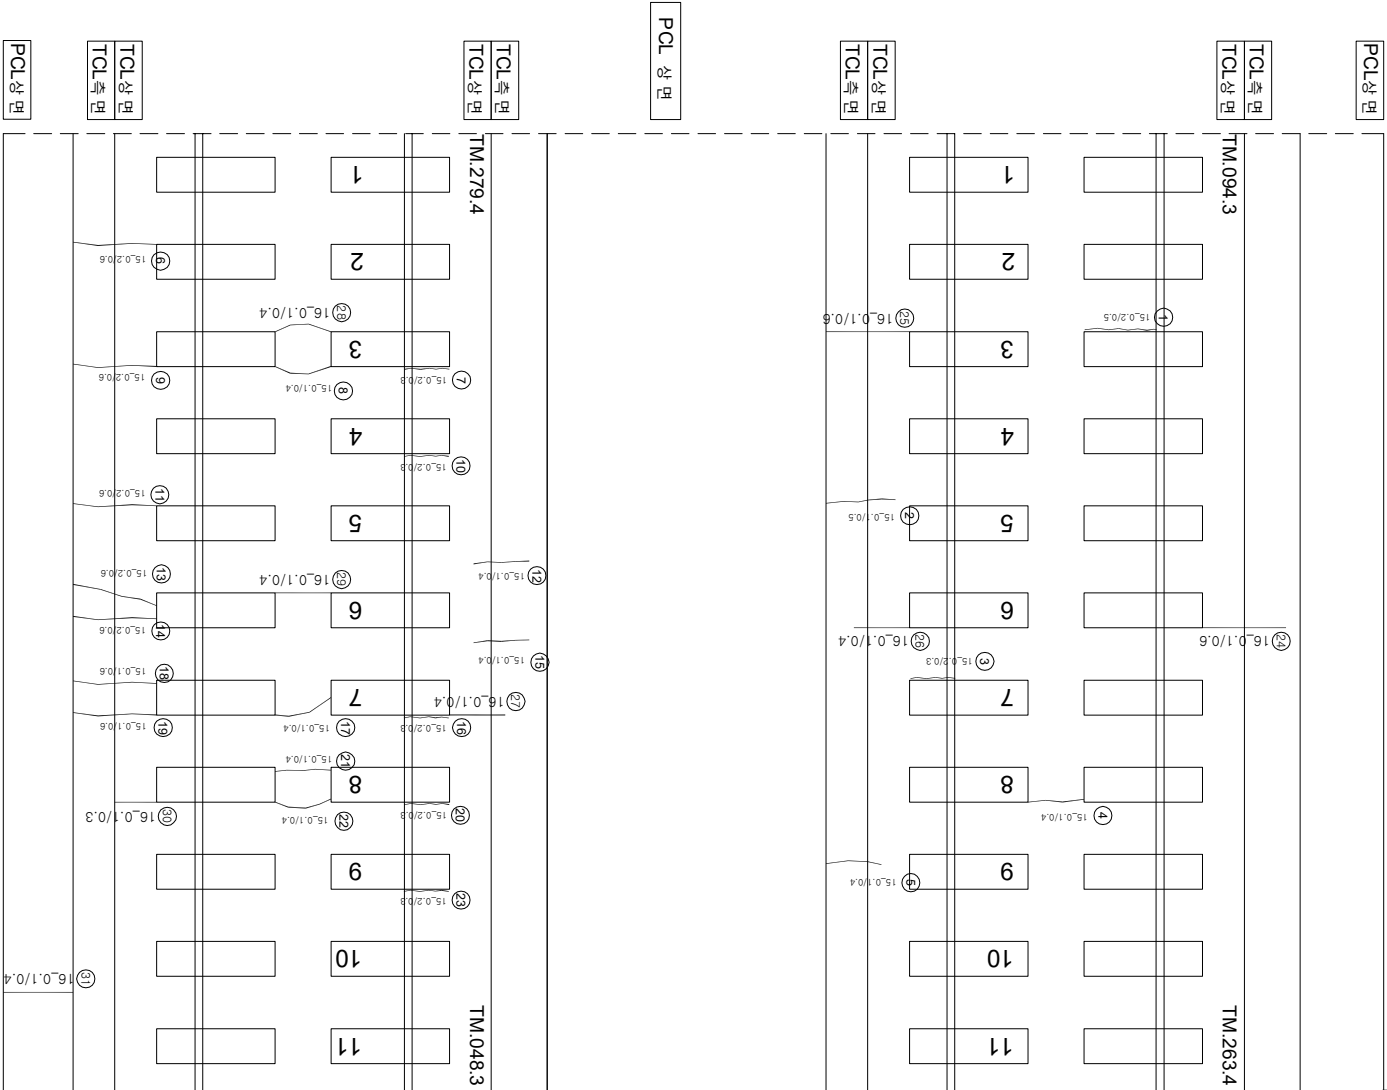

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	강계부 군열	0.2	mm	0.5 m		55			
2	군열	0.1	mm	0.5 m		56			
3	강계부 군열	0.2	mm	0.3 m		57			
4	군열	0.1	mm	0.4 m		58			
5	군열	0.1	mm	0.4 m		59			
6	군열	0.2	mm	0.6 m		60			
7	강계부 군열	0.2	mm	0.3 m		61			
8	군열	0.1	mm	0.4 m		62			
9	군열	0.2	mm	0.6 m		63			
10	강계부 군열	0.2	mm	0.3 m		64			
11	군열	0.2	mm	0.6 m		65			
12	군열	0.1	mm	0.4 m		66			
13	군열	0.2	mm	0.6 m		67			
14	군열	0.2	mm	0.6 m		68			
15	군열	0.1	mm	0.4 m		69			
16	강계부 군열	0.2	mm	0.3 m		70			
17	군열	0.1	mm	0.4 m		71			
18	군열	0.1	mm	0.6 m		72			
19	군열	0.1	mm	0.6 m		73			
20	강계부 군열	0.2	mm	0.3 m		74			
21	군열	0.1	mm	0.4 m		75			
22	군열	0.1	mm	0.4 m		76			
23	강계부 군열	0.2	mm	0.3 m		77			
24	군열	0.1	mm	0.6 m		78			
25	군열	0.1	mm	0.6 m		79			
26	군열	0.1	mm	0.4 m		80			
27	군열	0.1	mm	0.4 m		81			
28	군열	0.1	mm	0.4 m		82			
29	군열	0.1	mm	0.4 m		83			
30	군열	0.1	mm	0.3 m		84			
31	군열	0.1	mm	0.4 m		85			
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행	사	영	여	명	영	여	사	단		
									계	영	장
한국철도공사 KORAIL KOREA RAILROAD											
2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역											
(주) 한국구조물안전연구원 (주)한국도로안전연구원 (재)한국건설품질연구원											
이 복 영											
간윤경 김정기 윤석기											
영											
 0.220 (0.30m이하) : 흑색  0.420 (0.30m초과 0.50m이하) : 청색  0.620 (0.50m초과 1.00m이하) : 적색  1.020 (1.00m이상) : 분홍색											
 한도도장본리  망상  바리,바락,파손  변태											
 재료본리  철근노출  누수,습윤부  시공이음본리,홍본리											